

TSB-35-043-FTL - 6X4 eAxle Breather Hose Relocation to Reduce Water Intrusion Risk

6X4 eAxle Breather Hose Relocation to Reduce Water Intrusion Risk

TSB-35-043-FTL

Creation Date: 2026-08-19

Engine or Vehicle Affected:

► eCascadia

Warranty applies to this described condition. See the warranty information at the end of this bulletin.

Described Condition

eCascadia 6x4 vehicles built from January 4, 2023 through February 23, 2026, have an axle breather hose that terminates on the side of the eCarrier in an area exposed to high road spray. During operation in wet conditions, water may enter the axle housing through the breather system and contaminate the axle lubricant. Contaminated lubricant may appear milky during routine maintenance inspections, such as axle oil level checks or oil changes. If this condition is found, update the axle housing vent line routing using the procedure in this bulletin.

Table 1, Parts Table

Part Number	Description	Quantity
A 000 987 27 27	PIPE - PLASTIC	29 ft
23-14137-000	CABLE TIE ASSEMBLY - FIR TREE MOUNT	1
23-13476-000	TIE - CLAMP, 0.5 WIDTH, 15 LENGTH, 4.13 BUNDLE	12

Table 1, Parts Table

[35-043 6X4 eAxle Breather Hose Relocation to Reduce Water Intrusion Risk - Technical Literature](#)

