



Service Bulletin

Bulletin No.: PIC6583J

Date: August, 2026

PRELIMINARY INFORMATION

Subject: U018B Set Current in One or More Modules

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	LYRIQ	2023 - 2025		All	All	All	All
Cadillac	OPTIQ	2025		All	All	All	All
Cadillac	CELESTIQ	2025		All	All	All	All
Cadillac	ESCALADE IQ	2025		All	All	All	All
Chevrolet	Silverado EV	2025		All	All	All	All
GMC	Sierra EV	2025		All	All	All	All

Involved Region or Country	North America, Middle East, Australia, New Zealand, Europe, Israel, Japan, and S. Korea
Condition	A customer may comment one or more of the following concerns: NFC key card inop (Model Year 2025 only), Service vehicle soon light, Service OnStar message. After performing a diagnostic DTC scan a U018B may be found setting current.
Cause	K183 UHF module logic locked

Correction

Perform a global reset by disconnecting 12V battery for 30 minutes, using Document ID: 6307865 Battery Negative Cable Disconnection and Connection.

If the K183 (UHF) module recovers from being offline, then the K183 will require the latest K183 24.169.1.3 or greater software to be flashed into the module, perform K183 UHF module reprogramming with SPS.

If the 12V battery reset does not recover the K183 offline issue, then K183 module replacement is required.

In which service will install a new K183 At the latest software level of 24.169.1.3 or greater.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
*6480028	System Reset	0.5 Hr.
2811735	UHF K183 Programming	Use Published Time
6430600	UHF Short Range Low Energy Remote Control Access Transceiver Replacement	Use Published Time
*This is a unique Labor Operation for Bulletin use only.		

Version	9
Modified	10/25/2024 - Created on. 02/25/2025 - Updated correction. 03/25/2025 - Updated Correction and Labor Operation. 04/11/2025 - Updated Unique labor operation. 05/05/2025 - Updated Region and Correction. 08/22/2025 - Updated makes and models. 08/25/2025 - Updated verbiage under correction. 08/27/ 2025 - Updated models. 03/19/2026 - Updates to the models, condition, warranty, and correction sections. 08/28/2026 - Updated to remove VWP and add regular programming,

