



SERVICE BULLETIN

ID No. SB-26-005
Ref. No. HP / TERN - 07292026
Release Date 8/12/26

CHARGE DOOR RELEASE CABLE – SB-26-005

OVERVIEW

Charge Door Release Cable

In some instances, the original charge door release cable may bind, causing the latch to remain in its open position and preventing the charge door from closing. A longer cable is available to address this concern. Replace the charge door cable using the service procedure below.

SUBJECT VEHICLES

All Le-Series and RC8 vehicles built prior to 8/12/26

Parts

Charge Door Release Cable	49800198	Qty 1
Thread Locker (acquire locally)	ThreadLocker 242 or equivalent	Qty 1

SERVICE BULLETIN

ID No. SB-26-005
Ref. No. HP / TERN - 07292026
Release Date 8/12/26

SERVICE PROCEDURE

1. From behind the charge door (reaching up from below the step), release the cable from the charge door by rotating the cable end lock, and sliding the cable sleeve out of the mounting bracket.




SERVICE BULLETIN


ID No. SB-26-005
Ref. No. HP / TERN - 07292026
Release Date 8/12/26

SERVICE PROCEDURE

2. Remove 11 bolts and 8 nuts from the top and side of the step, and remove the driver's side upper step pad. (13.5 ft-lbs on reassembly)

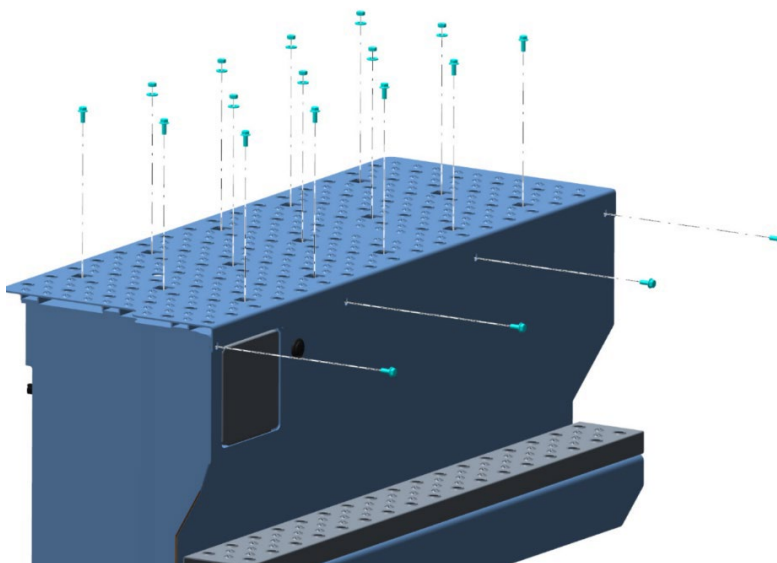

3. Remove 6 nuts from below the battery crash protection. (13.5 ft-lbs on reassembly)

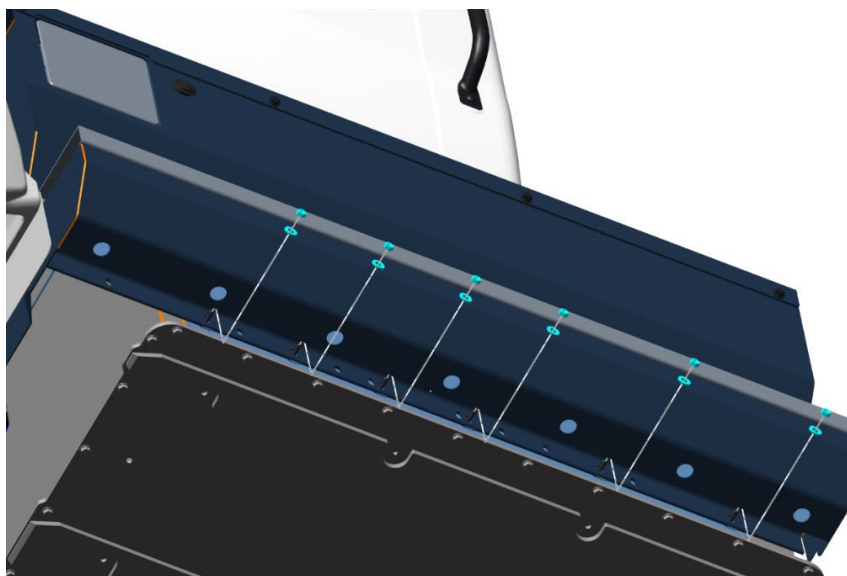


SERVICE BULLETIN

ID No. SB-26-005
Ref. No. HP / TERN - 07292026
Release Date 8/12/26

SERVICE PROCEDURE

4. From the rear corner of the crash protection, access the cable by angling the crash protection outward and disconnect the cable from the charge door release button.

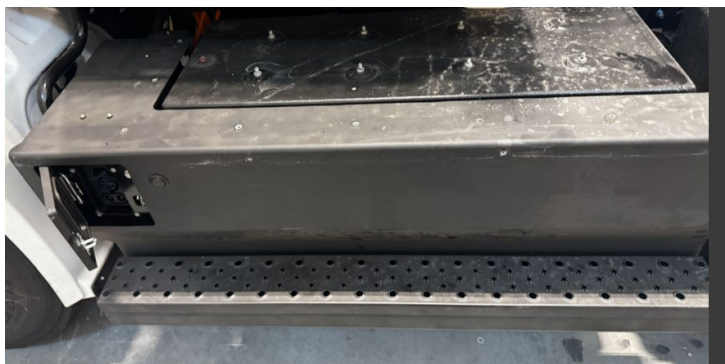



SERVICE BULLETIN

ID No. SB-26-005
Ref. No. HP / TERN - 07292026
Release Date 8/12/26

SERVICE PROCEDURE

5. Release the retaining clip, remove and discard the charge door release cable.



6. Install the new cable in reverse order and verify operation. Torque all crash protection and step plate bolts to 13.5 ft-lbs using the suggested threadlocker.

CLAIM APPLICATION

Warranty Status:

Covered under Hino or Hexagon Purus limited warranty

Labor Time:

- Cable Replacement: 1.0 hr