



HUSQVARNA TECHNICAL BULLETIN HTB2608

AUGUST 20, 2026

RECALL - REMEDY NOTICE

THIS MODIFICATION HAS TOP PRIORITY AND MUST BE PERFORMED IMMEDIATELY TO ENSURE CUSTOMER SAFETY

REAR BRAKE CALIPER REPLACEMENT

AFFECTED MODELS:

2022 FE 350s and FE 501s

2023 FE 350s and FE 501s

2024 FE 350s and FE 501s

RESTRICTIONS: AFFECTED MODELS ARE LINKED BY VIN IN DEALER.NET

BASIC INFORMATION:

Husqvarna Mobility North America, Inc. has determined that a defect which relates to motor vehicle safety exists with certain model motorcycles listed above.

During backwards rolling, the rear brake caliper may crack near the primary pin casting, which may cause the caliper to break when riding.

Cracks or breaks in the rear brake caliper can reduce braking ability, increasing the risk of a crash.

To remedy this defect, the rear brake caliper including the caliper bracket must be replaced on all affected motorcycles.

Husqvarna Mobility North America, Inc. is notifying all registered owners of affected motorcycles by mail. A copy of the customer letter is included in this bulletin. The customer should take the letter along with the affected motorcycle to an authorized Husqvarna motorcycles dealer to have the rear brake caliper replaced.

Dealers must replace the rear brake caliper including the caliper bracket on affected motorcycles in their inventory prior to any customer delivery.

Any affected motorcycles received directly from Husqvarna Mobility North America, Inc. require having the rear brake caliper replaced prior to customer delivery. Affected motorcycles acquired through dealer transfers or

COPYRIGHT NOTICE

The user acknowledges that all components of this technical information are Husqvarna's and/or third parties' copyright protected property. Alteration, assignment, distribution and reproduction are forbidden.

LIMITATION OF LIABILITY

The information included in or available through this technical information may include inaccuracies or errors. In no event shall Husqvarna and/or its suppliers be liable for any damages whatsoever, arising out of or in connection with the use of this technical information. Please always refer to the Husqvarna owners and repair manuals for proper instructions or contact the Husqvarna Dealer Services Department. ©2026 Husqvarna Mobility North America, Inc. – All rights reserved



trades must be remedied and checked in Husqvarna Dealer.net to ensure and document that the repair has been performed.

Motorcycles that are affected must not be sold until the rear brake caliper replacement procedure is performed as described in this bulletin.

It is a violation of Husqvarna Mobility North America, Inc. policy for an authorized Husqvarna motorcycles dealer to deliver any affected units to customers before the procedure in this bulletin has been performed.

Husqvarna Mobility North America, Inc. must report to the federal government on a regular basis how many motorcycles have been inspected and repaired during this campaign. Be sure to submit your warranty request for reimbursement on every unit repaired to ensure accurate compliance numbers.

PROCEDURE FOR REPAIR:

Replacing the rear brake caliper:

1. Jack up the vehicle on jack stands and secure it to prevent it from rolling away.
2. Remove the rear wheel.
3. Remove the brake caliper (including the bracket) from the vehicle and disconnect the brake line.
4. Remove the brake pads, bolts, and split pins, as well as the bleed screw kit, from the “old” caliper and install them in the “new” caliper.
5. Reattach the brake line to the caliper; see Table 1 for torque specifications.
6. Reinstall the brake caliper, including the new bracket, onto the vehicle.
7. Reinstall the rear wheel.
8. Bleed the brake system.
9. Take a short test drive to ensure the brake system is functioning properly.
10. Render the old part unusable (e.g., by sawing it in half), document this in the warranty claim with a photo, and store it in accordance with the retention period.
11. Create a warranty claim with photographic documentation of the “old” brake caliper on Dealer.net.

Warning:

Health hazard: Brake fluid is a substance that is harmful to health.

- Keep brake fluid out of the reach of children.
- Wear appropriate protective clothing and safety goggles.
- Avoid contact between brake fluid and your skin, eyes, or clothing.
- Seek medical attention immediately if brake fluid has been swallowed.
- If brake fluid comes into contact with your skin, rinse the affected area thoroughly with plenty of water.

COPYRIGHT NOTICE

The user acknowledges that all components of this technical information are Husqvarna's and/or third parties' copyright protected property. Alteration, assignment, distribution and reproduction are forbidden.

LIMITATION OF LIABILITY

The information included in or available through this technical information may include inaccuracies or errors. In no event shall Husqvarna and/or its suppliers be liable for any damages whatsoever, arising out of or in connection with the use of this technical information. Please always refer to the Husqvarna owners and repair manuals for proper instructions or contact the Husqvarna Dealer Services Department. ©2026 Husqvarna Mobility North America, Inc. – All rights reserved



- If brake fluid gets into your eyes, rinse them thoroughly with water immediately and seek medical attention.
- If brake fluid gets on your clothing, remove the clothing and change into clean clothes.

Warning:

Risk of Accident: Stale or unsuitable brake fluid impairs the function of the brake system.

- Make sure to use only clean, approved brake fluid from a tightly sealed container.

Note:

Environmental hazard: Hazardous substances cause environmental damage.

- Dispose of oils, greases, filters, fuel, cleaning agents, brake fluid, etc., properly and in accordance with applicable regulations.

Note:

Avoid contact between brake fluid and painted surfaces. Brake fluid corrodes paint. Husqvarna Mobility shall not be held responsible for any contamination of painted surface occurring in this area of the motorcycle following completion of this bulletin.

We shall not provide a description of general workshop methods. Likewise, safety rules that apply in a workshop are not specified here. It is assumed that the repair work will be performed by a fully trained mechanic who has completed training or has a corresponding qualification. In the event of uncertainty, the most recent repair manual must be consulted.

In the interest of clarity, some components may be shown disassembled or may not be shown at all. It is not always necessary to disassemble the component to perform the activity in question. Please follow the instructions in the text.

Table 1:

Component	Screw	Torque	Remarks
Screw, Fitting	M10	30 Nm	
Bleed screw	M8	4 Nm	

VEHICLE LOCK INFORMATION:

Unsold motorcycles that are linked to this recall are locked in the vehicle history. The vehicle lock prevents the motorcycle from being retailed to a customer before the recall is performed. In order to unlock the vehicle you must perform the recall and then submit a TI claim. After the TI claim is submitted it will be possible to unlock and retail the motorcycle.

COPYRIGHT NOTICE

The user acknowledges that all components of this technical information are Husqvarna's and/or third parties' copyright protected property. Alteration, assignment, distribution and reproduction are forbidden.

LIMITATION OF LIABILITY

The information included in or available through this technical information may include inaccuracies or errors. In no event shall Husqvarna and/or its suppliers be liable for any damages whatsoever, arising out of or in connection with the use of this technical information. Please always refer to the Husqvarna owners and repair manuals for proper instructions or contact the Husqvarna Dealer Services Department. ©2026 Husqvarna Mobility North America, Inc. – All rights reserved



PARTS ORDERING:

Note: Different part numbers for the rear brake caliper are used based on the model, model year and axle size. Make sure to order correct part number that matches the model the rear brake caliper is being replaced on.

1 piece #A54013080144 – Rear brake caliper for TI (20 mm axle)

2 pieces #0603100141 – CU sealing ring DIN7603 – 10x14x1

2022 FE 350s

2022 FE 501s

2023 FE 350s

2023 FE 501s

1 piece #A59013080244 – Rear brake caliper for TI (22mm axle)

2 pieces #0603100141 – CU sealing ring DIN7603 – 10x14x1

2024 FE 350s

2024 FE 501s

WARRANTY INPUT INFORMATION:

This Technical Bulletin only affects certain VIN numbers! Please check the VIN by performing a Motorcycle History search in Husqvarna Dealer.net to determine if it's affected. If the motorcycle is affected you will see a link to the bulletin and its repair status in the history results. Husqvarna Mobility North America, Inc. will not warranty units whose VIN numbers are not listed as this bulletin does not apply to them. It is the responsibility of the dealer to determine if the unit requires this update by checking the vehicle history and understanding the instructions provided by this bulletin.

To submit a TI claim click the arrow on the right side of the corresponding technical information message to start the claim process.

You can now choose the TI Number from the list. The TI number for this procedure is according to the repairs performed and listed in the warranty claim input information; click **Continue with selected action code**.

The Warranty Claim is automatically entered for you, including parts & labor. You must enter additional information in the required fields marked with an asterisk "*" before submitting the claim to Husqvarna motorcycles. The flat rate time for this repair is based on the action performed and provided in minutes.

COPYRIGHT NOTICE

The user acknowledges that all components of this technical information are Husqvarna's and/or third parties' copyright protected property. Alteration, assignment, distribution and reproduction are forbidden.

LIMITATION OF LIABILITY

The information included in or available through this technical information may include inaccuracies or errors. In no event shall Husqvarna and/or its suppliers be liable for any damages whatsoever, arising out of or in connection with the use of this technical information. Please always refer to the Husqvarna owners and repair manuals for proper instructions or contact the Husqvarna Dealer Services Department. ©2026 Husqvarna Mobility North America, Inc. – All rights reserved



Warranty type:
TI-Warranty
Assembly group:
13 – Brake System
Failure code:
900 – Trouble Shooting at Manufacturer`s Site
Failure causing part:
A54013095000 – Kit bleeder M10
Action code, parts, labor:
Rear brake caliper replacement: Action code 00: 13_2698518_00 Labor time: 30 minutes Parts: 1 piece #A54013080144 – Rear brake caliper for TI (20 mm axle) 2 pieces #0603100141 – CU sealing ring DIN7603 – 10x14x1 1 piece #GA06 – Brake fluid Action code 01: 13_2698518_01 Labor time: 30 minutes Parts: 1 piece #A54113080244 – Rear brake caliper for TI (25mm axle) 2 pieces #0603100141 – CU sealing ring DIN7603 – 10x14x1 1 piece #GA06 – Brake fluid Action code 02: 13_2698518_02 Labor time: 30 minutes Parts: 1 piece #A59013080244 – Rear brake caliper for TI (22mm axle) 2 pieces #0603100141 – CU sealing ring DIN7603 – 10x14x1 1 piece #GA06 – Brake fluid
Are stock parts affected:
YES – all brake calipers #A54013080000, #A54113080000, #A54113080100, #A59013080000, and #A59013080100 in stock at dealers must also be replaced and returned to the parts warehouse via RMA.

COPYRIGHT NOTICE

The user acknowledges that all components of this technical information are Husqvarna's and/or third parties' copyright protected property. Alteration, assignment, distribution and reproduction are forbidden.

LIMITATION OF LIABILITY

The information included in or available through this technical information may include inaccuracies or errors. In no event shall Husqvarna and/or its suppliers be liable for any damages whatsoever, arising out of or in connection with the use of this technical information. Please always refer to the Husqvarna owners and repair manuals for proper instructions or contact the Husqvarna Dealer Services Department. ©2026 Husqvarna Mobility North America, Inc. – All rights reserved



IMPORTANT SAFETY RECALL NOTICE

NHTSA Recall No. xxxxxxxx

This notice applies to your motorcycle, VIN: «Vin»
«PdiFirstName» «PdiLastName»
«PdiAddress1»
«PdiCity», «PdiProvince» «PdiPostalCode»

8/xx/2026

RE: Affected models:

2022 FE 350s and FE 501s
2023 FE 350s and FE 501s
2024 FE 350s and FE 501s

Dear Husqvarna motorcycle customer,

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Husqvarna Mobility North America, Inc. has determined that a defect which relates to motor vehicle safety exists with certain model motorcycles listed above.

During backwards rolling, the rear brake caliper may crack near the primary pin casting, which may cause the caliper to break when riding.

Cracks or breaks in the rear brake caliper can reduce braking ability, increasing the risk of a crash.

To remedy this defect, dealers will replace the rear brake caliper including the caliper bracket on all affected motorcycles, free of charge.

Please contact your authorized Husqvarna motorcycles dealer (log onto www.husqvarna-motorcycles.com for a complete dealer listing) as soon as possible to arrange having the rear brake caliper replaced. It is suggested that you call your local authorized Husqvarna motorcycles dealer to make an appointment to have the recall repair performed. The procedure will take approximately 30 minutes. However, it may be necessary to leave your motorcycle with the dealer for a longer period of time depending on their work schedule and if they need to order replacement parts. Please present a copy of this letter along with your motorcycle to your local authorized Husqvarna motorcycles dealer.

If you have any questions related to the content of this letter, please contact Husqvarna Mobility North America, Inc. Customer Relations at (888) 985-6090 for assistance.

If your dealer fails or is unable to remedy this defect without charge, or within a reasonable amount of time, you may submit a written complaint to Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue, S.E., Washington, DC 20590 or call 1-888-327-4236 (TTY: 1-800-424-9153); or go to <http://www.nhtsa.gov>

If you have sold, traded or no longer own this motorcycle, it is important for the safety of the current owner that you inform Husqvarna Mobility North America, Inc. of current ownership or unknown ownership status by returning the second page of this letter in the enclosed self-addressed prepaid postage envelope.

If you are a vehicle lessor, Federal Regulations require you to forward this notice to your lessee within ten days.

If you have already paid for a repair related to this concern before the date of this letter, you may be eligible for reimbursement. Please contact Husqvarna motorcycles Customer Relations at the number above for more information.

We apologize for any inconvenience and want to assure you that our commitment together with all Husqvarna motorcycles Dealers is to provide you with the highest level of service, support and customer satisfaction.

COPYRIGHT NOTICE

The user acknowledges that all components of this technical information are Husqvarna's and/or third parties' copyright protected property. Alteration, assignment, distribution and reproduction are forbidden.

LIMITATION OF LIABILITY

The information included in or available through this technical information may include inaccuracies or errors. In no event shall Husqvarna and/or its suppliers be liable for any damages whatsoever, arising out of or in connection with the use of this technical information. Please always refer to the Husqvarna owners and repair manuals for proper instructions or contact the Husqvarna Dealer Services Department. ©2026 Husqvarna Mobility North America, Inc. – All rights reserved

Husqvarna Mobility North America, Inc.
30125 KTM Way | Murrieta, CA 92563
1119 Milan Ave. | Amherst, OH 44001
8701 Samuel-Hatt | Chambly, QC, J3L 6V4

Dealer Services Department
P: 855- 282-1054
www.husqvarna-motorcycles.com



Best Regards,
Dealer Services Department
Husqvarna Mobility North America, Inc.

COPYRIGHT NOTICE

The user acknowledges that all components of this technical information are Husqvarna's and/or third parties' copyright protected property. Alteration, assignment, distribution and reproduction are forbidden.

LIMITATION OF LIABILITY

The information included in or available through this technical information may include inaccuracies or errors. In no event shall Husqvarna and/or its suppliers be liable for any damages whatsoever, arising out of or in connection with the use of this technical information. Please always refer to the Husqvarna owners and repair manuals for proper instructions or contact the Husqvarna Dealer Services Department. ©2026 Husqvarna Mobility North America, Inc. – All rights reserved