

Audi On-car analysis list from August 23, 2026

Please contact Audi Helpline before attempting repair

Please see TSB 2066297 '00 VIN-4-PIN reporting program (V4P, vin4pin) for more info about the program

	Models	MY	Engine	Trans	Topic	Topic details
	Q5 PHEV	2024-2025	PHEV	PHEV	Check engine light after charging	Verify the customer concern. Check DTC memory (P0E5E00: BATTERY CHARGER CONTROL MODULE PROCESSOR PERFORMANCE) is stored in the 008C <u>Contact TAC for further direction</u>
	S3, RS3, S5, RS5, SQ5	2023-2025	Any	Any	Rattle noise from sound generator	Vehicles with With Sound generator 3QF 907 601 Video recording showing noise BEFORE any work is performed What was found during TSB 2074729 Is a new sound generator needed? If so provide findings. <u>Contact TAC for further direction</u>
	Q4	2022-2023	Any	Any	Vehicle sound Malfunction warning	Warning message relating to the sound generator is able to be duplicated TSB PSS 2071352 applies System otherwise works No DTC Potential on-site needed <u>Contact TAC for further steps</u>
	RS3	2025-2026	Any	Any	Oil leak from oil filter drain off valve	Oil leaking from the oil filter housing or the oil filter drain off valve. Photo of leak clearly showing the source of the leak and the volume of the leak <u>Possible on-site inspection</u>
	A5 (FU) Q5 (GU)	2025, 2026	Any	Any	CEL: P003A00 Turbo Boost control A	Before performing work on the vehicle proceed as follows: 1. <u>Please</u> verify fault P003A00, and or P00AF00 is set. 2. <u>Run</u> test plan for faults make sure to check resistance at wastegate module 3. <u>Open tac case and report back findings</u>
	A5 (FU) Q5 (GU)	2025, 2026	Any	Any	CEL: P045600	Before performing work on the vehicle proceed as follows: 1. <u>P045600</u> EVAP Emission Contr. Sys. (very small Leak) Leak Detected 2. <u>Proceed</u> with normal diagnosis. If LDP is causal please verify the leak detection pump that is installed on the vehicle is a "L" suffix pump not a "F", or "P". 3. <u>If</u> the installed part is an "L" suffix please contact TAC for further instruction
	A3	2022-2023	2.0L	Any	excessive engine vibration	Before performing work on the vehicle proceed as follows: 1. <u>Please</u> verify noise/vibration coming from engine bay. 2. <u>If</u> crankshaft damper is found to be causal, contact TAC