



Connection offline

Technical Service Bulletin

Transaction No.: **2081726/2**

44 Center cover fitted too loosely in wheel rim

Release date: Aug 21, 2026

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
RS Q8	2025 – 2027	All	With PR Codes: 64H, and 64J

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised header (Add Model Year)
1	04/21/2026	Initial publication

Customer states:

- The center wheel cap is not fitted securely enough in the wheel rim.

Workshop findings:

- The complaint can be reproduced.
- No damage can be detected on the center wheel cap or the wheel rim.

Technical Background

Unfavorable tolerances between the hole in the center of the wheel rim and the center of the wheel cap.

Production Solution

Not applicable.

Service

- Remove the retaining ring from the center wheel cap.



- Press the two ends of the retaining ring slightly further apart to increase the pre-tensioning force.



- Reinstall the retaining ring in the center wheel cap and then fit the center wheel cap in the wheel rim.



It is not necessary to replace the wheel rim or the center wheel cap.

Warranty

The TSB number must always be noted in the “HST number” field in SAGA for ease of processing.

Claim Type:	If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.
Service Number:	4415
Damage Code:	0018

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2081726**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, LLC / Audi Canada Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, LLC / Audi Canada Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.