

Technical Service Bulletin

Transaction No.: **2082125/2**

43 Anti-theft alarm system triggered without any apparent reason (vehicles with air suspension)

Release date: Aug 12, 2026

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
A6 Sportback e-tron, S6 Sportback e-tron, Q6 e-tron, Q6 Sportback e-tron, SQ6 e-tron, and SQ6 Sportback e-tron	2025 2027	All	With PR Code: 2MA or 1BS Or 1BK or 2MB or 1BU
Q5, Q5 Sportback, SQ5, and SQ5 Sportback	2025 – 2026		
A6	2026 – 2027		

REVISION HISTORY

Revision	Date	Purpose
2	-	Revised header (Add Model Year)
1	05/27/2026	Initial publication

Customer states:

The anti-theft alarm system is triggered without any apparent reason.

Workshop findings:

The anti-theft alarm system was triggered by the inclination sensor. There are no DTCs about the event in any control units.

Technical Background

Under certain circumstances, a leak in the air suspension may cause the anti-theft alarm system to be triggered (by the inclination sensor).

Production Solution

Not applicable

Service

Please perform the following steps one after another:

1. To determine the reason why the anti-theft alarm system was triggered in diagnostic address 0009, read the measured values “History data anti-theft alarm” or “Anti-theft alarm history data”.
2. If the inclination sensor is logged in this measured value, read out the DTCs in diagnostic addresses 812C and 8131.
3. If additional DTCs are logged, please work through them with Guided Fault Finding.
4. If there are no DTCs in diagnostic addresses 812C and 8131, please check the pneumatic components of the air suspension (air spring struts, air lines and connections) for leaks using VAS 751 001, starting with the air spring struts on the front axle.

Warranty

Claim Type:	If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	4366		
Damage Code:	0050		
Labor Operations:	Check air suspension	4366 0199	Please bill according to the time required
	GFF / Guided Functions	0150 0060	Time stated on the diagnostic protocol
	GFF / Guided Functions	0150 0010	See SRT with associated operations
Claim Comment:	As per TSB 2082125/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Please note the information on predecessors and items that are included and excluded in the repair operations, as well as any associated tasks.

Try to reproduce the customer complaint (based on the description/cause of the issue), so that it can be clearly assigned to this TSB. The following repair must only be carried out if all the criteria (model/type, chassis number, engine/motor, gearbox code, PR number(s), part number, software version, code, etc.) apply exactly. Otherwise, this solution will not eliminate the problem and repeat repairs may be necessary. In such a case, the warranty claim may be rejected, and the cost of the parts may be charged back.

Additional Information

All part and service references provided in this TSB (**2082125**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, LLC / Audi Canada Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, LLC / Audi Canada Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.