

## Condition

| Model(s)                                                   | Year(s)     | VIN Range | Vehicle Specific Equipment               |                  |                      |                  |
|------------------------------------------------------------|-------------|-----------|------------------------------------------|------------------|----------------------|------------------|
| A5, S5 (FU), Q5, Q5 Sportback, SQ5, and SQ5 Sportback (GU) | 2025 - 2026 | All       | 0046 – Convenience system central module |                  |                      |                  |
|                                                            |             |           | Software part number                     | Software version | Hardware part number | Hardware version |
| A6                                                         | 2026        |           | *                                        | 0233             | *                    | *                |

### Customer states:

The rear lid does not open or close fully.

### Workshop findings:

The rear lid does not open or close fully.

## Technical Background

Possible deviation in the data string in the control unit for diagnostic address 0046.

## Production Solution

Not applicable.

## Service

**If the rear lid does not open or close fully, proceed as follows:**

### Check mechanical setting of rear lid

Please first check the precise fit of the rear lid and the permissible buffer forces (40N - 60N) at the rear lid buffers and make sure the specifications are complied with. To do so, refer to the information provided under “Adjusting rear lid” in the Workshop Manual; use spring pressure gauge VAS 895 035 and measurement film VAS 895 037 or alternatively spring scales in accordance with SOST article on spring pressure gauge VAS 895 035.

### Initialize rear lid



**If this is not performed, the parameters logged in the control unit no longer match the preload of the rear lid and a repeat repair may be required.**

To do so, start diagnosis via Guided Functions and perform the function **“0046 - Rear lid electronics - basic setting”**.



#### NOTICE

It is essential not to hinder or stop the movement of the rear lid under any circumstances. This would interrupt the initialization process.



#### CAUTION

Anti-trapping protection is NOT active for the entire duration of the initialization process. Make sure that there is no risk of trapping you or other persons at any time.

## Warranty

The TSB number must always be noted in the “HST number” field in SAGA for ease of processing.

|                          |                                                                                                                                                   |           |                                       |
|--------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------|-----------|---------------------------------------|
| <b>Claim Type:</b>       | <ul style="list-style-type: none"><li>If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.</li></ul> |           |                                       |
| <b>Service Number:</b>   | 5568                                                                                                                                              |           |                                       |
| <b>Damage Code:</b>      | 0039                                                                                                                                              |           |                                       |
| <b>Labor Operations:</b> | Adjust rear lid                                                                                                                                   | 5559 1599 | 20 TU                                 |
|                          | GFF / Guided Functions                                                                                                                            | 0150 0060 | Labor according to the diagnostic log |
| <b>Claim Comment:</b>    | As per TSB 2083113/1                                                                                                                              |           |                                       |

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Please note the information on predecessors and items that are included and excluded in the repair operations, as well as any associated tasks.

## Required Parts and Tools

|              |                       |
|--------------|-----------------------|
| <b>Tools</b> |                       |
| VAS 895 035  | Spring Pressure gauge |
| VAS 895 037  | Measurement film      |

## Additional Information

All part and service references provided in this TSB (**2083113**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

**©2026 Audi of America, LLC / Audi Canada Inc.** All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, LLC / Audi Canada Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.