



Technical Service Bulletin

Technical Service Bulletin: TSB260081

Released Date: 18-Aug-2026

Firetruck Road Speed Governor Slow Response L9, X12 MY21-MY25, X15 MY24-MY25

Firetruck Road Speed Governor Slow Response L9, X12 MY21-MY25, X15 MY24-MY25

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- L9 CM2450 L126B
- X12 CM2450 X137B
- X15 CM2450 X142B
- X15 CM2450 X146B

Issue Summary

Symptom:

- Road Speed does **not** meet/match Road Speed Governor setting.

Root Cause:

- ECM calibration tuning causes the Road Speed Governor to over or under shoot programmed speed by 11 kph/[7 mph].

Verification

Compare the ECM code and revision number in the ECM to the calibration revision listed in the ECM Calibration Revision History Database on QuickServe® Online (QSOL) for applicable changes.

Resolution

If an ECM calibration code update for this this symptom fault code is available, the ECM calibration code revision **must** be that revision or higher. For ECM calibration code calibration process, see corresponding Service Manual. Reference Procedure 019-032 in Section 19.

Document History

Date	Details
2026-6-2	Module Created
2026-8-13	Added X15 models.

Last Modified: 18-Aug-2026
