

Noises at the Rear Three-Point Belt on the Left and/or Right-Retrofitting the Rear Noise Protection Caps on the Left and Right (SY 59/26)

Model Line: **Cayenne (X1A/X1B)**

Model Year: **2026**


Concerns: **Rear three-point belt (N196, N197)**

information: **The customer complains about rattling noises coming from the belt retractor of the rear three-point belt on the left and/or right.**

Action: Retrofit the noise protection caps on the belt retractors of the rear three-point belts on the left and right.

Date of Introduction: From 02/12/2026, the noise protection cap will be installed during production.

Installation Position:

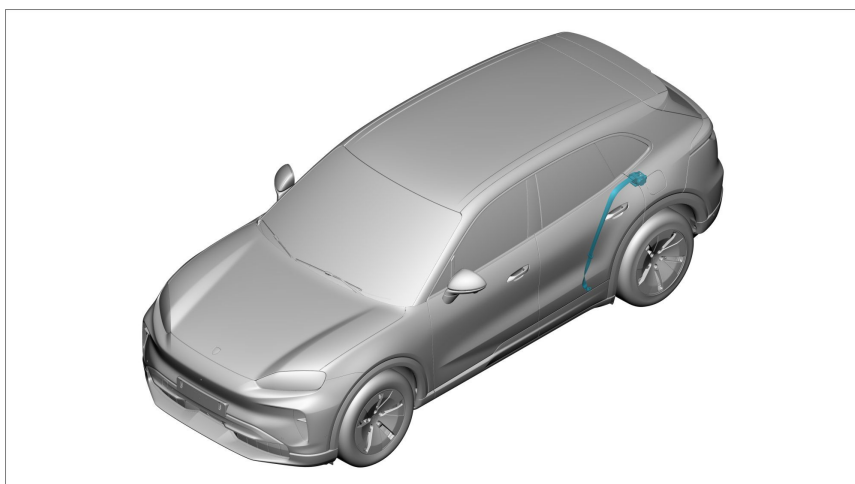

Installation position of the rear three-point belt (N196, N197)

Required tools

- Tools:
- Commercially available carpet knife
 - Torque wrench 14.75 - 73.75 ftlb (20–100 Nm), e.g. ➤ VAS 5820A - torque wrench 14.75 - 73.75 ftlb (20–100 Nm)

Required parts


Parts Info:

Part no.	Designation - Use	Number
95C857085A	> 1 cap (left) 95C857085A cap - left	1 piece
95C857086A	> 1 cap (right) 95C857086A cap - right	1 piece

Preparatory work

Work Procedure:

- 1 Expose the belt retractors for the rear three-point belts on the left and right.
For instructions, see:
69121900 Removing and installing the rear three-point belt (N196, N197)
- 2 Cut through the noise protection caps -1- at the marking -2- using a carpet knife.

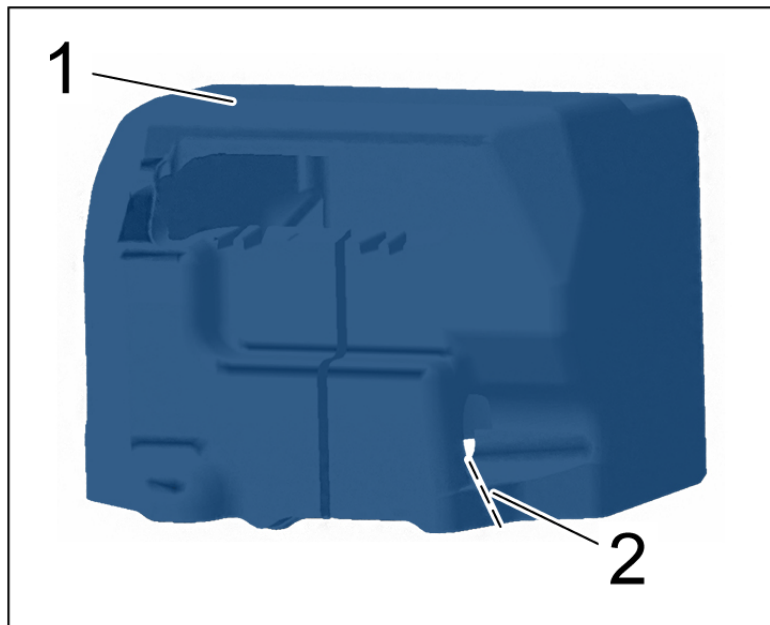

Noise protection cap



Information

The cut in the noise protection caps means that the electrical plug connection does not have to be disconnected.

Retrofitting the noise protection caps on the belt retractors of the rear three-point belts on the left and right


Work Procedure:



Information

The rework is described on the left-hand side as an example. The retrofit on the right-hand side is almost identical.

- 1 Guide the noise protection cap -1- past the belt strap -2- and electrical plug connection -3- and position it on the rear belt retractor -4-.

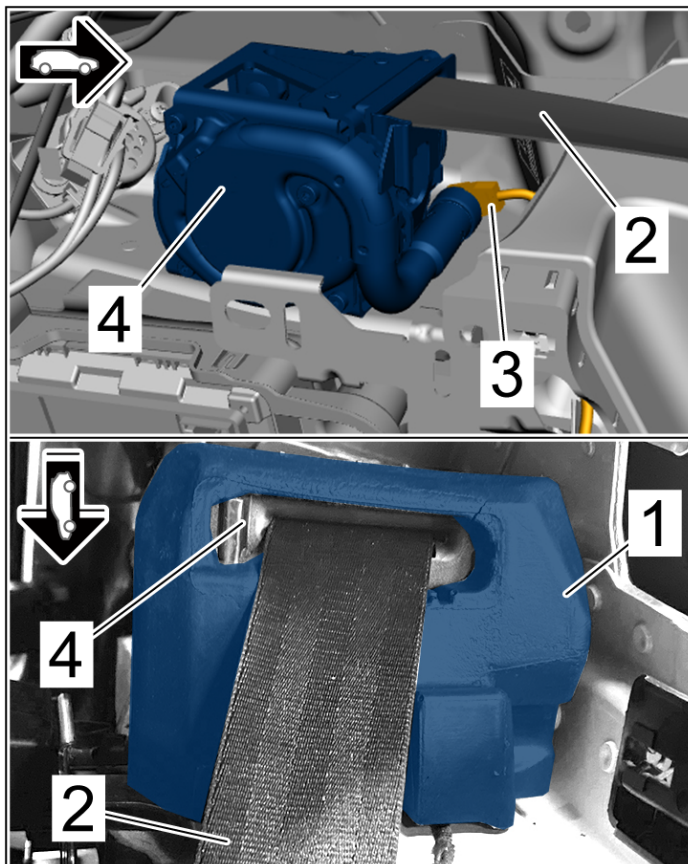

Retrofitting the noise protection cap (shown on the left side)

Follow-up actions

Work Procedure:

- 1 Complete the vehicle.

For instructions, see:

69121900 Removing and installing the rear three-point belt (N196, N197)

PCSS encryption

Labor Position:

69125040 Reworking the rear three-point belts (X1A)

69125041 Reworking the rear three-point belts (X1B)

PCSS encryption:

69120 Rear three-point belt
rattling 2024

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2026 Porsche Cars North America, Inc.