

Technical product information

Topic	27MY Transmission Spurious DTCs
Market area	Bentley: worldwide (2WBE),China 796 VW Import Comp. Ltd (Vico), Beijing (6796)
Brand	Bentley
Transaction No.	2083095/1
Level	EH
Status	Approval
Release date	

New customer code

Object of complaint	Complaint type	Position
vehicle service -> vehicle diagnosis -> guided fault finding	control units, services -> with event log entry	

Vehicle data

Continental GT, GTC & Flying Spur

Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
Z23*	2027	E		*	*	*
Z24*	2027	E		*	*	*
Z32*	2027	E		*	*	*

Documents

Document name
master.xml



Connection offline

Technical product information

Transaction No.: **2083095/1**

27MY Transmission Spurious DTCs

Customer statement / workshop findings

Customer statement:

No customer complaint.

Technical background

Some 27MY vehicles may sporadically log a transmission low oil pressure DTC following a specific driving manoeuvre. This is due to a software diagnostic threshold and does not indicate a transmission hardware fault, low transmission oil level, or any impact to vehicle operation. No warning messages are displayed to the customer.

DTC	Description	Symptom Code
P08677A	Internal leakage too high: Rise of engine idling speed	550778

Production change

A revised diagnostic threshold has been implemented for 28MY vehicles.

Measure

1. Confirm the presence of DTC **P08677A**.
2. No further diagnosis or repair is required.
3. Clear DTCs and the fault will be removed – **P08677A** may return but will have no effect on the customer.