

Technical Service Bulletin (TSB)

Oil Leak Through The Rear Crankshaft Oil Seal (Flywheel Side)

REFERENCE:	TSB: 09-010-26 REV. B GROUP: 09 - Engine	Date:	September 5, 2026	REVISION:	09-010-26 REV. A
VEHICLES AFFECTED:	2025 - 2027 (B1) Jeep Renegade 2025 - 2027 (H1) Jeep Commander 2025 - 2027 (M1) Jeep Compass This bulletin applies to vehicles built on or after July 07, 2025 (MDH 0707XX) and on or before February 20, 2026 (MDH 0220XX).			MARKET APPLICABILITY: ☒ NA☐ MEA ☐ EE☐ IAP ☒ SA☐ CH NOTE: This bulletin applies to North and South America markets.	
CUSTOMER SYMPTOM:	Customers may comment on the following: - Oil Pressure warning light illuminates. - Engine oil is leaking onto the floor beneath the vehicle.				
CAUSE:	Rear crankshaft oil seal (flywheel side)				

This bulletin supersedes Technical Service Bulletin (TSB) 09-010-26 REV. A, date of issue July 17, 2026, which should be removed from your files. Revisions are not highlighted with ****asterisks**** and include updates to Spare Parts.

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 26-092, date of issue May 22, 2026. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.

REPAIR SUMMARY:

This bulletin involves inspecting for oil leaks and if necessary replacing the rear crankshaft oil seal (flywheel side).

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
09-25-75-9A	Seal, Engine Oil Crankshaft - Inspect (1 - Introduction)	1 - Engine Repair and Performance	0.3 Hrs.
09-25-75-9B	Seal, Engine Oil Crankshaft - Inspect and Replace (1 - Introduction)	1 - Engine Repair and Performance	3.2 Hrs.
Failure Code	ZY	Service Action	

SPARE PARTS:

Qty	Part No.	Description	Notes
1 (AR)	55284989	Crankshaft Seal	
8 (AR)	46335859	Flywheel Oil Seal Retaining Bolt	
1 (AR)	6000630430	Gasket Between Tube And Throttle Body	
1 (AR)	6000629757	Gasket Between Pipe And Turbine	
1 (AR)	52245735	Nut And Lock Washer For Securing The Sway Bar Link To The Stabilizer Bar	
1 (AR)	52063540	Nut For Securing The Steering Tie Rod End To The Steering Knuckle	
1 (AR)	52014753	Bolt Securing The Arm Ball Joint To The Upright (M10)	
1 (AR)	51972833	Nut For Securing The Control Arm Ball Joint To The Steering Knuckle (M10)	
1 (AR)	51799495	Catalytic Converter to Auxiliary Muffler Gasket	
1 (AR)	10860270	Clamps For Securing The Lines To The AT6 Transmission Oil Cooler	Diameter: 23 Mm.
1 (AR)	10861170	Clamps For Securing The Lines To The AT6 Transmission Oil Cooler	Diameter: 43 Mm.
1 (AR)	71778273	PTU (Power Take-Off) And Driveshaft Retaining Ring	
1 (AR)	77367399	Tripod Housing To Transmission Retaining Ring	Left Side
**1 (AR)	52182628	Bolt Securing The Arm Ball Joint To The Upright (M12)	
1 (AR)	51972826	Nut Securing The Control Arm Ball Joint To The Steering Knuckle (M12) **	
48 (4.8 liters) (AR)	Mopar - 68608372AA SA - 7092779 / Argentina Only - 50035647	Oil 0W-30	100 ml REIMBURSEMENT ONLY
80 (8 liters) (AR)	68626281AA - Mopar SA - 7092803 / Argentina Only - 50040500	Mopar Antifreeze Coolant Oat 50/50	100 ml REIMBURSEMENT ONLY

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. If any vehicle not on the VIN list exhibits any of the symptoms listed above in the customer symptom section, perform the Repair Procedure.

REPAIR PROCEDURE:

1. Start the vehicle and after 20 seconds at idle, accelerate to 3500 rpm for three minutes then turn off the vehicle.
2. Raise and support the vehicle. Refer to the detailed service procedures available in DealerConnect> Service Library under: Service Info> 04 - Vehicle Quick Reference/Hoisting/Standard Procedure.
3. Check for the presence of oil in the engine area coupling between the engine and transmission, and the flywheel seal area [Fig. 1](#).

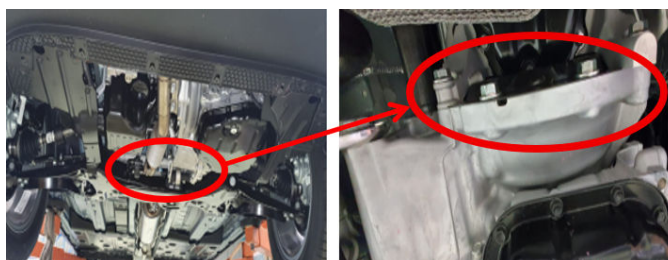


Fig. 1
Area For Oil Leaks

4. Is there presence of oil in the coupling area between the engine and transmission [Fig. 1](#)?
 - YES >>> Proceed to [Step 5](#).
 - NO >>> Lower the vehicle. This bulletin has been completed, use Inspect LOP (09-25-75-9A) to close the active RSU.
5. Replace the rear crankshaft oil seal (flywheel side). Refer to the detailed service procedures available in DealerCONNECT/Service Library under: 1020D39 - Retentor Traseiro - Lado Volante - Remoção/Recolocação e Substituição, para Veículos com Câmbio Automático. Incluso Procedimentos Necessários.

NOTE: For SA market only, after applying this TSB, it is not necessary to send DID-I or DID-A.

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.