



Service Bulletin

Bulletin No.: PIP6132


Date: September, 2026

PRELIMINARY INFORMATION

Subject: Engine Oil leak between Engine Oil Pan to Oil Cooler Adapter

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Corvette	2027		All	All	6.7L LS6	All


Involved Region or Country	North America
Condition	Some customers or technicians may notice that there is an engine oil leak visible from underneath the vehicle. During inspection, technicians may notice that there is a small oil leak that can be observed coming from between the oil pan and the oil cooler adapter.
Cause	When the engine is running this can also cause some bubbling in this area as well. When the engine is running this can also cause some bubbling in this area as well. This can be seen in the front mounting location of the oil cooler adapter or rear mounting area.

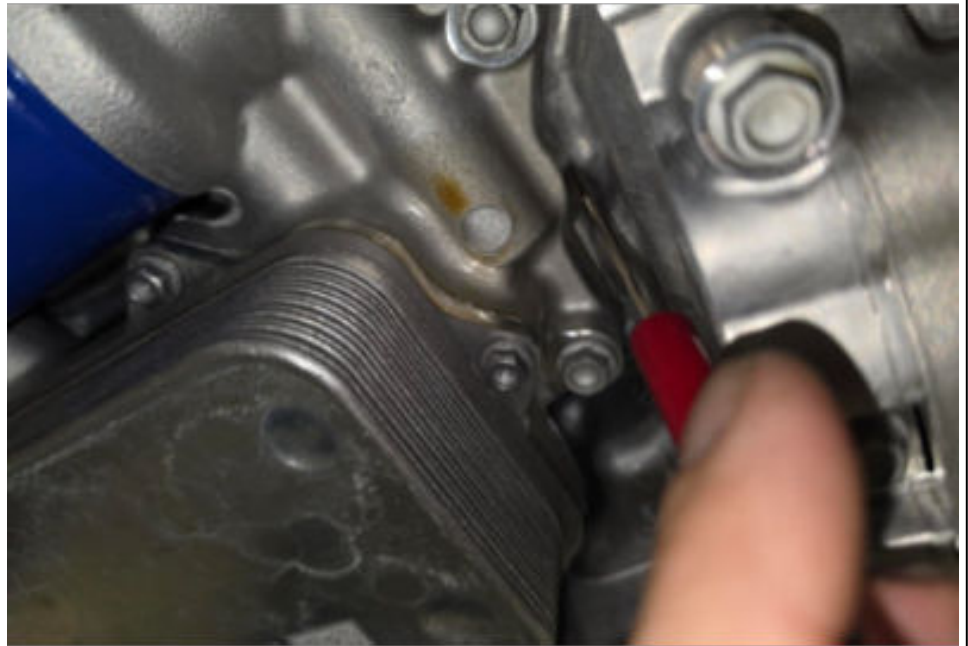

7216050




7216051

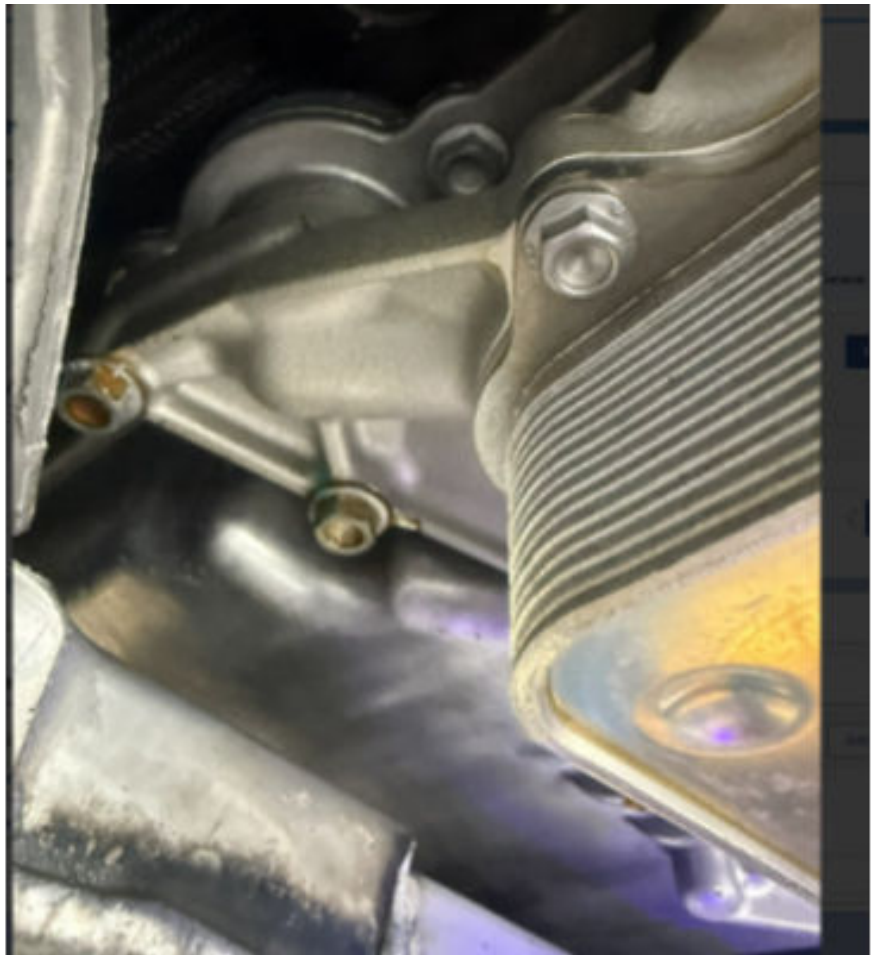

7216052

Correction


To correct this condition, it will be necessary to replace the 2 oil cooler adapter seals circled in the picture below:

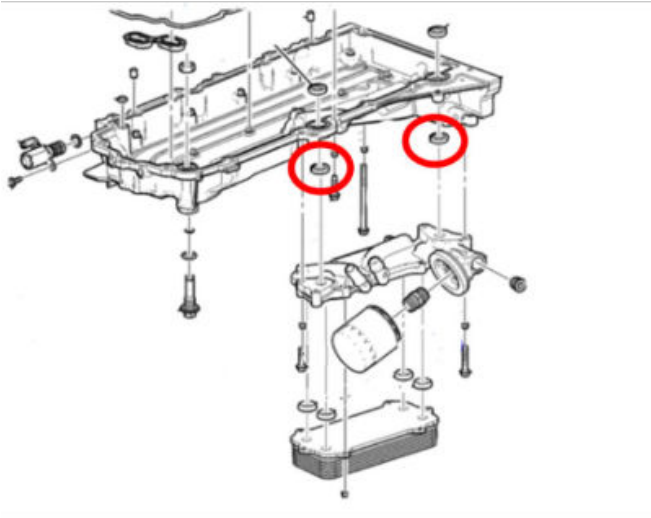

7216102

Important: It is not necessary to separate the oil cooler from the oil cooler adapter as shown in the service information procedure.

Important: To prevent any potential leaks when installing the oil cooler adapter bolts (1) it is very important to run the bolts down evenly and tighten in sequence, Refer to service information for specific torque procedure. The torque procedure is also noted below.

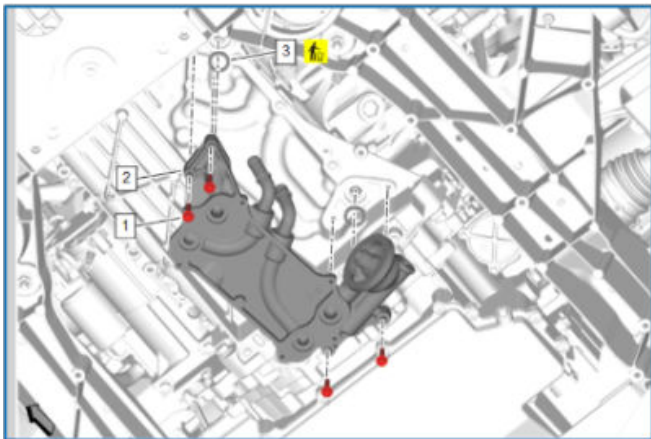

7216054


1. Oil Pan High Pressure Port Seal (3) Install NEW [2x]

2. Engine Oil Cooler Adapter (2) Install

Caution: Refer to Fastener Caution in Service Information

3. Engine Oil Cooler Adapter Bolt (1) Install and tighten in sequence [4x]

Engine oil cooler adapter bolt torquing sequence:

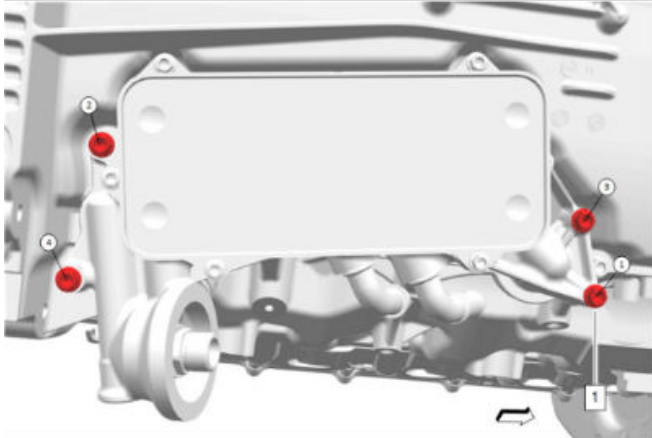

7216055

First Pass: 5 Nm (44 lb in)

Final Pass: 15 Nm (11 lb ft)

Parts Information

Description	Part Number	Qty
SEAL, OIL PAN HIGH PRESS PORT	12746274	2

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4030450	Engine Oil Cooler Adapter Replacement	ST

Version	1
Modified	09/17/2026 - Created on