



## Technical Service Bulletin

GROUP <b>RECALL</b>	NUMBER <b>17-01-048</b>
DATE <b>June, 2017</b>	MODEL(S) <b>Santa Fe Sport (AN)</b>

**SUBJECT:** 2017-2018 SANTA FE SPORT (AN) DRIVER'S SEAT BELT ANCHOR BOLT INSPECTION (RECALL CAMPAIGN 165)

### \* IMPORTANT

#### \*\*\* Dealer Stock and Retail Vehicles \*\*\*

Dealers must perform this Recall Campaign on all affected vehicles prior to customer retail delivery and whenever an affected vehicle is in the shop for any maintenance or repair.

When a vehicle arrives at the service department, access Hyundai Motor America's "Warranty Vehicle Information" screen via WEBDCS to identify open Campaigns.

**Description:** The driver's seat belt anchor in the Hyundai Santa Fe Sport (AN) is attached to the vehicle's inner sill structure with a bolt. The bolt may not have been properly torqued during vehicle assembly. If the driver's seat belt detaches from the anchor point in a collision, the risk of injury to the occupant is increased. This bulletin describes the procedure to inspect the driver's seat belt anchor bolt to confirm it is properly torqued.

NOTE: This issue does not affect the front passenger seat belt assembly.



### NOTICE

**Parts - No part replacement is required for this procedure.**  
**Please note this is a simple inspection that can be performed in the dealer's service drive in less than 15 minutes.**

**Applicable Vehicles:**  
**2017-2018 MY Santa Fe Sport (AN) Vehicles [VINs starting with 5NM]**

**Warranty Information:**

Model	Op Code	Operation	Op Time	Causal Part No.	Nature Code	Causal Code
Santa Fe Sport (AN)	71CA15R0	Seat Belt Anchor Bolt Inspection	0.2 M/H	88810-4Z500NBC	B15	ZZ7

**NOTE 1:** Submit Claim on Campaign Claim Entry Screen

**NOTE 2:** If a part is found in need of replacement while performing Recall 165 and the affected part is still under warranty, please submit a separate claim using the same Repair Order.


If the affected part is out of warranty, submit a Prior Approval Request for goodwill consideration prior to performing the work.

**Tools & Equipment Required:**

Tool Name	Image	Remark
Torque Wrench		Nominal Torque: (47NM or 34.7 ft-lbs)

**Service Procedure:**

1. Move the driver seat forward to allow access to the driver seat belt anchor bolt (A) located by the lower B pillar trim (B). To access the bolt, pull the anchor bolt cover (C) up to expose the anchor bolt.

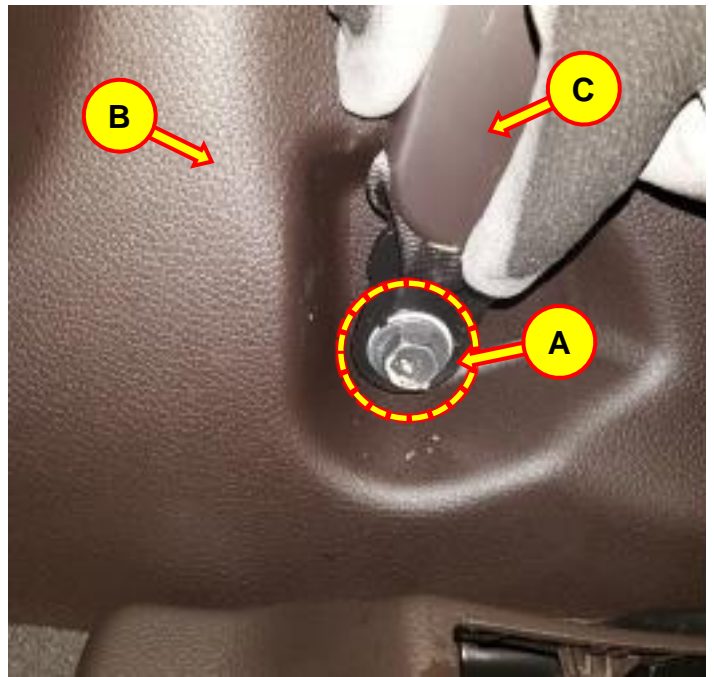

2. Set the torque wrench to nominal (47NM or 34.7 ft-lbs). Apply torque to the anchor bolt until it is tightened to spec.



3. Reseat the anchor bolt cover over the anchor bolt and move the driver seat rearward.

