

CERTAIN 2015 MODEL YEAR EDGE, 2015-2016 MODEL YEAR F-150, MKT, AND POLICE INTERCEPTOR SEDAN, AND 2016 MODEL YEAR ESCAPE, EXPLORER, FLEX, FUSION, MKX, MUSTANG, POLICE INTERCEPTOR UTILITY, TAURUS, AND TRANSIT VEHICLES — *ELECTRONIC THROTTLE BODY REPLACEMENT*

NEW ! OVERVIEW

In all of the affected vehicles, the electronic throttle body (ETB) internal motor contacts may develop contamination resulting in increased electrical resistance. If this condition is present, the malfunction indicator lamp will illuminate, diagnostic trouble codes (DTCs) P2111 and P2112 will set, and the vehicle may enter a Failure Mode Effects Management (FMEM) of default throttle position with fixed RPM. In this mode, while engine power and vehicle speed are reduced, the power steering, power braking, lighting, and climate control systems remain fully functional. *Dealers are to replace the ETB.*

NEW ! SERVICE PROCEDURE

Electronic Throttle Body Replacement

- 1. Replace the electronic throttle body. Please follow the Workshop Manual (WSM) procedure in Section 303-04.*

