

CERTAIN 2016 MODEL YEAR TRANSIT CONNECT VEHICLES — FUEL FILLER PIPE LABEL CORRECTION

OVERVIEW

In some of the affected vehicles, the fuel filler pipe identification ring was incorrectly labeled for E85 fuel usage. The use of E85 fuel may result in drivability issues, illuminated Malfunction Indicator Light, and the vehicle may not pass emission or smog tests that may be required in your area.

SERVICE PROCEDURE

1. Inspect the vehicle's fuel filler pipe identification ring for the presence of the "E0-E15" or "E85 /" marking.
 - If the "E0-E15" marking is present, no further action is required.
 - If the "E85 /" marking is present, proceed to Step 2.

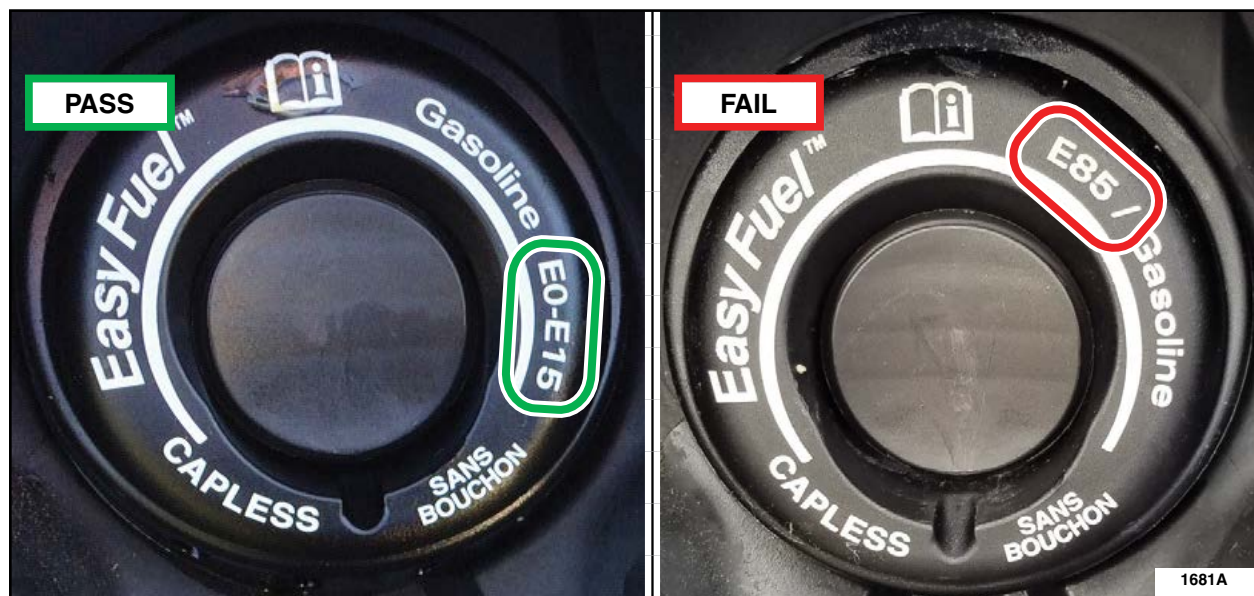


FIGURE 1



2. Remove the "E85 /" marking using acetone. See Figure 2.

- a. Mask the area/markings surrounding the "E85 /" marking.
- b. Using acetone applied to an abrasive pad, remove the "E85 /" marking from the fuel filler pipe identification ring. Repeat as required to remove all of the "E85 /".



FIGURE 2

