509

NR

Part 573 Safety Recall Report

Manufacturer Name :Ford Motor CompanySubmission Date :MAR 27, 2017NHTSA Recall No. :17V-212Manufacturer Recall No. :17S08

Manufacturer Information :

Manufacturer Name : Ford Motor Company Address : 330 Town Center Drive Suite 500 Dearborn MI 48126-2738 Company phone : 1-866-436-7332

Vehicle Information :

Vehicle 1:	2017-2017 Ford F-450/	/550 Superduty	,	
Vehicle Type :	BUSES, MEDIUM & HEA	VY VEHICLES		
Body Style :	ALL			
Power Train :	GAS			
Descriptive Information :	5 1 1 1	0	ngine, 4x4 drive, 205" who affected by this concern.	eel base, and 4.88
	this action to specific ve line (1-866-436-7332)	chicles can best or by contacting garding the vehi	l order. Information as to be obtained by either call g a local Ford or Lincoln de cles from the Ford On-line	ing Ford's toll-free ealer who can obtain
Production Dates : FEB 16, 2016 - FEB 21, 2017				
VIN Range 1:	Begin : NR	End :	NR	Not sequential
Description of Defect :				
Description of the Defect : Vehicles with this specific configuration may experience driveline vibration caused by a powertrain system resonance condition at speeds above 75 mph				

Description of the Defect :	Vehicles with this specific configuration may experience driveline vibration caused by a powertrain system resonance condition at speeds above 75 mph. Continued operation of a vehicle at these speeds could result in a resonance frequency that may fracture transmission and/or driveline components.
FMVSS 1 :	NR
FMVSS 2 :	NR
Description of the Safety Risk :	Fracture of the transmission and/or driveline components may result in a loss of motive power without warning while driving, or unintended vehicle movement in park if the parking brake is not applied, increasing the risk of injury or crash.

The information contained in this report was submitted pursuant to 49 CFR §573



Number of potentially involved :

Estimated percentage with defect :

Population :

Part 573 Safety Recall Report

Description of the Cause :
Identification of Any Warning
that can Occur :This specific vehicle configuration exhibits a powertrain system resonance
condition that was not identified during vehicle development testing.Identification of Any Warning
that can Occur :Customers may notice driveline vibration prior to a failure.

Supplier Identification :

Component Manufacturer

Name : NA Address : NR NR Country : NR

Chronology :

February-March 2017:

CCRG reviewed an issue concerning reports of transmission and/or driveline component fractures. Five warranty claims identified either driveshaft fractures ahead of the center bearing and/or transmission housing cracks on 2017MY Super Duty F450/550 205 in. wheelbase 4x4 vehicle configuration. Engineering analysis indicated the concern was caused by powertrain bending resulting from a driveshaft/powertrain resonance frequency that could occur at maximum vehicle speeds (78 mph to 81 mph).

CCRG conducted a vehicle evaluation to evaluate potential symptoms associated with this powertrain system resonance as described in some of the reports from the field.

On March 20th, 2017, Ford's Field Review Committee reviewed the concern and approved a field action.

Description of Remedy :

Description of Remedy Program :	Owners will be notified by mail and instructed to take their vehicle to a Ford or Lincoln dealer to have the two-piece driveshaft replaced with a new three-piece driveshaft and two center bearing brackets. There will be no charge for this service. Ford is excluding reimbursement for costs because the original warranty
	program would provide for a free repair for this concern. Ford will forward a copy of the notification letters to dealers to the agency when available.
How Remedy Component Differs	
from Recalled Component :	

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

Identify How/When Recall Condition NR was Corrected in Production :

Recall Schedule :

Description of Recall Schedule :	Notification to dealers is expected to occur on March 28th, 2017. Mailing
	of owner notification letters is expected to begin April 4th, 2017 and is
	expected to be completed by April 11th, 2017.
Planned Dealer Notification Date :	MAR 28, 2017 - MAR 28, 2017
Planned Owner Notification Date :	APR 04, 2017 - APR 04, 2017

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR $\S573$