

# Part 573 Safety Recall Report

# 18V-010

**Manufacturer Name :** Jaguar Land Rover North America, LLC**Submission Date :** JAN 08, 2018**NHTSA Recall No. :** 18V-010**Manufacturer Recall No. :** J072**Manufacturer Information :****Population :**

Manufacturer Name : Jaguar Land Rover North America, LLC

Number of potentially involved : 16,532

Address : 555 MACARTHUR BOULEVARD

Estimated percentage with defect : 100 %

MAHWAH NJ 07430

Company phone : 8188500

**Vehicle Information :**

Vehicle 1 : 2010-2015 JAGUAR XF

Vehicle Type : LIGHT VEHICLES

Body Style : 4-DOOR

Power Train : GAS

Descriptive Information : 2010, 2011, 2012, 2013, 2014 and 2015 MY Jaguar XF Vehicles in select VIN range that were originally sold or ever registered in Zone C (Priority Group 10).

Production Dates : NOV 08, 2008 - JUN 15, 2015

VIN Range 1 : Begin : SAJWA0JC8AMR44060 End : SAJWA0GB2ALR78855  Not sequentialVIN Range 2 : Begin : SAJWA0GB4BLR81449 End : SAJWA0JC2BMS20690  Not sequentialVIN Range 3 : Begin : SAJWA0JCXCMS16372 End : SAJWA0HB8CLS60325  Not sequentialVIN Range 4 : Begin : SAJWA0ES9DPS55276 End : SAJWJ0EFXD8U08972  Not sequentialVIN Range 5 : Begin : SAJWJ0EF3E8U09107 End : SAJWJ0EFXE8U32691  Not sequentialVIN Range 6 : Begin : SAJWJ0FF4F8U34212 End : SAJWJ0FF7F8U88782  Not sequential

Vehicle 2 : 2014-2015 JAGUAR XF

Vehicle Type : LIGHT VEHICLES

Body Style : 4-DOOR

Power Train : GAS

Descriptive Information : 2014 and 2015 MY Jaguar XF Vehicles in select VIN range that were originally sold or ever registered in Zone A (Priority Group 10).

Production Dates : AUG 27, 2013 - JUN 05, 2015

VIN Range 1 : Begin : SAJWA0ESXEPU06496 End : SAJWJ0EF5E8U39080  Not sequentialVIN Range 2 : Begin : SAJWA0F71F8U24391 End : SAJWA0FS7FPU88784  Not sequential

Vehicle 3 : 2011-2015 JAGUAR XF

Vehicle Type : LIGHT VEHICLES

Body Style : 4-DOOR

Power Train : GAS

**Descriptive Information :** 2011, 2012, 2013, 2014 and 2015 MY Jaguar XF Vehicles in select VIN range that were originally sold or ever registered in Zone B (Priority Group 10).

**Production Dates :** NOV 17, 2009 - JUN 05, 2015

VIN Range 1 : Begin :	SAJWA0FB6BLR69174	End :	SAJWA0JC9BMS20654	<input type="checkbox"/> Not sequential
VIN Range 2 : Begin :	SAJWA0JC5CMS10172	End :	SAJWA0HB4CLS61066	<input type="checkbox"/> Not sequential
VIN Range 3 : Begin :	SAJWA0ES5DPS51676	End :	SAJWA0E77D8U09022	<input type="checkbox"/> Not sequential
VIN Range 4 : Begin :	SAJWA0EX8E8U06499	End :	SAJWA0KZ5EMU34709	<input type="checkbox"/> Not sequential
VIN Range 5 : Begin :	SAJWA0HP9FMU34218	End :	SAJWJ0FF5F8U88778	<input type="checkbox"/> Not sequential

## Description of Defect :

**Description of the Defect :** Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2014 and 2015 Model Year (MY) Jaguar XF vehicles originally sold or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Unless included in "Zone A" above, Jaguar is also recalling certain 2011 to 2015 MY Jaguar XF vehicles, originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Unless included in "Zone A and Zone B" above, Jaguar is also recalling certain 2010 to 2015 MY Jaguar XF vehicles, originally sold, or ever registered in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming or "Zone C."

Vehicles outside the model years and zones as described above are not subject to this safety recall.

FMVSS 1 : NR

FMVSS 2 : NR

**Description of the Safety Risk :** These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death.

**Description of the Cause :** NR

**Identification of Any Warning that can Occur :** NR

**Supplier Identification :****Component Manufacturer**

Name : TK Holdings  
Address : Bahnweg 1  
Aschaffenburg FOREIGN STATES 63743  
Country : Germany

**Chronology :**

On May 18, 2016, Takata notified Jaguar Land Rover that they had submitted DIR's to NHTSA for the subject inflators. Jaguar Land Rover opened an investigation on May 20, 2016 and reviewed the concern at the Product Safety and Compliance Committee (PSCC) meeting on May 24, 2016. The committee concluded that certain Jaguar XF passenger airbags have been fitted with non-desiccated inflators containing ammonium nitrate. The issue was progressed to the Senior Review Panel (SRP) for determination.

On May 26, 2016 the SRP concluded that, despite Jaguar Land Rover not being aware of any field incidents with the subject Takata inflators, based on the information above provided by Takata and in an abundance of caution, Jaguar Land Rover will conduct a voluntary recall of the vehicles equipped with non-desiccated inflators containing ammonium nitrate in the United States as identified by Takata in their DIR - Equipment Reports 16E-042, 16E-043 and 16E-044.

There have been no reported injuries in Jaguar Land Rover vehicles as a result of this concern.

As part of Jaguar Land Rover's commitment to the co-ordinated remedy program initiated by NHTSA, this notification commences Phase 4 of the recall campaign to target certain Jaguar XF 2010 to 2015 MY vehicles as defined in the Third Amendment to the Coordinated Remedy Order (ref. Docket No. NHTSA-2015-0055).

**Description of Remedy :**

Description of Remedy Program : Jaguar will notify owners, and authorized dealers will replace the passenger frontal air bag assemblies. There will be no charge to owners for this repair.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

**Recall Schedule :**

Description of Recall Schedule : Distribution of interim notification letters will occur on or before February 28, 2018. Notifications to dealers will occur on January 11, 2018.

Planned Dealer Notification Date : JAN 11, 2018 - JAN 11, 2018

Planned Owner Notification Date : FEB 28, 2018 - FEB 28, 2018

\* NR - Not Reported