TECHNICAL INSTRUCTIONS

FOR

SAFETY RECALL JOA, JOB, JOC

FRONT PASSENGER AIRBAG "MODULE" REPLACEMENT ONLY



CERTAIN 2003 – 2008 MODEL YEAR MATRIX


The repair quality of covered vehicles is extremely important to Toyota. All dealership technicians performing this repair are required to successfully complete the most current version of the E-Learning course "Safety Recall and Service Campaign Essentials". To ensure that all vehicles have the repair performed correctly; technicians performing this repair are required to currently hold <u>at least one</u> of the following certification levels:

- Toyota Expert (Electrical)
- Master
- Master Diagnostic Technicians

It is the dealership's responsibility to select technicians with the above certification level or greater to perform this repair. Carefully review your resources, the technician skill level, and ability before assigning technicians to this repair. It is important to consider technician days off and vacation schedules to ensure there are properly trained technicians available to perform this repair at all times.


I. OPERATION FLOW CHART

The flow chart is for reference only. *DO NOT* use it in place of the full technical instructions. Follow *ALL* steps as outlined in the full technical instructions to confirm the campaign is completed correctly.

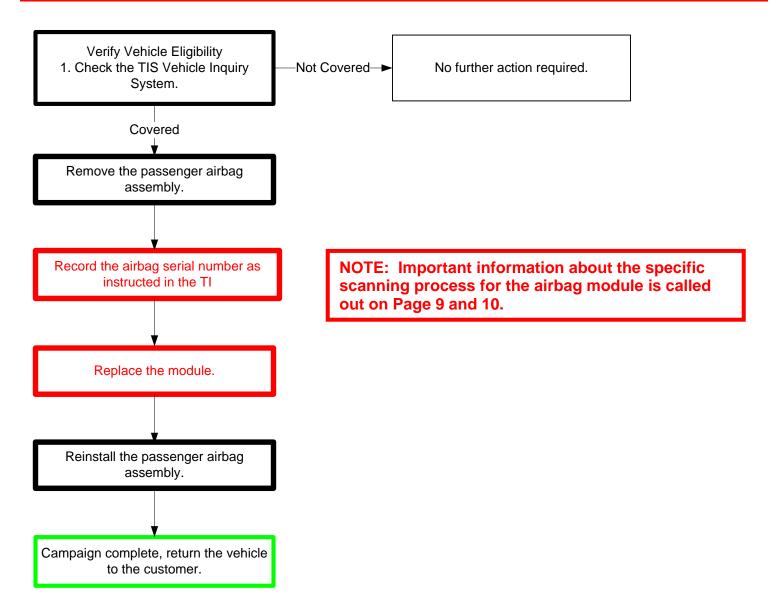

II. BACKGROUND

The subject vehicles are equipped with front passenger airbag inflators which may have been manufactured in such a way as to have a potential for the intrusion of moisture over time. Depending on the circumstances, this could create excessive internal pressure when the airbag is deployed and cause the inflator to rupture. In the event of an inflator rupture, metal fragments could pass through the airbag cushion material, striking the vehicle occupants and potentially resulting in serious injury or death.

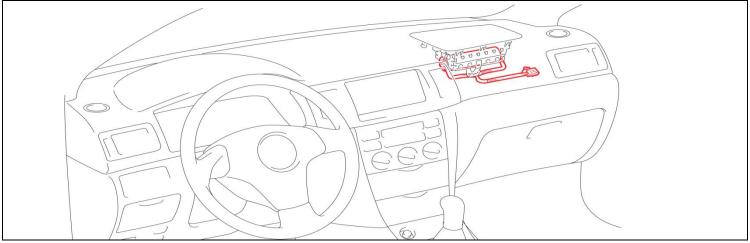

III. IDENTIFICATION OF AFFECTED VEHICLES

- Check the TIS Vehicle Inquiry System to confirm the VIN is involved in this Safety Recall, and that the campaign has not already been completed prior to dealer shipment or by another dealer.
- TMS warranty will not reimburse dealers for repairs conducted on vehicles that are not affected or were completed by another dealer.

IV. PREPARATION

A. PARTS

Applicable for: The Continental U.S. 48 States Only

Model	Part Number	Part Description	Quantity
03-04 Matrix	04005-22601	Instrument Panel Airbag Kit*	1
05-08 Matrix	04005-22901	Instrument Panel Airbag Kit*	1
	* The kit above inclu Airbag Modu	des the following parts.	
Matrix	04005-28112	IP Wire Harness Kit*	1
	*The kit above inclu	des the following parts.	
	Wire Harne	ss 1	

Applicable for: Alaska, Hawaii and USTT Locations Only

Model	Part Number	Part Description	Quantity
03-04 Matrix	04005-22501	Instrument Panel Airbag Kit*	1
05-08 Matrix	04005-22801	Instrument Panel Airbag Kit*	1
	*The kit above inclu Airbag Modu	des the following parts.	
Matrix	04005-28112	IP Wire Harness Kit*	1
	*The kit above inclu	des the following parts.	
	Wire Harnes	SS 1	


B. TOOLS & EQUIPMENT

- Standard hand tools
 - Molding remover set
- Torque wrenchTechstream

OPTIONAL SST – This is an essential special service tool that the dealership should have. This tool is not mandatory when performing this repair.


Part Number	Part Name	Quantity
09890-47010-01	Anti-Static Mat Set	1

DSF CAMPAIGN TOOLS – This tool was provided to the dealership for campaign D0F and will be used for campaign DSF. This tool is required when performing this repair.

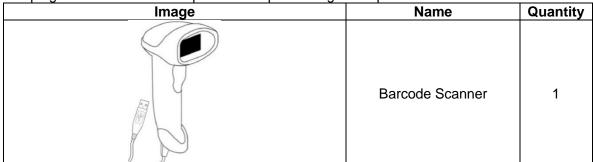


NOTE: This tool *CANNOT* be ordered through the parts or tools system. There is a very limited supply of tools, but if additional tools are needed, contact your regional representative.


V. COMPONENTS

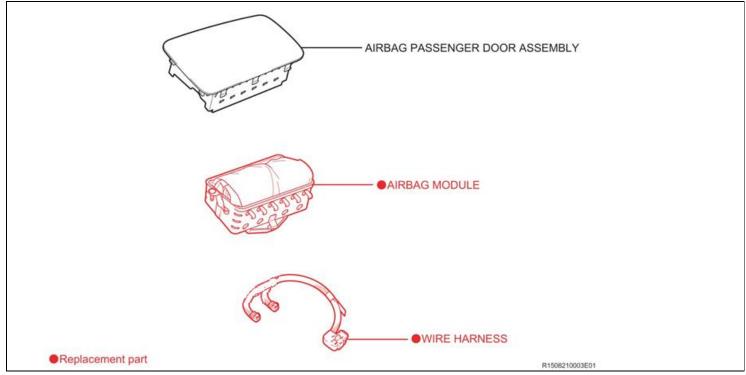

VI. SAFETY PRECAUTIONS

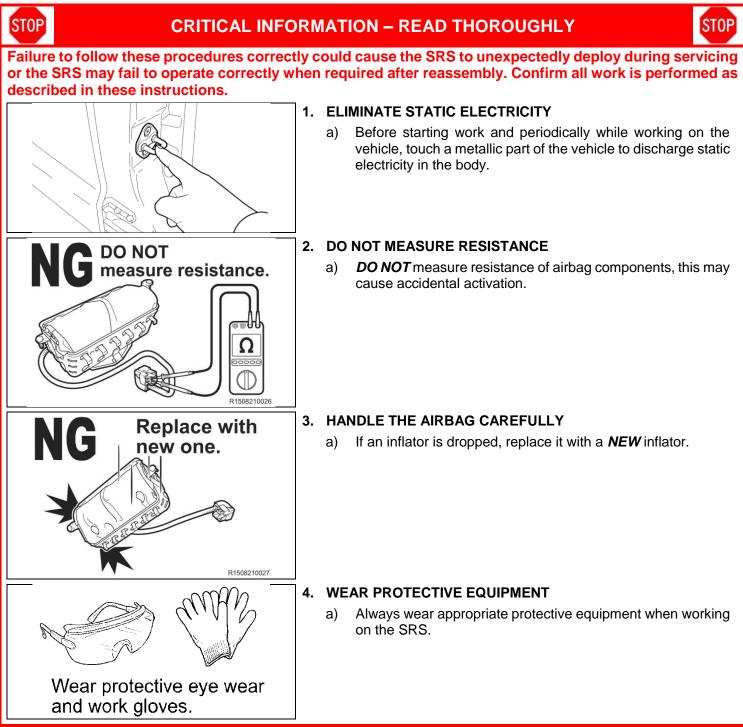

VII. SRS SYSTEM HEALTH CHECK

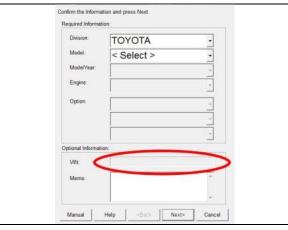

1. PERFORM A HEALTH CHECK

- a) Confirm the Techstream is connected to the dealership's internet.
- b) When launching the Techstream software the VIN **MUST** be entered manually.

NOTE: All letters of the VIN *MUST* be entered in ALL CAPS, or the VIN will need to be reentered when running the diagnostic report.

c) Perform a health check.

The VIN *MUST* be entered manually in ALL CAPS when launching the Techstream software, the VIN MAY *NOT* auto-populate due to vehicle age.

The serial number recording application will be disabled and the repair cannot be completed if a health check and diagnostic report is not performed and recorded by TMS.

VIII. WORK AREA PREPARATION


STOP

STOP

CRITICAL INFORMATION – READ THOROUGHLY

STOP

The anti-static mat set that is an essential SST may be available at your dealership and is optional to use during inflator replacement. If the anti-static kit is not available, before starting work and periodically while working on the vehicle, touch a metallic part of the vehicle to discharge static electricity in the body.

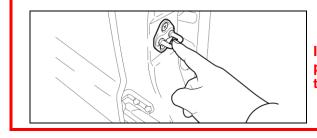

If the anti-static kit is not available, before starting work and periodically while working on the vehicle, touch a metallic part of the vehicle to discharge static electricity in the body.

IX. PASSENGER AIRBAG INFLATOR REPLACEMENT

1. LAUNCH THE SERIAL NUMBER RECORDING APPLICATION

STOP

- The AIRBAG ASSEMBLY and NEW MODULE serial numbers MUST be recorded using the barcode scanner (provided at the launch of SSC D0F).
- The barcode scanner application MUST be completed on every vehicle. These numbers MUST be included on every warranty claim that is submitted for inflator module replacement or the claim may be subject to debit.
- The technician performing the work MUST have valid TIS login credentials and an internet connection to perform the inspection and scanning process.
- a) Log in to TIS and input the VIN of the vehicle in the Vehicle Inquiry tab.
- b) Confirm the VIN is applicable and that the campaign has not been completed.
- c) Click on the link to launch the serial number recording application.

Vehicle Identification Number Enter a 17 Digit Will being to sear			
VECTINX BR32E 00000000			
a) Vehicle Information			
Division: TOYOTA	Model: Corolla	Grade: CE	Model Year: 2003
Drive Type: 2WD	Body Type: 4Dr. Sedan	Engine Family: 4-cylinder - 122	Transmission:
Date of First Use:	Production Date: 01/18/2002	Plant Code: Z - FREMONT PLANT - NUMMI	
VIN: 1NX -8R32E-00000000	Standard Equipment: Click here	to display	
Exterior Color: 03M5, SANDRIF	T METALLIC	Interior Color: FA41, FA41	
		Interior Trim Color: FA, *	Interior Fabric: F, *
Vehicle accessories are not curre	ntly available. Try your query again later.		
Centreon Service History	Warranty DTC History Dia	ignostic Report	
Service Campaign			
Campaign Description: Safet	Recall DOF Remedy Notice - 2003-2004 Mo	del Year Corolla, Corolla Matrix, Segucia, ar	nd Tundra Vehicles, 2002-2003 Model Year

d) Reenter TIS password in the serial number recorder application.


NOTE: The person logged-in to TIS <u>MUST</u> be the person performing the repair.

Front Passenger	Airbag Inflat	or Module - S	Safety Recall	
Tonerabbenger	SSC - I		survey resource	
			12345	
ser ID: SuzukiR		Technician Nan	ne: Russell Suzuki	
ealer Code:		Dealer Name:		
ime: 06/10/2014 02:07 PM PDT		Airbag Serial #:		
riginal Inflator Serial #:		Replacement Ir	iflator Serial #:	
VIN: ST	TD STATE	is BEIGE M. M.]		
	Mileage*			
Task Dealor	User	Time	Status	
Airbag # Record			Not Started	
Inflator # Record			Not Started	
Terms & Conditions			Not Started	
New Airbag #			Not Started	

e) Record the vehicle mileage into the serial number recording application.

NOTE:


- A task status screen will populate next and at other intervals during the repair. This screen will indicate if the module was replaced or in some limited cases that the entire airbag assembly was replaced. Click 'next' to proceed to the next step. This information will be used for record keeping by TMS.
- If this screen indicates that the inflator has already been replaced on this VIN, there is no need to perform the campaign again.

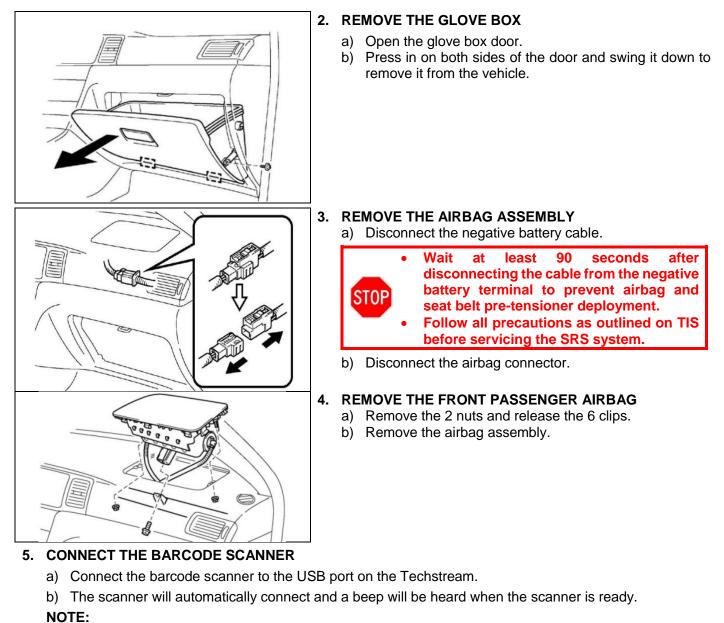

- The scanner was provided for SSC D0F.
- The scanner works best in low light conditions.

• Always hold the scanner directly in front of and parallel to the barcode label.

SCAN THE AIRBAG SERIAL NUMBER 6. a) Scan the **AIRBAG ASSEMBLY** serial number 2 AIRBAG SERIAL NUMBER IDENTIFICATION times. • The airbag serial number is ALWAYS the 12 DIGITS 1) Confirm the cursor is in the first serial number located between the asterisks. box then scan the serial. The 3 digits before the asterisk ARE NOT part of the 2) Position the cursor in the second serial serial number, and SHOULD NOT be entered or an number box then scan the serial. inaccurate response may be returned. NOTE: Airbag Serial Number Label Example If both serial numbers that are entered do not match, confirm and reenter. If the serial number barcode will not scan, it can be entered manually. F22 *00000000XX0

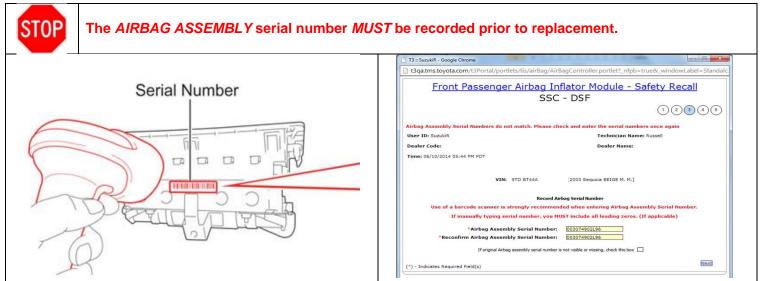


NOTE: If the airbag serial number # is missing or cannot be scanned go to page 12.

b) Click next.



Remember: You will need to <u>check the box indicating the old inflator serial number</u> is not readable or missing to move to the next screen.

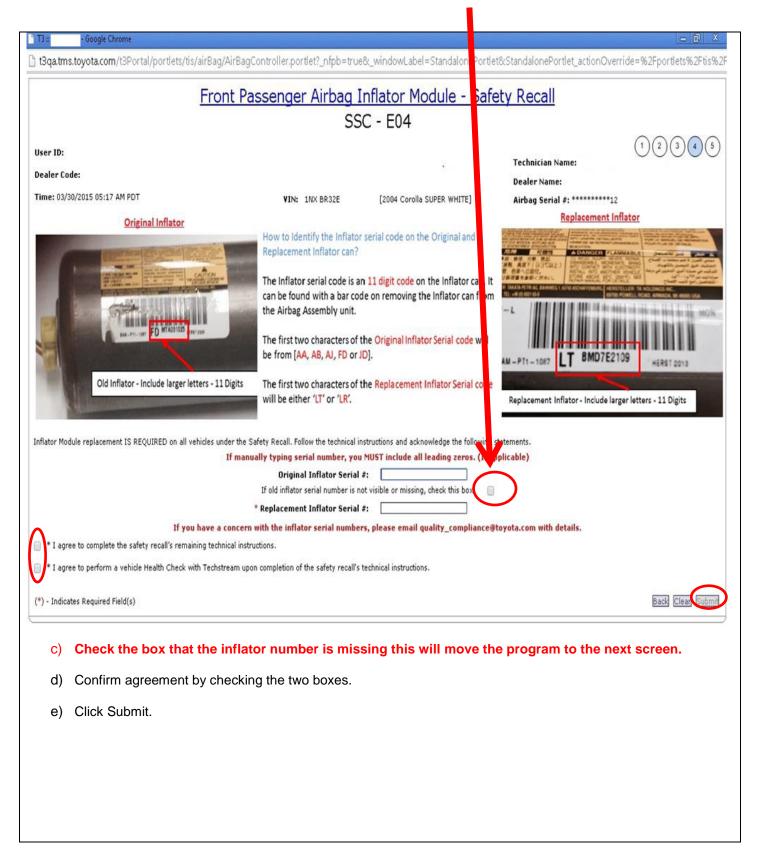

Scan	the New Airbag Assembly Serial Number	
f)	Confirm the cursor is in the serial number box	
g)	Scan the replacement module serial number	
h)	Click next.	
	Front Passenger Airbag Inflator Module - Safety Recall SSC - DSF	
	User ID: SuzukiR Technician Name: Russell	
	Dealer Code: Dealer Name:	
	Time: 06/12/2014 03:43 PM PDT	
	VIN: STD ST44A [2003 Sequoia BELGE M. M.]	
	Record Airbag Serial Number	
	Use of a barcode scanner is strongly recommended when entering Airbag Assembly Serial Number.	
	If manually typing serial number, you HUST include all leading zeros. (If applicable)	
	"New Airbag Assembly Serial Number: 003074902195	
	(*) - Indicates Required Field(s)	

i) Record the Warranty Authorization # to be included in the warranty claim.

T3 :: SuzukiR - Google Chrome	
t3qa.tms.toyota.com/t3Portal/portlets/tis/airBag	/AirBagController.portlet?_nfpb=true&_windowLabel=Standalc
Front Passenger Airbag I	nflator Module - Safety Recall 🥂 🚔
S	SC - DSF
User ID: SuzukiR	Technician Name: Russell
Dealer Code:	Dealer Name:
Time: 06/10/2014 05:13 PM PDT	Airbag Serial #: ********96
Original Inflator Serial #: AAEL5110212	Replacement Inflator Serial #: AAEL5110213
I agree to complete the safety recall's remaining technology	terms and conditions on 06/10/2014 05:13 PM PDT nical instructions. tream upon completion of the safety recall's technical instructions.
VIN - STD BT44A Warranty Au Airbag Innova - stula	ed completion of Airbag Inflator Module Safety Recall for 12003 Sequoia BEIGE M. M.] sthorization #: b5511e9f was replaced updo whic samety recall. ds and then click 'Close' to resume working.
	Close

j) Place the old module in the parts box and take it immediately to the parts department.

NOTE:

- Confirm the cursor is in the correct serial number input box before scanning.
- If the serial number barcode will not scan, it can be entered manually.
- If there are any difficulties or concerns with this process, email Quality_compliance@toyota.com with details.

IF THE ORIGINAL AIRBAG SERIAL NUMBER IS MISSING OR CANNOT BE SCANNED

If the airbag serial number and barcode are not legible or are not present, check the box in the STOP application indicating the serial number is not legible. a) Check the box as shown below. Front Passenger Airbag Inflator Module - Safety Recall SSC - DSF 12343 User ID: SuzukiR Technician Name: Russell Dealer Code: Dealer Name: Time: 06/12/2014 03:43 PM PDT VIN: 5 1NX BR32E 00000000 (2003 Corolla, Beige) **Record Airbag Serial Number** Use of a barcode scanner is strongly recommended when entering Airbag Assembly Serial Number. If manually typing serial number, you MUST include all leading zeros. (If applicable) *Airbag Assembly Serial Number: *Reconfirm Airbag Assembly Serial Number: If original Airbag Assembly serial number is not visible or missing, check this Please contact Region for further information Back Next (*) - Indicates Required Field(s) Note: Do not contact your region for this procedure. b) Record the NEW module serial number in the Serial Number Recording Application. Front Passenger Airbag Inflator Module - Safety Recall SSC - DSF (2)(3)(4)(5)User ID: SubukiR Technician Name: Russell Dealer Code: Dealer Name: Time: 06/12/2014 03:43 PM PDT VIN: 1NX BR32E 00000000 (2003 Corolla, Beige) **Record Airbag Serial Number** Use of a barcode scanner is strongly recommended when entering Airbag Assembly Serial Number. If manually typing serial number, you MUST include all leading zeros. (If applicable) "New Airbag Assembly Serial Number: 003074902196

(*) - Indicates Required Field(s)




Next

X. MODULE REPLACEMENT


1. WORKING WITH AIRBAG

- a) Carefully place the airbag on the bench inflator side up.
 - NOTE: Place clean sheet(s) of paper on the bench to protect the airbag.
- b) Avoid standing directly over the inflator.

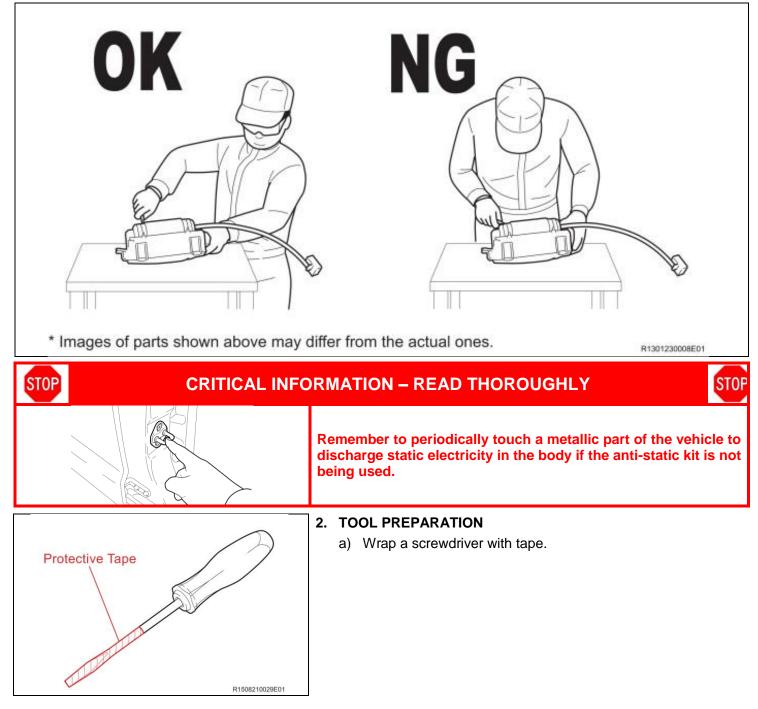

3. REMOVE THE COVER

a) Gently insert the screwdriver between the airbag door and module and disengage the claws holding the door to the module. Please refer to the video below.

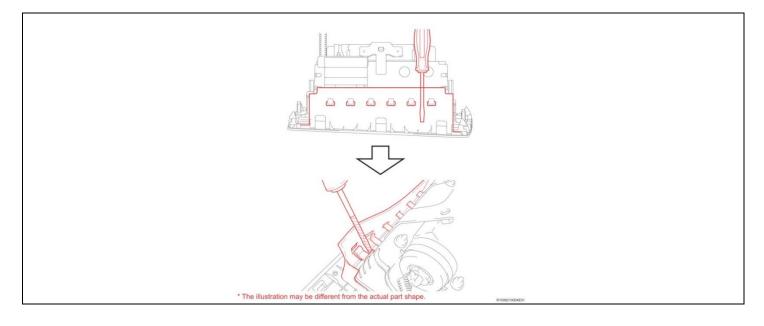


- b) After all the claws have been disengaged separate the module from the door.
- c) Mark the old module so it is not reused.
- d) Inspect the door for damage to the mounting slots.



4. INSTALL THE NEW MODULE

a) Carefully slide the new module into the airbag door.

NOTE: Mounting direction.

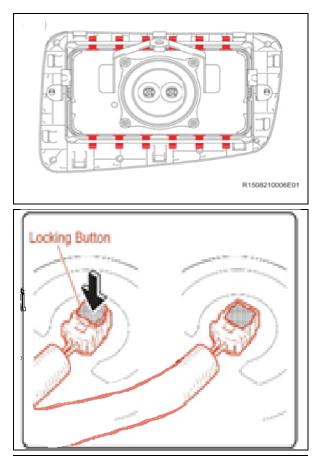

b) Reengage the tangs of the module into the door using the screwdriver with the shaft wrapped in tape.

- c) Connect the new harness to the new module.
- d) Press the lock tab down.

XI. FRONT PASSENGER AIRBAG ASSEMBLY INSTALLATION

1. REINSTALL THE AIRBAG ASSEMBLY

Note: During reinstallation of the airbag assembly, ensure the 12mm bolt and two 10mm nuts securing the airbag assembly to the instrument panel are installed and torqued to the required specification identified on TIS.

a) Refer to TIS for instructions on airbag installation:

Matrix 2003-2005MY 2006MY 2007MY 2008MY


- 2. RECONNECT THE NEGATIVE BATTERY CABLE
- 3. PERFORM A HEALTH CHECK AND DIAGNOSTIC REPORT

◄ VERIFY REPAIR QUALITY ►

- Confirm all precautions are follow to ensure safety during the repair
- Confirm the entire serial number checker application is completed and the warranty authorization # is recorded on *EVERY* vehicle
- Confirm the old module is handled safely and given to the appropriate parts professional for shipment
 - Confirm the new harness connector is fully engaged and routed correctly.

If you have any questions regarding this update, please contact your regional representative.

XII. APPENDIX

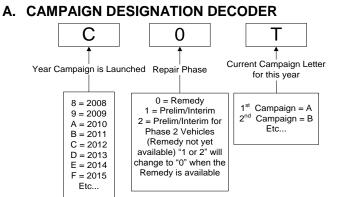

B. CAMPAIGN PARTS DISPOSAL

ALL inflators that are removed from vehicles under this campaign **MUST** be packaged and shipped back to the inflator manufacturer following the manufacturer's instructions. The instructions can be found in the following locations:

• Attached to the dealer letter