#### OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

# 18V-055

**Manufacturer Name:** Indian Motorcycle Company

Submission Date: JAN 16, 2018 NHTSA Recall No.: 18V-055 Manufacturer Recall No.: I-18-01



#### **Manufacturer Information:**

Manufacturer Name: Indian Motorcycle Company

Address: 2100 Highway 55

Medina MN 55340

Company phone: 999

# **Population:**

Number of potentially involved: 7,392 Estimated percentage with defect: 1 %

#### **Vehicle Information:**

Vehicle 1: 2015-2017 Indian Motorcycle Roadmaster

Vehicle Type: MOTORCYCLES

Body Style : OTHER Power Train : GAS

Descriptive Information: The affected population was determined to use the part in question, that may have a

defect.

Production Dates: FEB 04, 2014 - JUL 27, 2017

VIN Range 1: Begin: 56KTRAAA9F3322427 End: 56KTRAAAXH3356878 ✓ Not sequential

#### **Description of Defect:**

Description of the Defect: Operating or storing Indian Roadmaster models in a wet environment may

result in water intrusion into the trunk wiring harness connection. Water intrusion may lead to an electrical short. If not resolved, water could generate

corrosion and further damage electrical hardware.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: Water intrusion into the wiring harness may lead to an electrical short across

terminals resulting in constant illumination of the brake light, even if the

brakes are not applied.

Description of the Cause: Trunk wiring connections on Indian Roadmaster models were manufactured

without plugs that are intended to keep water out of the unused connector

terminal ports.

Identification of Any Warning Trunk and fender mounted brake lights or running lights may remain

that can Occur: illuminated, even after the vehicle is powered down.

## **Supplier Identification:**

## **Component Manufacturer**

Name: Indian Motorcycle Address: 2100 Highway 55

Medina MINNESOTA 55340

Country: United States

#### **Chronology:**

Polaris identified 7 warranty cases in CY 2017 related to water intrusion into the trunk wiring harness connection.

#### **Description of Remedy:**

Description of Remedy Program: Polaris will issue a Safety Recall Bulletin with instructions to remove the

affected wiring harness and replace with an updated wiring harness that

contains plugs in the connectors at no cost to the owner.

If you have had this procedure performed before you received this letter, you may be eligible to receive reimbursement for the cost of obtaining a pre-notification remedy of the problem associated with this recall. For more information regarding obtaining reimbursement please contact the Polaris Consumer Service Department using the contact information

above.

from Recalled Component: prevent water intrusion.

How Remedy Component Differs The updated wiring harness includes connectors that contain plugs which

Part No: 2412717

Name/Description: HARNESS-JUMPER, TRUNK

was Corrected in Production: unused terminals.

Identify How/When Recall Condition All production and supplier inventory was reworked to include plugs in

#### **Recall Schedule:**

Description of Recall Schedule: NR

Planned Dealer Notification Date: JAN 18, 2018 - NR Planned Owner Notification Date: JAN 30, 2018 - NR

\* NR - Not Reported