# Safety Recall Code: 69R6



Subject	Driver Fronta	al Airbag Inflato	r (Takata)				
Revision Summary	Updated inst	tructions for the	mandatory Takata parts return process in Append	lix B.			
Release Date	July 21, 2018	5					
Affected Vehicles	U.S.A. & Ca airba		009-2013 MY Audi vehicles equipped with a Taka	nta driver frontal			
			n Elsa on the day of repair to verify that a VIN qualifies for repair iry & verification source.	under this action.			
	✓ Camp						
	<ul> <li>If Elsa shows other open action(s), inform your customer so that the work can also be completed at the same time the vehicle is in the workshop for this campaign.</li> </ul>						
Problem Description	The driver airbag may explode in a crash with airbag deployment. Sharp metal fragments can hit people and cause serious injury or death. Owners should schedule this recall repair immediately, even if an interim repair was recently done.						
Corrective Action	Replace the o	Replace the driver frontal airbag inflator (final remedy repair).					
Repair Availability	Criteria	Model	Repair Availability and Expected Timing				
Availability	01	Q5	Available				
	02		Available				
	03	A5 Cabriolet	Available				
	04	A 4 Cabrialat	Not Available – September				
	04	A4 Cabriolet	Perform 69N2 if Open				
	05		Not Available – September				
	05		Perform 69N2 if Open				
	06		Not Available – September				
			Perform 69N2 if Open				
	07	A3/A4	Not Available – September				
	07	Cabriolet	Perform 69N2 if Open				
	08		Not Available – September				
	00		Perform 69N2 if Open				
	09 thru 20		Not Available – September				
			Perform 69N2 if Open				

Code Visibility	On or about February 01, 2018, affected vehicles were listed on the Inventory Vehicle Open Campaign Action report under My Dealership Reports (found on <u>www.accessaudi.com</u> & OMD Web). A list was not posted for dealers who did not have any affected vehicles.
	On or about February 01, 2018, this campaign code showed open on affected vehicles in Elsa.
Owner Notification	Owner notification will take place according to the schedule provided by the National Highway Traffic Safety Administration (NHTSA).
	Owner letter examples are included in this bulletin for your reference.
Additional Information	Please alert everyone in your dealership about this action, including Sales, Service, Parts and Accounting personnel. Contact Warranty if you have any questions.
	IMPORTANT REMINDER ON VEHICLES AFFECTED BY SAFETY & COMPLIANCE RECALLS
	<u>New Vehicles in Dealer Inventory:</u> It is a violation of Federal law for a dealer to deliver a new motor vehicle or any new or used item of motor vehicle equipment (including a tire) covered by this notification under a sale or lease until the defect or noncompliance is remedied. By law, dealers must correct, prior to delivery for sale or lease, any vehicle that fails to comply with an applicable Federal Motor Vehicle Safety Standard or that contains a defect relating to motor vehicle safety.
	<u>Pre-Owned Vehicles in Dealer Inventory:</u> Dealers should not deliver any pre-owned vehicles in their inventory which are involved in a safety or compliance recall until the defect has been remedied.
	Dealers must ensure that every affected inventory vehicle has this campaign completed before delivery to consumers.

#### **Claim Entry Instructions**

After campaign has been completed, enter claim as soon as possible to help prevent work from being duplicated elsewhere. Attach the Elsa screen print showing action <u>open on the day of repair</u> to the repair order.

If customer refused campaign work:

- ✓ <u>U.S. dealers:</u> Submit the request through Audi Warranty Online under the <u>Campaigns/Update</u> option.
- ✓ <u>Canada dealers:</u> Upload the repair order to Audi WIN/Operations/Campaign Closure.

	1						
Service Number	69R6						
Damage Code	0099	0099					
Parts Vendor Code	002	002					
Claim Type	Sold vehicle: 7 10						
	Unsold vehicle: 7 90	0					
Causal Indicator	*Mark airbag inflato	r as causal part					
Vehicle Wash/Loaner	Do not claim wash/l	loaner under this ac	tion				
Vehicles have more th	an one criteria. C	laim all applicat	ole criteria listed below on <u>one</u> claim.				
Criteria I.D.	01 and 8R						
	Install new airbag ir	Install new airbag inflator.					
	Labor operation:	6958 5699	95 T.U.				
	Quantity	Part Number	Description				
	1.00	8R0898201B*	Airbag Inflator				
Criteria I.D.	02 and 8R						
	Install new airbag ir	nflator.					
	Labor operation:	6958 5699	95 T.U.				
	Quantity	Part Number	Description				
	1.00	8R0898201C*	Airbag Inflator				
Criteria I.D.	03 and 8F						
	Install new airbag ir	nflator.					
	Labor operation:	6958 5599	85 T.U.				
	Quantity	Part Number	Description				
	1.00	8F0898201A*	Airbag Inflator				
Criteria I.D.	04 and 8H						
	Repair Not Availabl	e					

#### Continue to next page

Criteria I.D.	05 and 8P or 05 and 8H
	Repair Not Available
Criteria I.D.	06 and 8P
	Repair Not Available
Criteria I.D.	07 and 8P
	Repair Not Available
Criteria I.D.	08 and 8P
	Repair Not Available
Criteria I.D.	09 thru 20 and 8H
	Repair Not Available

#### Customer Letter Example (USA)

This notice applies to your vehicle: <VIN>

NHTSA: <INSERT NUMBER>

#### Subject: Safety Recall 69R6 – Driver Frontal Airbag Inflator (Takata) Certain 2009-2013 MY Audi Vehicles

Dear Audi Owner,

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act. Audi has decided that a defect, which relates to motor vehicle safety, exists in certain 2009-2013 model year Audi vehicles. Our records show that you are the owner of a vehicle affected by this action.

	DANGER!
Th	e driver airbag may explode in a crash with airbag deployment.
Sharp	metal fragments can hit people and cause serious injury or death.
What should you do?	Schedule this recall repair immediately, even if an interim repair was recently done.
	Please contact your authorized Audi dealer without delay to schedule this recall repair. For your convenience, you can also visit <u>www.audiusa.com</u> and click on the "Find a Dealer" link to locate a dealer near you and schedule this service.
What will we do?	To correct this defect, your authorized Audi dealer will replace the driver airbag inflator in your vehicle. This work will take about two hours to complete and will be performed for you free of charge.
	Please keep in mind that your dealer may need additional time for the preparation of the repair, as well as to accommodate their daily workshop schedule.
Lease vehicles and address changes	If you are the lessor and registered owner of the vehicle identified in this action, the law requires you to forward this letter immediately via first-class mail to the lessee within ten (10) days of receipt. If you have changed your address or sold the vehicle, please fill out the enclosed prepaid Owner Reply card and mail it to us so we can update our records.
Can we assist you further?	If you need help scheduling this repair, or if your authorized Audi dealer fails or is unable to complete this work free of charge within a reasonable time, please contact Audi Customer Experience at 1-800-253-2834 or via our "Contact Us" page at <u>www.audiusa.com</u> .
Checking your vehicle for open Recalls and Service Campaigns	To check your vehicle's eligibility for repair under this or any other recall/service campaign, please visit the <b>Recall/Service Campaign Lookup</b> tool at <u>www.audiusa.com</u> and enter your Vehicle Identification Number (VIN).

If you still cannot obtain satisfaction, you may file a complaint with: The Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue, SE., Washington, DC 20590; or call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153); or go to <u>http://www.safercar.gov</u>.

We apologize for any inconvenience this matter may cause; however we are taking this action to help ensure your safety and continued satisfaction with your vehicle.

Sincerely,

Audi Customer Protection

#### Customer Letter Example (CANADA)

This notice applies to your vehicle: <VIN>

#### Subject: Safety Recall 69R6 – Driver Frontal Airbag Inflator (Takata) Certain 2009-2013 MY Audi Vehicles

Dear Audi Owner,

This notice is sent to you in accordance with the requirements of the Motor Vehicle Safety Act. Audi has decided that a defect, which relates to motor vehicle safety, exists in certain 2009-2013 model year Audi vehicles. Our records show that you are the owner of a vehicle affected by this action.

#### DANGER!

#### The driver airbag may explode in a crash with airbag deployment.

#### Sharp metal fragments can hit people and cause serious injury or death.

What should you do?	Schedule this recall repair immediately, even if an interim repair was recently done.
	Please contact your authorized Audi dealer without delay to schedule this recall repair.
What will we do?	To correct this defect, your authorized Audi dealer will replace the driver airbag inflator in your vehicle. This work will take about two hours to complete and will be performed for you free of charge.
	Please keep in mind that your dealer may need additional time for the preparation of the repair, as well as to accommodate their daily workshop schedule.
Lease vehicles and address changes	If you are the lessor and registered owner of the vehicle identified in this action, the law requires you to forward this letter immediately via first-class mail to the lessee within ten (10) days of receipt. If you have changed your address or sold the vehicle, please fill out the enclosed prepaid Owner Reply card and mail it to us so we can update our records.
Can we assist you further?	If your authorized Audi dealer fails or is unable to complete this work free of charge within a reasonable time, please contact Audi Customer Relations Monday through Friday from 8AM to 8PM EST at 1-800-822-2834 or via our "Contact Audi Canada" page at <u>www.audi.ca</u> .

We apologize for any inconvenience this matter may cause; however we are taking this action to help ensure your safety and continued satisfaction with your vehicle.

Sincerely,

Audi Customer Protection

## 

- The driver frontal airbag inflator could potentially rupture (due to propellant degradation occurring after longterm exposure to absolute high humidity and temperature cycling). In the event of an inflator rupture, in very rare cases metal fragments could pass through the airbag cushion material, which may result in serious injury or death.
- All Takata Recalls should be performed before any other work is performed on the vehicle.

#### 

Risk of injury. Refer to "Warning and Safety Precautions", found in Appendix A at the end of this document.

#### 

- Damages resulting from improper repair or failure to follow these work instructions are the dealer's responsibility and are not eligible for reimbursement under this action.
- This procedure must be read in its entirety prior to performing the repair.
- Due to variations in vehicle equipment and options, the steps/illustrations in this work procedure may not identically match all affected vehicles.
- Diagnosis and repair of pre-existing conditions in the vehicle are not covered under this action.

#### **Required Parts**

Criteria	<b>Quantity</b>	Model (model code)	Part Number	Part Description	
01	1	Q5 (8R) -	8R0898201B	Airbag Inflator Kit Without Vibration Damper	
02	1		8R0898201C	Airbag Inflator Kit With Vibration Damper	
03	1	A5 Cabriolet (8F)	8F0898201A	Airbag Inflator Kit With Vibration Damper	
04 through 20	Repair Not Available - Perform 69N2 if Open				

#### 

All inflator kits include inflator, inflator nuts, horn ring bolts, and return instructions.

### **Required Safety Equipment**





• Ear Protection (locally sourced).

• Face Shield (locally sourced).

### **Required Tools**





• ESD Worksurface - VAS 6613

• Bar Code Scanner – VAS6161/1





• Airbag Support - T10568

• VAS6150D - Diagnostic Tester (or equivalent)



• VAG1410 - Torque Wrench (or equivalent)

#### **Required Work Environment**

#### 

#### Risk of injury.

It is critical that a clean, uncongested work environment is utilized during the inflator replacement procedure. Extra tools, debris, etc... in the blast area of an airbag impose a danger in the event an airbag were to deploy. Ensure there are no loose components in the blast area of the airbag.

### **I**NOTE

The work area must be in the vicinity of the scan tool and the vehicle in order to properly complete this procedure.



- Workbench that will support a vice.
- Work surface free of unnecessary tools, equipment and debris.

### **Repair Instruction**

#### **Section A - Check for Previous Repair**



• Enter the VIN in Elsa and proceed to the "Campaign/Action" screen.

#### 

On the date of repair, print this screen and keep a copy with the repair order.

- Confirm the Campaign/Action is open <arrow 1>. If the status is closed, no further work is required.
- Note the Applicable Criteria ID <arrow 2> for use in determining the correct work to be done and corresponding parts associated.

**Proceed to Section B** 

#### 

#### Risk of injury.

- People in the immediate vicinity of the workplace must be protected from possible noise and projectiles.
- Pyrotechnic components can trigger unintentionally.
- In the event of unintentional deployment:
  - Single-stage generators: allow airbag to cool down completely. Wait at least 10 minutes before handling.
  - Two-stage generators: wait for second airbag ignition. Allow airbag to cool down completely. Wait at least 10 minutes before handling.



• Prior to beginning repairs, verify the horn is operational.


### 

Diagnosis and repair of an inoperable horn, before or after inflator replacement, will not be covered under this campaign.



• Use the QR code or the link to view a video detailing the repair process prior to performing the repair.

https://audiacademy.kzoplatform.com/player/medium/811705205740 540937

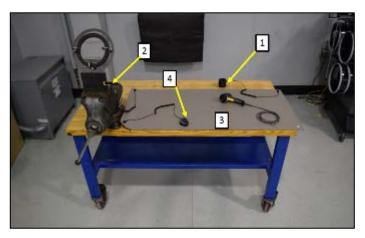


## NOTE

- Prior to beginning work, all parts and tools are to be placed on the ESD table mat.
- The workstation must be in the vicinity of the vehicle.
- Assemble ESD workplace -VAS 6613- <1, 2, 3, and 4>.
- Plug ESD workplace into a wall socket using plug <1>.

#### 

The wall socket or extension cord must have a sufficient ground.

- Clamp Airbag Support T10568 <2> into the vice.
- Connect crocodile clip <1> to airbag support <2> and ESD workplace -VAS 6613-.

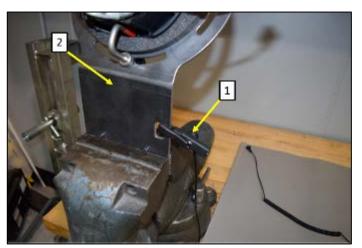



- Ensure ODIS is updated to the latest version.
- Connect vehicle diagnostic tester to the vehicle.
- Select Start Diagnosis function and identify vehicle.
- After identification of control units, Guided Fault Finding is started automatically.
- Follow the instructions on screen.

iporter:	444	VIN:	CONTRACTOR OF A				
saler:	03999	Engine:	CADA 2.01 TFSI / 155 kW	1. 1.		Promotion To a sur	men
D:						NACHERALDER & G. C.	17760
ntrol mod 1	Test plan	Poeration Special Functions				Operating modes	£ .
ests in current test plan		C Test overview				Diagnosis	
	ed according to chance	i onernen frieben orospa to ooy		-		DBD	11
= E139-St	unroof Regulator (RG.6	Suspension, Wheels, Brakes, Steering	ig (Rep. Gr. 01; 40 - 49)			C Tim	11
= E582-TR	It Sunroof Button 1 (RC	Body (Rep.Gr. 01; 27; 50-97)				A Measurement	11
= G525-Ri	ear Lid Closed Sensor	Software Version Management (SVM	ŋ	10		info	11
- G526-R	3	<ul> <li>Build status documentation</li> </ul>				Admin	511
- V6-Wind	tshield Washer Lamp (	Airbag				- SE	
= 19 - Röng	g break diagnosis (RG.	Documents harness connectors		-		Log	U,
		Vehicle information documents				Data	¥
				-		Extras	¥
		5	Attach to the test plan	Close		Extras	
						Help	
139_87_601_0306	_21@00021				1	info	8°.
erform tes <mark>2</mark>	Select se	lf test				> 🖾	0
) 🙆 🗖			ALC: NO. OF TAXABLE	- 1	. 5 8	10 R - 10 2550	AM 1017
<ul> <li>Select th</li> </ul>	ne "Test plan"	tab <1>.					
	Select self tes						
	<i>"_</i>						
<ul> <li>Open the</li> </ul>	e "Build status	s documentation" dropdow	n <3>.				

- Highlight "Airbag" <4>.
- Select "Attach to the test plan <5>.


mporter:	444	VIN:		an 1 m	
)ealer:	03999	Engine:	CADA 2.0I TFSI / 155 kW		
80;	-				
ontrol modules Ord	ers DISS TSB Testplan C	Operation Special Functions			Operating modes *
ests in current test p	Aan				Diagnosis
Status Tests	(sorted according to chances	of success)			() OBD
- DE1	39-Sunroof Regulator (RG.60	)			C Plant
- DES	82-Tilt Sunroof Button 1 (RG.)	96)			
- 00	25-Rear Lid Closed Sensor 1	(RG.55)			Measurement
- 36	26-Rear Lid Closed Sensor 2	(RG.55)			trifo
1.00	-Windshield Washer Pump (R				Admin
	Ring break diagnosis (RG.9	0).			Log *
= 🔒 Air	bag	1		-	Data *
					Extras ¥
					Help ¥
234_X_1_0416_11.	.BZD_Airbag			4 *	Info *
Perform test	2 Felect self	test			> 🖾 📀
9 ê 🧧		100 M	The NUMBER OF	- V 🖲 🕴	🐿 👘 🕷 4) - 10.52 AM 1/13/2017
• Highl	ight the "Airbag" t	est plan <1>.			
Selec	t "Perform test'	· -0>			

Officiaril Dageortic In Importer:	tormation System Service - 113 444	VIN:				
Dealer:	03999	Engine:	CCTA 2.0 L Motronic/147kW	real Ly		R. BARTER
RO;						
CONCINCIAL D	DISS TSB	Operation Special Processory			Operating mod	les t .
Airbag ABD				Complete/Continue	Diagnosis	
NOTE:					(a) caro	
This program assi	sts you with the back documer	ntation of the part number of the new o	as generator/airbag module for the		di tain'	
airbag system.					A Measurem	vent s
	anned value with the value	shous the bar code on			😭 Info	
the gas generat	or or between the asterisks there be a discrepancy in t	("") on the airbag			Q Admin:	
- configure the a	e manually in the input fiel canner after the completion r code from the description	n of the program with			Log	
					Data	
					Current View	
					De Print	
					Diagnostic Ses	ssion
					· (11) (11)	
			-		C. Herr	-
	K	< > >	Help Cancel test		>	0
0 6				- 5 8 8	Annual Income	241 PM

- Scanning the data matrix code during this test plan step calibrates the scanner to avoid error messages.
- Scanning the calibrating data matrix code may not have to be done every time. Only when the scanner requires calibration. You will know if the scanner needs calibrating if the scanner does not scan the inflator's data matrix code.
- If the inflator data matrix code cannot be scanned, then print out the data matrix code shown below and scan the printout.




• After calibrating the scanner, select "Complete/Continue"

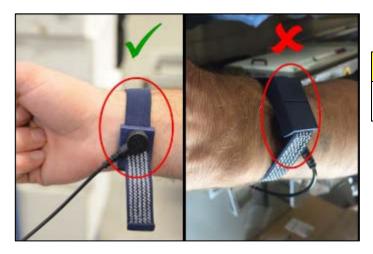

• Put the wrist strap from the ESD workplace on your wrist.

#### 

The white dots on the wrist strap must be against the skin.

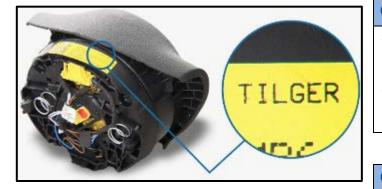

#### 

- There are two types of inflator. One version is "with vibration absorption" and one is "without vibration absorption".
- Airbags with vibration absorption may be identified by the word "TILGER" on the label found on the airbag.

### 

In the event an airbag had previously been replaced, the replacement airbag may have an inflator WITH the vibration absorber. If this situation is encountered, the inflator WITH vibration absorption MUST be installed:

- Repackage the previously scanned inflator and return to the parts department.
- Acquire the correct inflator from the parts department.
- Scan the new inflator using the GFF test plan.
- Install the new inflator, following the "Inflator versions WITH vibration absorption" instructions.



- Place the new inflator on the ESD mat.
- Scan the data matrix code of the new inflator at a distance of about 15 cm.

### 

Ensure the correct inflator is scanned and installed into the vehicle.

<u>Crit.</u>	Model (model code)	Part Number
01		8R0898201B
02	Q5 (8R)	8R0898201C
03	A5 Cabriolet (8F)	8F0898201A

### **I**NOTE

The photo is for reference only. The inflator that is installed may be either a single stage or dual stage inflator.


	formation System Service - 3.1.1					Name (	-
nporter: )ealer: tO:	444 03999	VIN: Engine:	CCTA 2.0 L Motronic/147K	v	2 🛃 📎		-
	DISS TSB	Operation Special Functions				Operating modes	a .
Airbag ABD	1 1 1 1			RXL	1	🕲 Diagnosis	
Input				A	ccept	() ono	
Scan the barcode			*			All States	
(DNOTE						A Veasurement	
the second state of the se	meric values are displayed v	vhile Caps Lock is				😭 into	11
acuve.						@eann	
						Log	*
						Data	*
						Current View	1
						D Print	
						Diagnostic Session	9
			-			CE blog:	1
	K	< > >	Help Canceltest			Contraction of the local division of the loc	3
🙃 e 🤞	s 🐨 🏩 🖉				- 5 8 8 1	N <sup>1/1</sup> B → 1 → 2:50	PM 2017
Once the	e new inflator has	been successfully sc	anned, press "Accept"				

#### 

- Compare the scanned value with the value shown above the data matrix code on the new inflator.
- If there is a discrepancy, manually enter the value from the new inflator in the input field.
- If no value appears, recalibrate the scanner.

nporter:	444	VIN:			
ealer:	03999	Engine:	CCTA 2.0 L Motronio/147kW		
0:					Operating modes *
	DISS TSB Test plan	Operation Special Functions			Diagnosis
intag ABD				-1-	
Driver/front passenger side				-2-	(B) (HD)
n which side was	the gas generator replaced?				- Charles
Driver side				.3.	A Measurement
2. Front passenge 3. Back	rside			-4-	😭 info
. Cancel					(Q Amin
					Log ¥
					Data *
					Current View
					D Print
					Diagnostic Session
					CB Stop.
No.1					S Hest
	K	< > >	Help Cancel test		» 🛛 🔅
	- m - 0				250 PM
• Sel	ect option 1 indica	ating that the Driver sid	le inflator was replaced.		
<ul> <li>Alte</li> </ul>	er selecting optio	n 1, a valid Gero iD	will need to be entered in	order to upload	a the new inna

Continue to Section C.

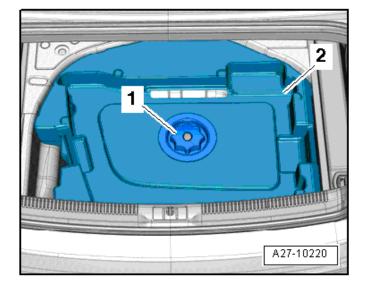

#### **A5 Cabrio Procedure**

#### 

Accident risk. When working on pyrotechnic components (such as airbags and belt tensioners), the battery must be disconnected with the ignition switched **ON**.

### 


Before disconnecting the battery, it is recommended to record the customer's radio presets so they can be restored before returning vehicle to the customer.

- Turn **ON** the ignition.
- Move the driver seat to the most rearward position.
- Fully recline driver seat.

#### 


Reclining the driver seat before disconnecting the battery allows for additional safety in the event Terminal 15 power is not restored when reconnecting the battery at the end of the repair.

- Lift the luggage compartment floor and engage it on the body.
- Remove the wind deflector from its mount.
- Remove the nut <1> and remove the wind deflector mount <2>.

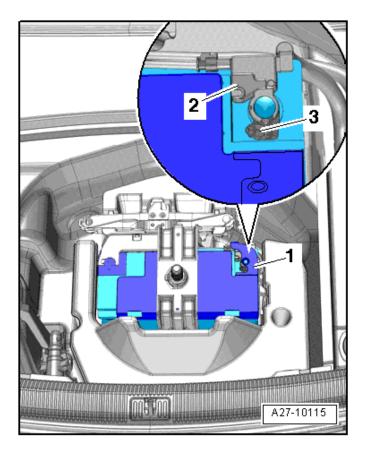

- Open the cover <1> over the battery negative terminal.
- Make sure the ignition is turned **ON**.
- Loosen the nut <3>.
- Remove and isolate the battery ground cable terminal <2> from the battery terminal.

Continue to Section D.

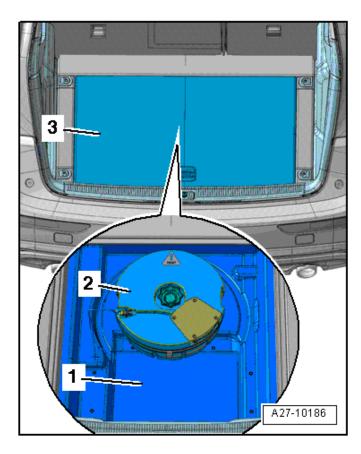

### Q5 Procedure

#### 

Accident risk. When working on pyrotechnic components (such as airbags and belt tensioners), the battery must be disconnected with the ignition switched **ON**.

#### 


Before disconnecting the battery, it is recommended to record the customer's radio presets so they can be restored before returning vehicle to the customer.

- Turn **ON** the ignition.
- Move the driver seat to the most rearward position.
- Fully recline the driver seat.

### 

Reclining the driver seat before disconnecting the battery allows for additional safety in the event Terminal 15 power is not restored when reconnecting the battery at the end of the repair.


- Remove the luggage compartment floor covering <3>.
- Remove the dirt tray, if applicable.
- If equipped, remove the subwoofer <2>.
- Fold back the carpet <1> over the cover.

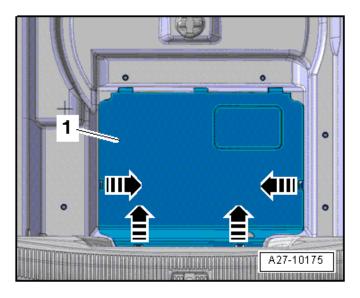

### 

The cover is available with varying numbers of retaining clips.

• Unlock the retaining tabs <arrows> and open the cover <1>.

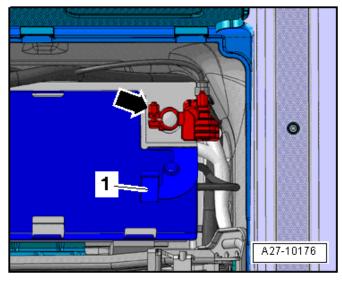


Section D – Airbag Removal

- Open the cover <1> over the battery negative terminal.
- Make sure the ignition is turned **ON**.
- Loosen the nut <arrow>.

•


• Remove and isolate the battery ground cable terminal from the battery pole.


Continue to Section D.

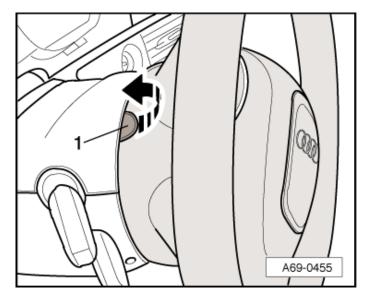

### **Bolted Airbag Version**

- Adjust the steering column as far down as possible.
- Turn the steering wheel so the cap <1> on the rear side of it faces upward. This is approximately the 12:00 position.
- Pry the cap off <arrow>.

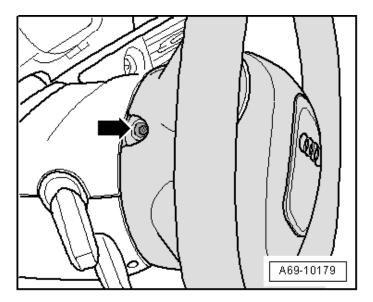

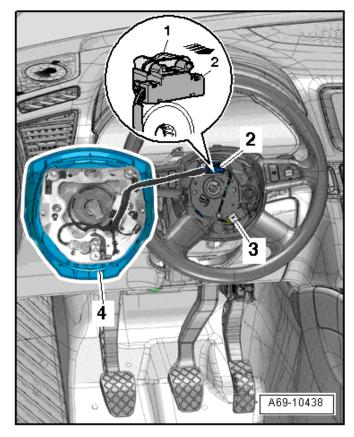

- Remove the driver airbag bolt <arrow>.
- Turn the steering wheel 180° and repeat the procedure on the opposite side.

#### 


Before handling pyrotechnic components (for example, disconnecting the connector), the person handling it must "discharge static electricity". This can be done by touching the door striker, for example.


- Bring the steering wheel back into the center (wheels are straight).
- Remove the driver airbag from the steering wheel slightly.
- Pull connector lock <1> as far as stop <arrow>. This releases the electrical connector <2> and it can be removed.
- Versions with Multi-function and Tiptronic steering wheel: Disconnect the connector <3>.
- Remove the airbag <4>.

#### 

Set the airbag down so the logo on the impact cushion faces upward.

**Continue to Section E** 

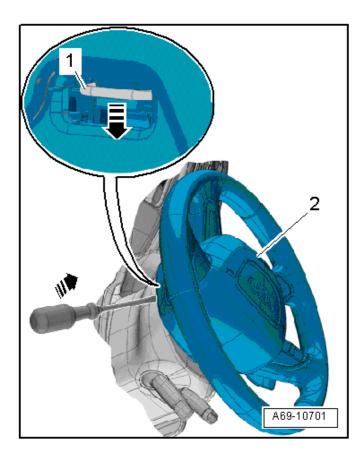

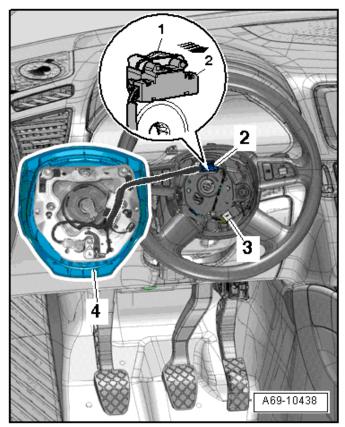

#### **Attached Airbag Version**

- Adjust the steering column as far down as possible.
- Turn the steering wheel so the opening on the rear side of it faces upward. This is approximately the 12:00 position.
- Release the locking bracket <1> in the direction of the arrow using a T25 TORX screwdriver, approximately 100 mm long.

#### 

Electrical wires can be damaged with a flat-head screwdriver. Damage to the wiring is not covered under this action.

• Turn the steering wheel 180° and repeat the procedure on the opposite side.

#### 

Before handling pyrotechnic components (for example, disconnecting the connector), the person handling it must "discharge static electricity". This can be done by touching the door striker, for example.

- Bring the steering wheel back into the center (wheels are straight).
- Remove the driver airbag from the steering wheel slightly.
- Pull connector lock <1> as far as stop <arrow>. This releases the electrical connector <2> and it can be removed.
- Versions with Multi-function and Tiptronic steering wheel: Disconnect the connector <3>.
- Remove the airbag <4>.

#### 

Set the airbag down so the logo on the impact cushion faces upward.

#### **Continue to Section E**

#### Section E – Inflator Replacement

#### 

#### Risk of injury.

- People in the immediate vicinity of the workplace must be protected from possible noise and projectiles.
- Pyrotechnic components can trigger unintentionally.
- In the event of unintentional deployment:
  - Single-stage generators: allow airbag to cool down completely. Wait at least 10 minutes before handling.
  - Two-stage generators: wait for second airbag ignition. Allow airbag to cool down completely. Wait at least 10 minutes before handling.

#### 


Risk of injury.

It is critical that a clean, uncongested work environment is utilized during the inflator replacement procedure. Extra tools, debris, etc... in the blast area of an airbag impose a danger in the event an airbag were to deploy. Ensure there are no loose components in the blast area of the airbag.



#### 


- Prior to beginning work, all parts and tools are to be placed on the ESD table mat.
- The workstation must be in the vicinity of the vehicle.

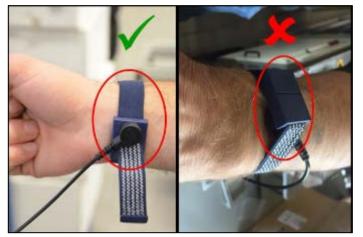


• Put the wrist strap from the ESD workplace on your wrist.

#### 

The white dots on the wrist strap must be against the skin.

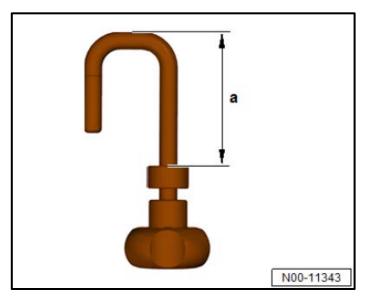

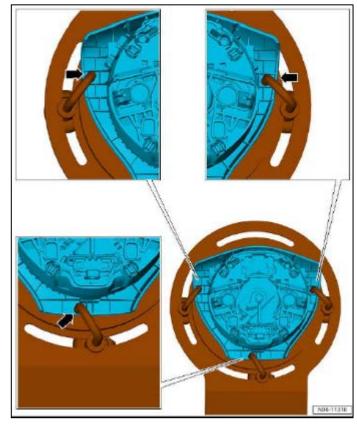

## 

Tighten mounting by hand to prevent damage.

• Adjust three knurled nuts of securing hooks to <dimension a> 50mm.


• Clamp airbag centrally in airbag support. There are securing points on the sides <arrows>, parallel opposite each other and below.

### 


The clamps must be placed in the positions shown <arrows> to prevent damage to the airbag. Damage to the airbag is not covered under this action.

## 

The style of barcode has no bearing on the following installation instructions.

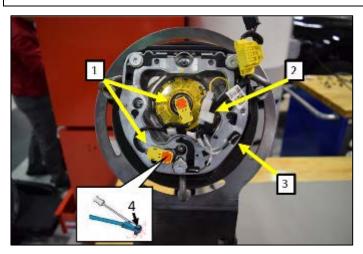


- Disconnect connector <1> using a small flat bladed screwdriver to disengage connector lock <4>.
- Disconnect connectors <2 and 3>.

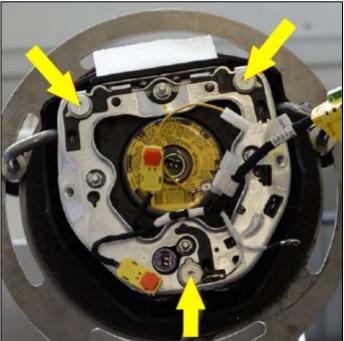

- Remove and discard the three horn ring bolts <arrows>.
- Remove the horn ring.

### 

When removing the horn ring, take care that the springs are not lost as they are not available separately. Replacement of the airbag is required if a spring is lost and is not covered under this action.

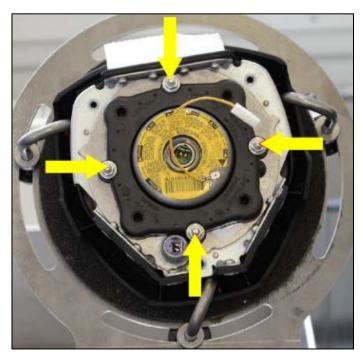

• Remove and discard the four nuts <arrows>.

### **I**NOTE

Inflator with vibration absorption shown. The photo is for reference only.

• Remove the inflator and place in the original packaging.

## **I** NOTE


Inflator return instructions are included with the new inflator.


# Inflator versions WITH vibration absorption (Criteria 02, 03):

• Install the new inflator onto the studs.


Part Number	Part Description
8R0898201C	Inflator Kit – Criteria 02
8F0898201A	Inflator Kit – Criteria 03

• Ensure the recess on the inflator lines up properly with the tab on the airbag <arrow>.

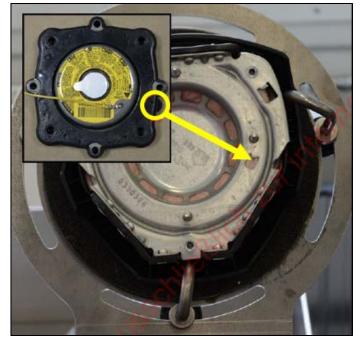

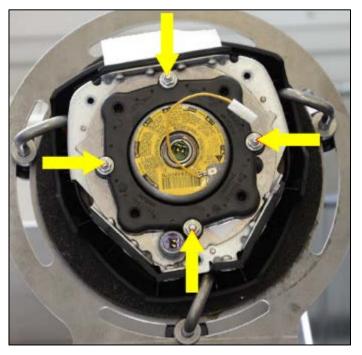

 Install the new inflator and torque nuts <arrows> to 4.5 Nm.

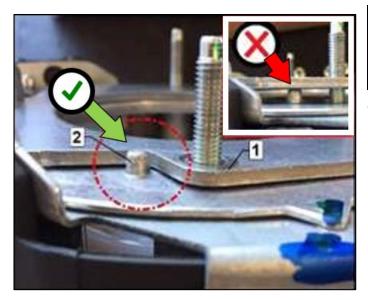


# Inflator versions WITHOUT vibration absorption (Criteria 01):

### 🗚 DANGER

The inset illustrates the plate resting on the tab. Failure to install the plate properly could cause improper airbag operation.

 Install the plate included in the kit so that the recess on the plate <1> aligns with the tab <2> on the airbag.

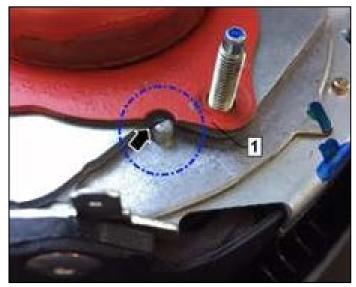

• Install the new inflator onto the studs.


Part Number	Part Description
8R0898201B	Inflator Kit – Criteria 01

• Ensure the recess on the inflator <1> lines up properly with the tab on the airbag <arrow>.


### **I**NOTE

In the event an airbag had previously been replaced, the replacement airbag may have an inflator WITH the vibration absorber. If this situation is encountered, the inflator WITH vibration absorption (part # 8R0898201C) MUST be installed:


- Do not install the plate included in the 8R0898201B kit.
- Repackage the previously scanned inflator and return to the parts department.
- Acquire the correct inflator (part # 8R0898201C) from the parts department.
- Scan the new inflator using the GFF test plan.
- Install the new inflator, following the "Inflator versions WITH vibration absorption (Criteria 02, 03)" instructions.
- Install the new inflator nuts <arrows> and torque to 4.5 Nm.

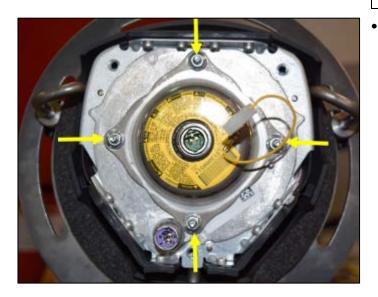


#### CONTINUED FOR ALL INFLATOR VERSIONS:

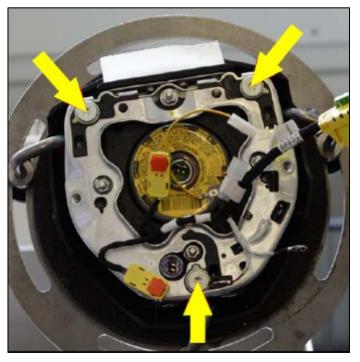

• Install the horn ring and tighten the bolts <arrows> to 6 Nm.

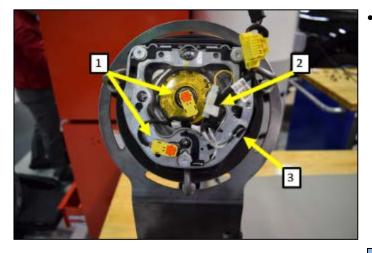

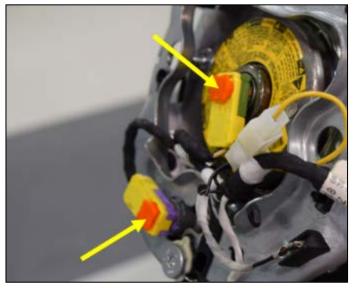

## Install connectors <1, 2 and 3>.

## 


Ensure the connector locks <arrows> are fully opened as shown when installing the connectors.



- Engage the connector locks.
- Ensure all wire connections are secure and the airbag harness is routed correctly.

Continue to Section F.


#### Section F – Airbag Installation

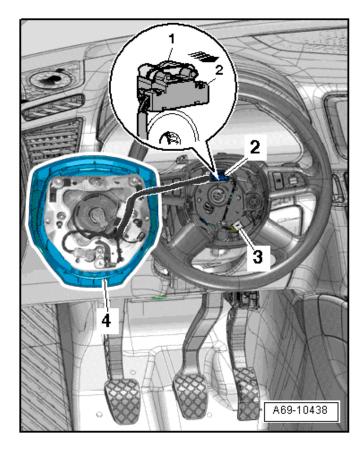

#### **Bolted Airbag Version**


### 

- The battery must be disconnected before installing the airbag back into the vehicle.
- Before handling pyrotechnic components (for example, disconnecting the connector), the person handling it must "discharge static electricity". This can be done by touching the door striker, for example.
- Connect the spiral spring electrical connector <2> with the airbag connector coupling on the coil connector with slip ring.
- Versions with Multi-function and Tiptronic steering wheel: Install the connector <3>.

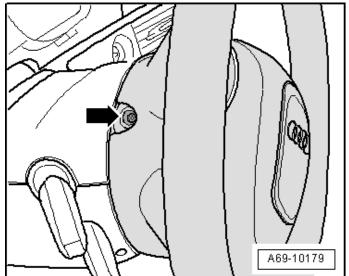

- Position the driver airbag in the steering wheel.
- Install the 2 bolts <arrow> for securing the driver airbag approximately 2 turns.
- Press horn about 3 times to achieve even gap dimension
- Torque the bolts <arrow> to 7 Nm.
- Install the bolt cover caps.

#### Continue to Section G.

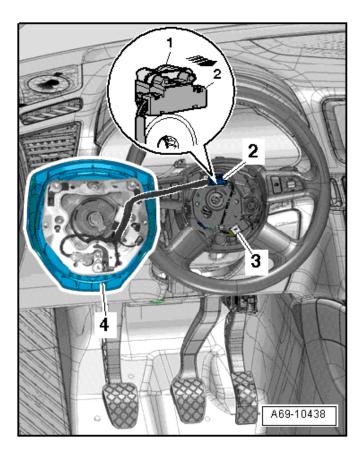


### **Attached Airbag Version**

#### 

- The battery must be disconnected before installing the airbag back into the vehicle.
- Before handling pyrotechnic components (for example, disconnecting the connector), the person handling it must "discharge static electricity". This can be done by touching the door striker, for example.
- Connect the spiral spring electrical connector <2> with the airbag connector coupling on the coil connector with slip ring.
- Press in harness connector to secure in the pockets on the steering wheel.
- Position driver airbag in the steering wheel and press on it until it audibly engages.

Continue to Section G.

#### Section G – Battery Reconnect

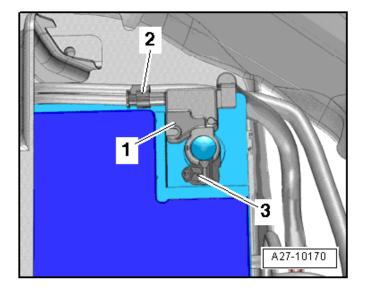

#### **A5 Cabrio Procedure**

#### 

Ignition must be ON when connecting battery. If pyrotechnic components (e.g. airbag, belt tensioner) are not repaired correctly, they may deploy unintentionally after connecting battery. There must not be anyone inside the vehicle when connecting the battery.

- Disconnect the connector <2> from the Battery Monitoring Control Module -J367- <1>.
- Connect the battery ground cable terminal by hand to the battery negative terminal.
- Torque the nut <3> to 6 Nm.
- Reconnect the connector to the Battery Monitoring Control Module -J367-.
- Install the battery terminal cover.

#### 


After connecting the power supply, the ABS warning lamp may only go out after the vehicle has been driven a few yards.


- Install the wind deflector mount <2>.
- Install the nut <1>.
- Install the luggage compartment floor.
- Cycle the ignition off and back on.
- Store previously recorded radio presets (if necessary).
- Set clock to local time.
- Activate the power window regulator one-touch up/down function.
- Check the DTC memories of all the control units and erase under-voltage faults if necessary.
- After completing repairs, verify the horn is operational.

#### 

Diagnosis and repair of an inoperable horn, before or after inflator replacement, will not be covered under this campaign.

#### Repair is complete, proceed to Section H.

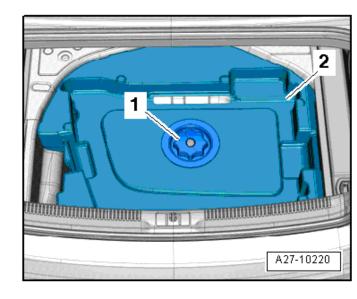

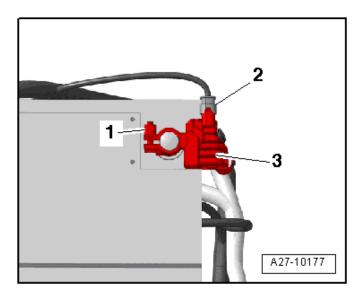

### Q5 Procedure


#### 


- Ignition must be **ON** when connecting battery. If pyrotechnic components (e.g. airbag, belt tensioner) are not repaired correctly, they may deploy unintentionally after connecting battery. There must not be anyone inside the vehicle when connecting the battery.
- If the ignition is not switched on after reconnecting the battery (the indicator lamps in the instrument cluster do not illuminate), the ignition (key/button) may only be switched on while sitting in the driver's seat in the rearmost position.
- Disconnect the connector <2> from the Battery Monitoring Control Module -J367- <3>.
- Connect the battery ground cable terminal by hand to the battery negative terminal.
- Torque the nut <1> to 5 Nm.
- Reconnect the connector to the Battery Monitoring Control Module -J367-.


### 

After connecting the power supply, the ABS warning lamp may only go out after the vehicle has been driven a few yards.

• Install battery terminal cover <1>.

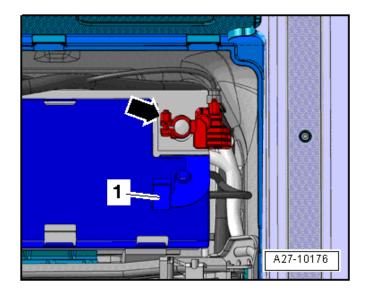

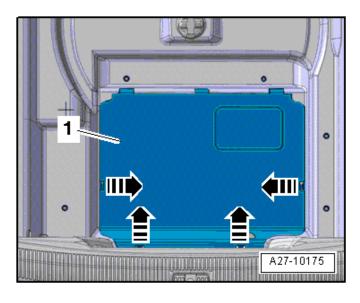

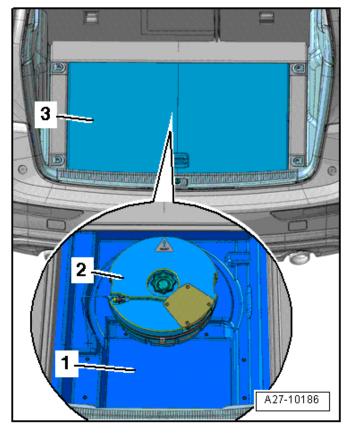

## 

The cover is available with varying numbers of retaining clips.

Install cover <1>.

- Install the carpet <1> over the battery cover.
- If equipped, install the subwoofer <2>.
- Install the dirt tray, if applicable.
- Install the luggage compartment floor covering <3>.
- Cycle the ignition off and back on.
- Store previously recorded radio presets (if necessary).
- Set clock to local time.
- Activate the power window regulator one-touch up/down function.
- Check the DTC memories of all the control units and erase under-voltage faults if necessary.
- After completing repairs, verify the horn is operational.

#### 

Diagnosis and repair of an inoperable horn, before or after inflator replacement, will not be covered under this campaign.

Proceed to Section H.

has be accordar	y that this campaign en performed in strict nce with the applicable i repair procedure.	
SAGA Code:		
Technician:		
Date:		
tem#: AUD4927ENG		

-OR-

Je certifie que cette		
	campagne de rappel a été	
exécutée suivant les strictes		
directives de réparation		
	d'Audi	
Code de SAG	A:	
Technicien:		
Date:		
tem # AUD4927FRE		

• Once the campaign has been completed, the technician should stamp the repair order.

• Stamps are available for ordering through the Compliance Label Ordering Portal.

Repair is Complete, Proceed to Appendix B (Mandatory Takata Parts Return Process).

# Appendix A – Warning and Safety Precautions

#### 

#### General Safety Precautions when Working with Pyrotechnic Components:

- Pyrotechnic components always contain propellant that generates a gas during combustion. In some components, there is also a supply of pressurized gas to ensure this gas is generated
- This pressurized gas is stored under high pressure in a compressed gas container. Pyrotechnic components are triggered by electrical/mechanical igniters.
- Only trained personnel should perform testing, assembly and servicing work. Airbags do not have a replacement interval.
- Never check with test lamps, voltmeter or ohmmeters.
- Only check pyrotechnic components when they are installed in the vehicle using vehicle diagnosis, testing and information systems approved by the manufacturer.
- When working on pyrotechnic components and the airbag control module, disconnect the battery ground strap while the ignition is switched on. Then cover the negative terminal.
- Wait 10 seconds after disconnecting the battery.
- The ignition must be SWITCHED ON when connecting the battery. There should not be anyone inside the vehicle when doing this.
- Exception: vehicles with batteries in the passenger compartment. In this case, stay outside the range of the airbags and seat belts.
- Wash your hands after touching ignited pyrotechnic components from the restraint system.
- Do not open or repair pyrotechnic components. Use only new components to reduce the risk of injury.
- Do not install pyrotechnic components that have fallen onto a hard surface or show signs of damage.
- Discharge static electricity before handling pyrotechnic components, for example before disconnecting the electrical connector. This can be done by touching grounded metal objects such as the door striker pin.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Audi dealer. ©2018 Audi of America, Inc. and Audi Canada. All Rights Reserved.

- Install pyrotechnic components immediately after removing them from their transport packaging. If you must stop working, store the pyrotechnic component in its original transport packaging.
- Do not leave pyrotechnic components lying in the open unattended.
- Do not treat pyrotechnic components with grease, cleaning solutions or similar products.
- Do not expose pyrotechnic components to temperatures above 100 °C, even for brief periods of time.
- People in the immediate vicinity of the workplace must be protected from possible noise and projectiles.
- Pyrotechnic components can trigger unintentionally.
- In the event of deployment:
  - Single-stage inflators: allow airbag to cool down completely. Wait at least 10 minutes before handling.
- Two-stage inflators: wait for second airbag ignition. Allow airbag to cool down completely. Wait at least 10 minutes before handling.

## Appendix B – Mandatory Takata Parts Return Process

NOTE

