

# Safety Recalls N138 and H081 AJ20P 4 Cyl Gasoline Engines – Fuel Rail leaking



- New safety recalls were announced February 7th affecting certain 18MY Jaguar and Land Rover models fitted with 4 cyl AJ20P gasoline engines. Service Bulletins with Q & A have been posted to Infotrail and JBN. SRE18-03 and SRE18-03C. 7-142USA2 and 7-142CAN2
- Models affected:
  - Jaguar 18MY XF/XE/F-PACE/E-PACE and F-TYPE Recall H081
  - Land Rover 18MY Discovery Sport, Evoque and 18MY Range Rover Velar. Recall N138
- Defect: The brazing of the engine fuel rail end caps is inconsistent and may not meet the design condition, thereby not sealing the fuel rail ends. Fuel vapor and liquid fuel leaks can occur over time.
- Prior to recall launch please submit EPQR's for any vehicle with a fuel rail leak and attach a short video clearly showing source of leak
- There are several reports of fuel leaks but there have been no reports of accidents, injuries or fires.
- Affected vehicles will need a replacement fuel rail plus 4 injector seal kits
- Parts and technical repair bulletins are expected to be available week of March 12<sup>th</sup> 2018. Initial parts shipments will be pushed to stores
- Check DDW to confirm which vehicles are affected. Not all vehicles in the VIN range are affected. Lists of unsold new vehicles are published on JBN/Infotrail
- Affected new cars must not be sold prior to completing the recall repair.
- Customer notification is scheduled to begin March 16<sup>th</sup> 2018.

