OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

## 18V-126

**Manufacturer Name:** Kaufman Trailers of NE, Inc.

Submission Date: FEB 20, 2018 NHTSA Recall No.: 18V-126 Manufacturer Recall No.: NR



#### **Manufacturer Information:**

Manufacturer Name: Kaufman Trailers of NE, Inc.

Address: 706 North Silver St.

Lexington NC 27292

Company phone: 7906800

## **Population:**

Number of potentially involved: 81 Estimated percentage with defect: 7 %

#### **Vehicle Information:**

Vehicle 1: 2018-2018 Kaufman FE-3/7K-44 & FE-3/7K-47

Vehicle Type: TRAILERS

Body Style : Power Train : NR

Descriptive Information: On a small percentage of these two trailer models, the axles installed were

manufactured with an incorrect spindle. On axles with the incorrect spindle there is the potential for the axle spindle to break between the inner and outer bearings. If this happens there is the immediate loss of the wheel and hub from the trailer, creating a dangerous situation for the truck towing the trailer, as well as other motorists that the wheel/hub could impact. Many of the two models listed that were produced during this time frame were manufactured with the correct spindle.

Production Dates: JUL 01, 2017 - FEB 14, 2018

VIN Range 1 : Begin : NR End : NR Not sequential

#### **Description of Defect:**

Description of the Defect: A spindle failure (fatigue/stress loading leading to shear failure) has been

identified in the extreme loading conditions of the 8k hybrid spindle triple axle

application.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: On axles with the incorrect spindle there is the potential for the axle spindle

to break between the inner and outer bearings. If this happens there is the immediate loss of the wheel and hub from the trailer, creating a dangerous situation for the truck towing the trailer, as well as other motorists that the

wheel/hub could impact.

Description of the Cause: NR

Identification of Any Warning NR that can Occur:

### **Supplier Identification:**

### **Component Manufacturer**

Name: Lippert Components, Inc.

Address: NR

NR

**Country: United States** 

#### **Chronology:**

NR

## **Description of Remedy:**

Description of Remedy Program: Kaufman Trailers of NE, Inc. will replace all axles on your trailer that visual

inspection shows to have an incorrect spindle(s). Replacement axles will be installed free of charge at any Kaufman Trailer facility or at a preapproved service center. Axle replacements will take approximately 1-2 hours per axle to complete. It is possible that your trailer may have one or two incorrect axles, but not all three. Only axles that have an incorrect

spindle(s) will be replaced.

How Remedy Component Differs This is done by a quick visual inspection that is illustrated in the recall

from Recalled Component: letter.

Identify How/When Recall Condition As soon as the axle MFG company was notified, they verified a few was Corrected in Production: incorrect spindles had been used for the axles used on the two models referenced in this recall. They immediately rectified the problem internally to make certain these spindles were not used on the axles built for the referenced models.

#### **Recall Schedule:**

Description of Recall Schedule: Owners (There are no dealers for these trailer models) to be notified via

certified mail as soon as recall letter is approved.

Planned Dealer Notification Date: NR - NR Planned Owner Notification Date: NR - NR

Part 573 Safety Recall Report	18V-126	Page 3
* NR - Not Reported		
The information contained in this report was submitted	d nursuant to 40 CED SE72	