Safety Recall Code: 69Q9



Subject

TAKATA SDI Driver Frontal Airbag Inflator

Release Date

March 15, 2018

Affected Vehicles

U.S.A. & CANADA: Certain 2007-2014 MY Volkswagen vehicles equipped with a Takata SDI driver frontal airbag

Check Campaigns/Actions screen in Elsa on the day of repair to verify that a VIN qualifies for repair under this action. Elsa is the <u>only</u> valid campaign inquiry & verification source.

- ✓ Campaign status must show "open."
- ✓ If Elsa shows other open action(s), inform your customer so that the work can also be completed at the same time the vehicle is in the workshop for this campaign.

Problem Description

The driver airbag may explode in a crash with airbag deployment. Sharp metal fragments can hit people and cause serious injury or death.

Corrective Action

Replace the driver frontal airbag inflator with a newly manufactured version. This repair is the <u>final</u> remedy.

Parts Information

Parts will be allocated weekly. Please email WooAPartsSpecialists@vw.com with Vin if you do not have the proper part(s) in stock.

Code Visibility

On or about March 15, 2018, affected vehicles were listed on the Inventory Vehicle Open Campaign Action report under My Dealership Reports (found on www.vwhub.com & OMD Web). A list was not posted for dealers who did not have any affected vehicles.

On or about March 15, 2018, this campaign code showed open on affected vehicles in Elsa.

Owner Notification

Owner notification will take place in March 2018. Owner letter examples are included in this bulletin for your reference.

Additional Information

Please alert everyone in your dealership about this action, including Sales, Service, Parts and Accounting personnel. Contact Warranty if you have any questions.

IMPORTANT REMINDER ON VEHICLES AFFECTED BY SAFETY & COMPLIANCE RECALLS

New Vehicles in Dealer Inventory: It is a violation of Federal law for a dealer to deliver a new motor vehicle or any new or used item of motor vehicle equipment (including a tire) covered by this notification under a sale or lease until the defect or noncompliance is remedied. By law, dealers must correct, prior to delivery for sale or lease, any vehicle that fails to comply with an applicable Federal Motor Vehicle Safety Standard or that contains a defect relating to motor vehicle safety.

<u>Pre-Owned Vehicles in Dealer Inventory:</u> Dealers should not deliver any pre-owned vehicles in their inventory which are involved in a safety or compliance recall until the defect has been remedied.

Dealers must ensure that every affected inventory vehicle has this campaign completed <u>before</u> <u>delivery to consumers</u>.

Fill out and affix Campaign Completion Label (CAMP 010 000) after work is complete. Labels can be ordered at no cost via the Compliance Label Ordering portal at www.vwhub.com.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

March 2018 69Q9 Page 1 of 66

Claim Entry Instructions

After campaign has been completed, enter claim as soon as possible to help prevent work from being duplicated elsewhere. Attach the Elsa screen print showing action *open on the day of repair* to the repair order. If customer refused campaign work:

- ✓ <u>U.S. dealers:</u> Submit request via WISE under the *Campaigns/Update/Recall Closure* option.
- ✓ Canada dealers: Fax repair order to Warranty at (905) 428-4811.

Service Number	69Q9		
Damage Code	0099		
Parts Vendor Code	wwo		
Claim Type	Sold vehicle: 7		
	Unsold vehicle	: 7 90	
Causal Indicator	Mark airbag in	flator kit* as causal p	part
Vehicle Wash/Loaner	Do not claim wash/loaner under this action		
Criteria I.D.	T1		
	2007-2010 Passat Sedan and Passat Wagon with a four spoke steering wheel		
	Install new airbag inflator kit.		
	Labor operation: 6958 56 99 105 T.U.		
	Quantity	Part Number	Description
	1.00	3C0898201J*	Airbag Inflator Kit With Vibration Damper
Criteria I.D.	N1		
	2007-2010 Pas	ssat Sedan and Pas	sat Wagon
	Install new airbag inflator kit.		
	Labor operatio		105 T.U.
	Quantity	Part Number	Description
	1.00	3C0898201H*	Airbag Inflator Kit Without Vibration Damper
Criteria I.D.	N2		
	2009-2014 CC	, GTI, Golf, Eos, Go	<u>If R</u>
	Inctall now sirk	og inflator kit	
	Install new airbag inflator kit.		
	Labor operation: 6958 56 99 105 T.U.		
	Quantity	Part Number	Description
	1.00 3C8898201B* Airbag Inflator Kit Without Vibration Damper		

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. @2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

March 2018 69Q9 Page 2 of 66

Customer Letter Example (USA)

This notice applies to your vehicle: <VIN>

NHTSA: 18V148

Subject: Safety Recall 69Q9 - Takata SDI Driver Frontal Airbag Inflator

Certain 2007-2014 Model Year Volkswagen Vehicles equipped with a Takata SDI Driver Frontal Airbag

Dear Volkswagen Owner,

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act. Volkswagen has decided that a defect, which relates to motor vehicle safety, exists in certain 2007-2014 model year Volkswagen vehicles equipped with a Takata SDI driver frontal airbag. Our records show that you are the owner of a vehicle affected by this action.

DANGER!

The driver airbag may explode in a crash with airbag deployment. Sharp metal fragments can hit people and cause serious injury or death.

What should you do? Schedule this recall repair immediately, even if an interim repair was recently done.

> Please contact your authorized Volkswagen dealer without delay to schedule this recall repair. For your convenience, you can also visit www.vw.com/find-a-dealer to locate a dealer

near you and schedule this service online.

What will we do? To correct this defect, your authorized Volkswagen dealer will replace the driver airbag inflator

in your vehicle. This work will take about two hours to complete and will be performed for you

free of charge.

Please keep in mind that your dealer may need additional time for the preparation of the repair.

as well as to accommodate their daily workshop schedule.

Lease vehicles and address changes

If you are the lessor and registered owner of the vehicle identified in this action, the law requires you to forward this letter immediately via first-class mail to the lessee within ten (10) days of receipt. If you have changed your address or sold the vehicle, please fill out the

enclosed prepaid Owner Reply card and mail it to us so we can update our records.

Can we assist you further?

If your authorized Volkswagen dealer fails or is unable to complete this work free of charge within a reasonable time, or if you should have any questions about this communication, please don't hesitate to contact Customer CARE, Monday through Friday by phone at 800-893-5298. You are also welcome to e-mail or chat through the

"Contact Us" page http://www.vw.com/contact/.

Checking your vehicle for open Recalls and **Service Campaigns**

To check your vehicle's eligibility for repair under this or any other recall/service campaign, please click on the Look Up Recalls link at www.vw.com and enter your Vehicle Identification

Number (VIN) into the **Recall/Service Campaign Lookup** tool.

If you still cannot obtain satisfaction, you may file a complaint with: The Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue, SE., Washington, DC 20590; or call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153); or go to http://www.safercar.gov.

We apologize for any inconvenience this matter may cause; however we are taking this action to help ensure your safety and continued satisfaction with your vehicle.

Sincerely,

Volkswagen Customer Protection

Customer Letter Example (CANADA)

This notice applies to your vehicle: <VIN>

Subject: Safety Recall 69Q9 – Takata SDI Driver Frontal Airbag Inflator

Certain 2007-2014 Model Year Volkswagen Vehicles equipped with a Takata SDI Driver Frontal

Airbag

Dear Volkswagen Owner,

This notice is sent to you in accordance with the requirements of the Motor Vehicle Safety Act. Volkswagen has decided that a defect, which relates to motor vehicle safety, exists in certain 2007-2014 model year Volkswagen vehicles equipped with a Takata SDI driver frontal airbag. Our records show that you are the owner of a vehicle affected by this action.

DANGER!

The driver airbag may explode in a crash with airbag deployment.

Sharp metal fragments can hit people and cause serious injury or death.

What should you do? Schedule this recall repair immediately, even if an interim repair was recently done.

Please contact your authorized Volkswagen dealer without delay to schedule this recall

repair

What will we do? To correct this defect, your authorized Volkswagen dealer will replace the driver airbag inflator

in your vehicle. This work will take about two hours to complete and will be performed for you

free of charge.

Please keep in mind that your dealer may need additional time for the preparation of the repair,

as well as to accommodate their daily workshop schedule.

Lease vehicles and address changes

If you are the lessor and registered owner of the vehicle identified in this action, the law requires you to forward this letter immediately via first-class mail to the lessee within

ten (10) days of receipt. If you have changed your address or sold the vehicle, please fill out the enclosed prepaid Owner Reply card and mail it to us so we can update our

records.

Can we assist you

further?

If your authorized Volkswagen dealer fails or is unable to complete this work free of charge within a reasonable time, please contact Customer Relations, Monday through

Friday from 8AM to 8PM EST by phone at 1-800-822-8987 or via our "Contact Us" page

at www.vw.ca.

We apologize for any inconvenience this matter may cause; however we are taking this action to help ensure your safety and continued satisfaction with your vehicle.

Sincerely,

Volkswagen Customer Protection

A DANGER

- The driver frontal airbag inflator could potentially rupture (due to propellant degradation occurring after long-term exposure to absolute high humidity and temperature cycling). In the event of an inflator rupture, in very rare cases metal fragments could pass through the airbag cushion material, which may result in serious injury or death.
- This Recall should be performed before any other work is performed on the vehicle.

A WARNING

Risk of injury. Refer to "Warning and Safety Precautions", found in Appendix A at the end of this document.

! NOTE

- Damages resulting from improper repair or failure to follow these work instructions are the dealer's responsibility and are not eligible for reimbursement under this action.
- This procedure must be read in its entirety prior to performing the repair.
- Due to variations in vehicle equipment and options, the steps/illustrations in this work procedure may not identically match all affected vehicles.
- Diagnosis and repair of pre-existing conditions in the vehicle are not covered under this action.

Required Parts

<u>Criteria</u>	Qty.	Model (model code)	Part Number	Part Description
N1	1	Passat (3C)	3C0898201H	Airbag Inflator Kit Without Vibration Damper
T1	1	Passat Wagon (3C)	3C0898201J	Airbag Inflator Kit With Vibration Damper
Vehicles with Criteria N1 or T1 will have a four spoke steering wheel.				

N2	1	Eos (1F) CC (35) Golf/GTI (1K, 5K) Rabbit (1K) Passat (3C)	3C8898201B	Airbag Inflator Kit Without Vibration Damper
Vehicles with Criteria N2 or T2 will have a three spoke steering wheel.				

U NOTE

 All inflator kits include inflator, inflator nuts, horn ring bolts, one replacement horn ring spring and return instructions.

Required Safety Equipment




• Ear Protection (locally sourced)



• Face Shield (locally sourced)

March 2018 69Q9 Page 6 of 66

Required Tools

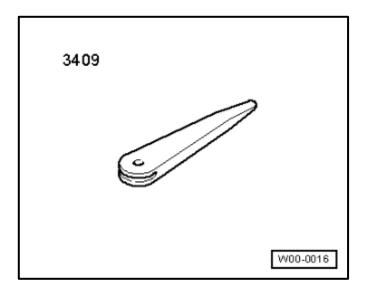

• Trim Removal Wedge – 3409 (or equivalent)



• ESD Worksurface - VAS 6613

March 2018 69Q9 Page 7 of 66



• Bar Code Scanner – VAS6161/1



• Airbag Support - T10568



• Lever - T10571



VAS6150D - Diagnostic Tester (or equivalent)



VAG1410 – Torque Wrench (or equivalent)

Required Work Environment



A WARNING

Risk of injury.

It is critical that a clean, uncongested work environment is utilized during the inflator replacement procedure. Extra tools, debris, etc... in the blast area of an airbag impose a danger in the event an airbag were to deploy. Ensure there are no loose components in the blast area of the airbag.



NOTE

The work area must be in the vicinity of the scan tool and the vehicle in order to properly complete this procedure.

March 2018 69Q9 Page 9 of 66




- Workbench that will support a vice.
- Work surface free of unnecessary tools, equipment and debris.

Repair Instruction

Section A - Check for Previous Repair

i TIP

If Campaign Completion label is present, no further work is required.

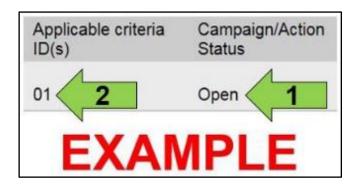

• Enter the VIN in Elsa and proceed to the "Campaign/Action" screen.

i TIP

On the date of repair, print this screen and keep a copy with the repair order.

- Confirm the Campaign/Action is open <arrow 1>.
 If the status is closed, no further work is required.
- Note the Applicable Criteria ID <arrow 2> for use in determining the correct work to be done and corresponding parts associated.

Proceed to Section B

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

March 2018 69Q9 Page 10 of 66

Section B – Inflator Identification (all vehicles)

A WARNING

Risk of injury.

- People in the immediate vicinity of the workplace must be protected from possible noise and projectiles.
- Pyrotechnic components can trigger unintentionally.
- In the event of unintentional deployment:
 - Single-stage inflators: allow airbag to cool down completely. Wait at least 10 minutes before handling.
 - Two-stage inflators: wait for second airbag ignition. Allow airbag to cool down completely. Wait at least 10 minutes before handling.



Prior to beginning repairs, verify the horn is operational.



Diagnosis and repair of an inoperable horn, before or after inflator replacement, will not be covered under this campaign.


The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

March 2018 69Q9 Page 11 of 66



Use the QR code or the link to view a video detailing the repair process prior to performing the repair.

https://vwcup.track360.com/?p=vwiqCertification&id=11288

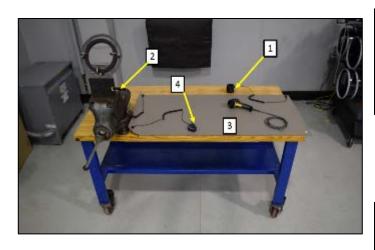

! NOTE


- Prior to beginning work, all parts and tools are to be placed on the ESD table mat.
- The workstation must be in the vicinity of the vehicle.
- Assemble ESD workplace -VAS 6613- <1, 2, 3,
- Plug ESD workplace into a wall socket using plug <1>.



NOTE

The wall socket or extension cord must have a sufficient ground.

- Clamp Airbag Support T10568 <2> into the vice.
- Connect crocodile clip <1> to airbag support <2> and ESD workplace -VAS 6613-.

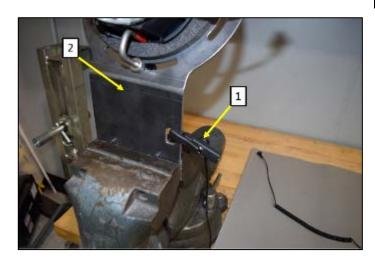


The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

March 2018 69Q9 Page 12 of 66



- Ensure ODIS is updated to the latest version.
- Connect vehicle diagnostic tester.
- Select Start Diagnosis function and identify vehicle.
- After identification of control units, Guided Fault Finding is started automatically.
- Follow the instructions on screen.

March 2018 69Q9 Page 13 of 66

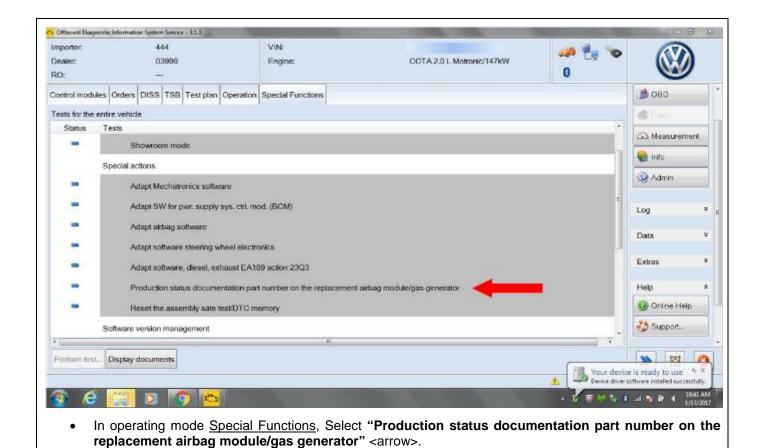


The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To

determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

March 2018

69Q9 Page 14 of 66

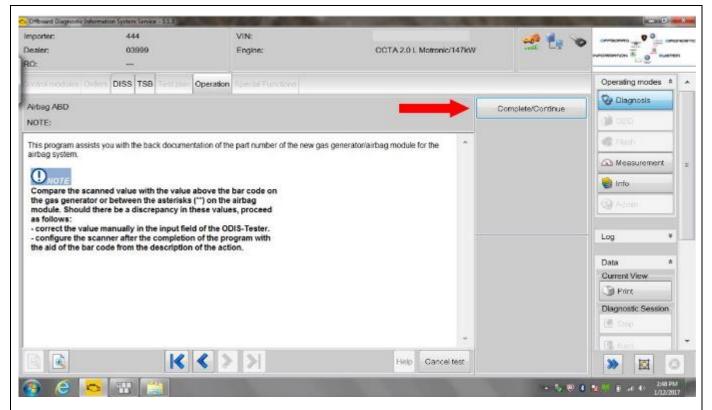


- Scanning the data matrix code during this test plan step calibrates the scanner to avoid error messages.
- Scanning the calibrating data matrix code may not have to be done every time (only when the scanner requires calibration). You will know if the scanner needs calibrating if the scanner does not scan the inflator's data matrix code.
- If the inflator data matrix code cannot be scanned, then print out this matrix shown below and scan the printout.



After calibrating the scanner, select "Complete/Continue"

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.


March 2018 69Q9 Page 15 of 66

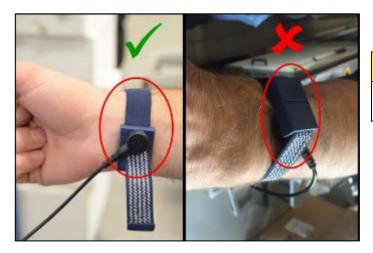

 Put the wrist strap from the ESD workplace on your wrist.

A CAUTION

The white dots on the wrist strap must be against the skin.

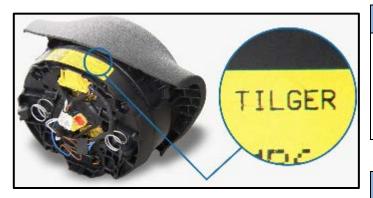

. NOTE

- There are two types of inflator. One version is "with vibration absorption" and one is "without vibration absorption".
- Airbags with vibration absorption may be identified by the word "TILGER" on the label found on the airbag.

U NOTE

In the event an airbag had previously been replaced, the replacement airbag may have an inflator WITH the vibration absorber. If this situation is encountered, the inflator WITH vibration absorption MUST be installed:

- Repackage the previously scanned inflator and return to the parts department.
- Acquire the correct inflator from the parts department.
- Scan the new inflator using the GFF test plan.
- Install the new inflator, following the "Inflator versions WITH vibration absorption" instructions.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

March 2018 69Q9 Page 16 of 66



- Place the new inflator on the ESD mat.
- Scan the data matrix code of the new inflator at a distance of about 15 cm.

A CAUTION

Ensure the correct inflator data matrix code is scanned at this time.

Crit.	Model (model code)	Part Number
N1	Passat (3C)	3C0898201H
T1	Passat Wagon (3C)	3C0898201J
N2	Eos (1F) CC (35) Golf/GTI (1K, 5K)	3C8898201B

Rabbit (1K) Passat (3C)



U NOTE

The photo is for reference only. The inflator that is installed may be either a single stage or dual stage




① NOTE

The data matrix code includes the values as shown.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

March 2018 69Q9 Page 17 of 66

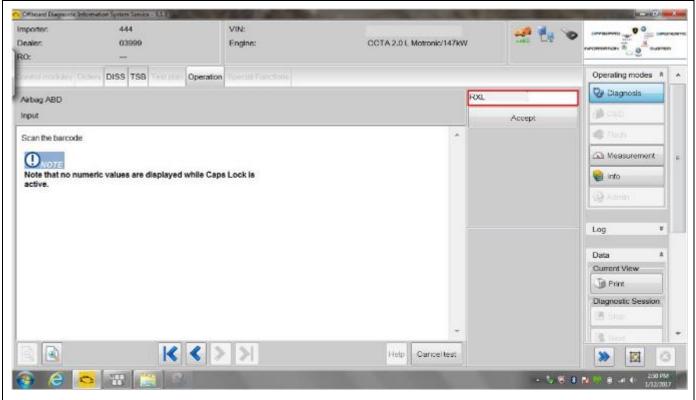


Once the new inflator has been successfully scanned, press "Accept"

U NOTE

- Compare the scanned value with the value shown near the data matrix code on the new inflator.
- If there is a discrepancy, manually enter the value from the new inflator in the input field.
- If no value appears, recalibrate the scanner.

March 2018 69Q9 Page 18 of 66

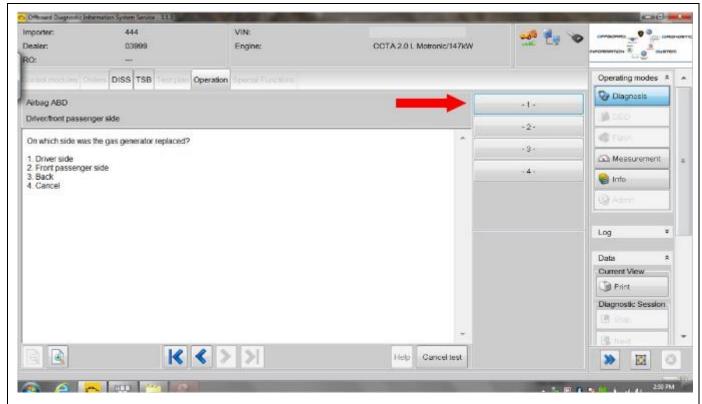

- Select option 1 indicating that the Driver side inflator was replaced.
- After selecting option 1, a valid GeKo ID will need to be entered in order to upload the new inflator identification.

Continue to Section C

March 2018 69Q9 Page 19 of 66

Section C - Battery Disconnect



Battery in Engine Compartment:

WARNING

Accident risk. When working on pyrotechnic components (such as airbags and belt tensioners), the battery must be disconnected with the ignition switched ON.



① NOTE

Before disconnecting the battery, it is recommended to record the customer's radio presets so they can be restored before returning vehicle to the customer.

- Turn **ON** the ignition.
- Move the driver seat to the most rearward position.
- Fully recline driver seat.




A CAUTION


Reclining the driver seat before disconnecting the battery allows for additional safety in the event Terminal 15 power is not restored when reconnecting the battery at the end of the repair.

- Open the battery protective covering <1>.
- Loosen the nut <1>.
- Remove and isolate the battery ground cable terminal from the battery terminal.

Continue to Section D

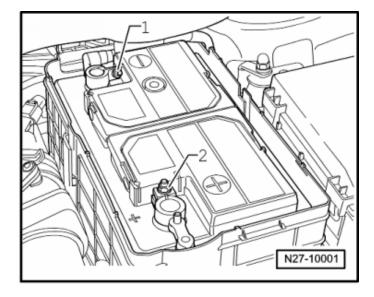

March 2018 69Q9 Page 20 of 66

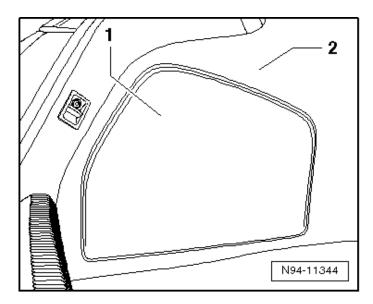

Battery in Luggage Compartment:

A WARNING

Accident risk. When working on pyrotechnic components (such as airbags and belt tensioners), the battery must be disconnected with the ignition switched **ON**.

U NOTE

Before disconnecting the battery, it is recommended to record the customer's radio presets so they can be restored before returning vehicle to the customer.

- Turn ON the ignition.
- Move the driver seat to the most rearward position.
- Fully recline driver seat.

A CAUTION

Reclining the driver seat before disconnecting the battery allows for additional safety in the event Terminal 15 power is not restored when reconnecting the battery at the end of the repair.


Unclip the service cover <1> off the side trim panel <2>.

① NOTE

The battery is installed in the left side of the luggage compartment in vehicles with the 3.6L V6 gasoline engine.

- Loosen the nut <1>.
- Remove and isolate the battery ground cable terminal from the battery terminal.


Continue to Section D

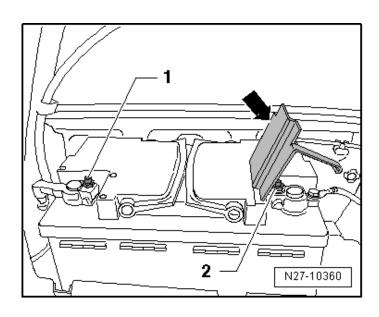


The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

March 2018 69Q9 Page 21 of 66

Section D - Airbag Removal

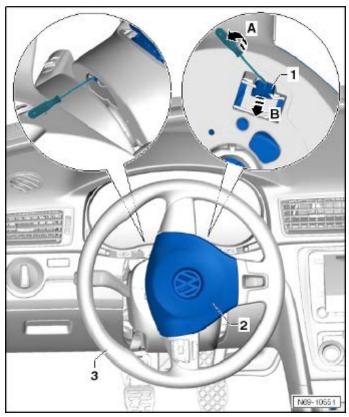

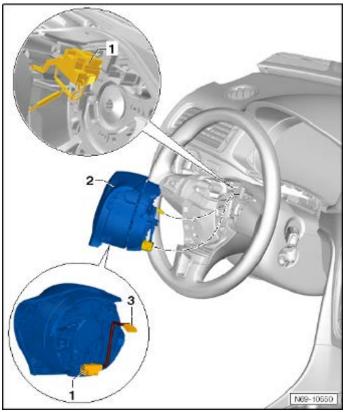

• NOTE

Procedure illustrated is for a three spoke steering wheel. The procedure for a four spoke steering wheel is the same.

- Lower the steering wheel <3> as far as possible.
- Adjust steering wheel depth (reach) <3> so it is in the fully extended position.
- Turn the steering wheel <3> to the position illustrated.
- Insert a screwdriver all the way into the hole on the back of the steering wheel (approximately 8 mm).
- Turn the screwdriver toward the driver door <arrow A>. This will unlock the airbag unit <2> locking mechanism <1> in direction of <arrow>, on the right side of the steering wheel.
- Turn the steering wheel 180° and repeat the procedure on the opposite side.

• NOTE

The screwdriver previously mentioned should be about 175 mm long and have a blade width of 7 mm.

A WARNING

Before handling pyrotechnic components (for example, disconnecting the connector), the person handling it must "discharge static electricity". This can be done by touching the door striker, for example.

- Turn the steering wheel back to its center position.
- Remove the airbag unit <2> from the steering wheel.
- Release the connector lock on the airbag connector <1> and remove it.
- Disconnect the connector <3> (if equipped).

A WARNING

Set the airbag down so the logo on the impact cushion faces upward.

Continue to Section E

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

March 2018 69Q9 Page 22 of 66

Section E - Inflator Replacement

A WARNING

Risk of injury.

- People in the immediate vicinity of the workplace must be protected from possible noise and projectiles.
- Pyrotechnic components can trigger unintentionally.
- In the event of unintentional deployment:
 - Single-stage inflators: allow airbag to cool down completely. Wait at least 10 minutes before handling.
 - Two-stage inflators: wait for second airbag ignition. Allow airbag to cool down completely. Wait at least 10 minutes before handling.

A WARNING


Risk of injury.

It is critical that a clean, uncongested work environment is utilized during the inflator replacement procedure. Extra tools, debris, etc... in the blast area of an airbag impose a danger in the event an airbag were to deploy. Ensure there are no loose components in the blast area of the airbag.



U NOTE

- Prior to beginning work, all parts and tools are to be placed on the ESD table mat.
- The workstation must be in the vicinity of the vehicle.

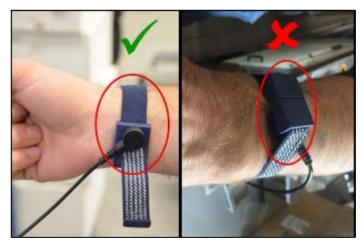


 Put the wrist strap from the ESD workplace on your wrist.

A CAUTION

The white dots on the wrist strap must be against the skin.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

March 2018 69Q9 Page 23 of 66

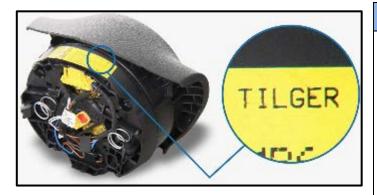


U NOTE

- There are two types of inflator. One version is "with vibration absorption" and one is "without vibration absorption".
- If the version "with vibration absorption" is installed, this can be identified by "TILGER" (vibration damper) on the label of the airbag module.
- If the version "without vibration absorption" is installed, there is NO lettering on the label of the airbag module
- Identify inflator version by criteria and proceed to the proper subsection.
 - <u>Criteria N2</u>: Inflator, three spoke steering wheel, without vibration absorption: **Proceed to Subsection 1**
 - <u>Criteria N1</u>: Renewing inflator, four spoke steering wheel, without vibration absorption: **Proceed to Subsection 3.**
 - <u>Criteria T1</u>: Renewing inflator, four spoke steering wheel, with vibration absorption: **Proceed to Subsection 4.**

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

March 2018 69Q9 Page 24 of 66

Subsection 1 – Inflator, three spoke steering wheel, without vibration absorption

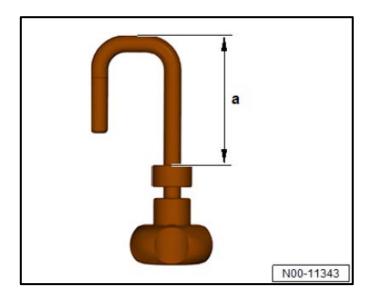


Removal Procedure:



U NOTE

- The three spoke steering wheel has three mounting points.
- Tighten mounting by hand to prevent damage.
- Adjust three knurled nuts of securing hooks to <dimension a> 50mm.

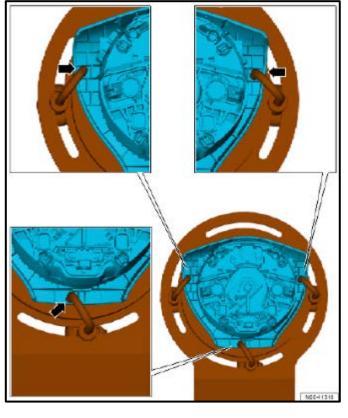


Clamp airbag centrally in airbag support. There are securing points on the sides <arrows>, parallel, opposite each other, and below.



U NOTE

The clamps must be placed in the positions shown <arrows> to prevent damage to the airbag. Damage to the airbag is not covered under this action.

March 2018 69Q9 Page 25 of 66

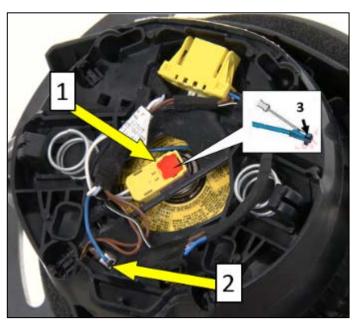


- Disengage connector lock <3> using a small flat bladed screwdriver.
- Remove connector <1> using needle nose pliers.

A CAUTION

- Do not use a screwdriver to pry off connector
 <1> or damage to the connector could occur.
- Damage to the airbag connectors will not be covered under this action.
- Remove ground cable <2>.



The photo is for reference only. The inflator that is installed may be either a single stage or dual stage inflator.

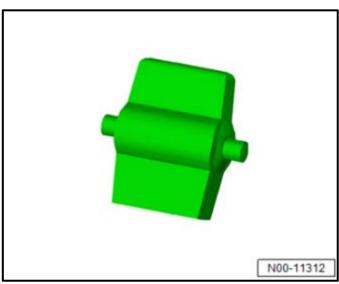


① NOTE


- The locking pins are to be reused.
- There may be instances in which short locking pins are fitted. These can be levered out with a small screwdriver.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

March 2018 69Q9 Page 26 of 66

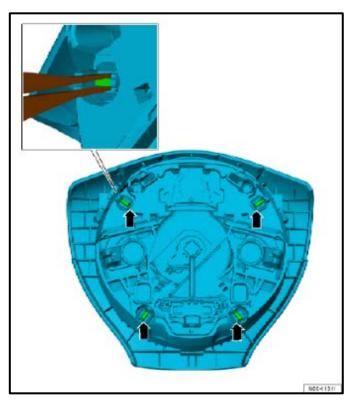

 Remove locking pins <arrows> for horn ring with aid of longnose pliers.

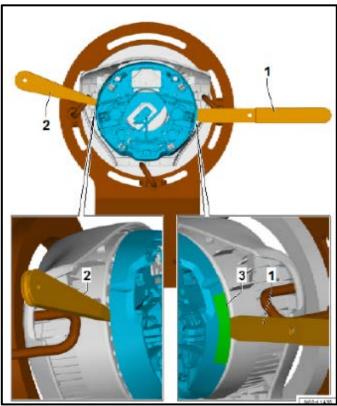


- Apply lever -T10571- <1> in shaded area <3>. At the same time, apply removal wedge -3409- on the other side <2> and lever off horn ring.
- Repeat work steps on other side.

A CAUTION

Use extreme care when removing the horn ring. If horn ring is damaged during remove, airbag replacement will be necessary. Replacement of the airbag due to damage during horn ring removal will not be covered under this action.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.


March 2018 69Q9 Page 27 of 66

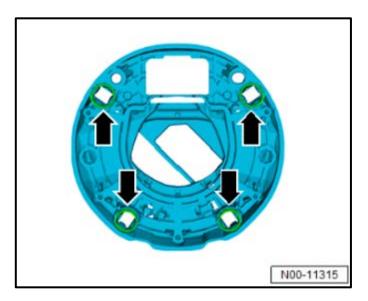


• Remove horn ring with springs <arrows>.

A CAUTION

- When removing the horn ring, take care that the springs are not lost as they are not available sepereately.
- **ONE** replacement spring is included in the inflator kit in the event a spring is lost or damaged.
- If more than one spring is lost, replacement of the airbag is required. Replacement of the airbag is required if a spring is lost and is not covered under this action.

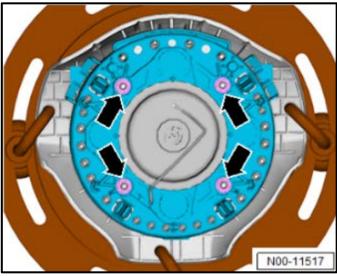

- Remove and discard nuts <arrows>.
- Remove cover for inflator.

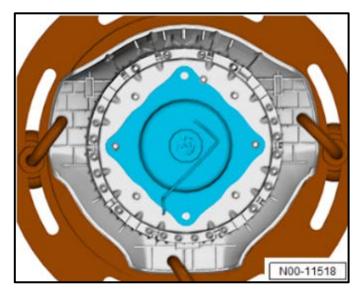

Remove the inflator and place in the original packaging.

! NOTE

Inflator return instructions are included with the new inflator.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

March 2018 69Q9 Page 28 of 66



Installation Procedure:

 Insert the new inflator as shown. Note the recess <arrow>.

Criteria	Inflator Kit Part Number
N2	3C8898201B

U NOTE

In the event an airbag had previously been replaced, the replacement airbag may have an inflator WITH the vibration absorber. If this situation is encountered, the inflator WITH vibration absorption MUST be installed:

- Repackage the previously scanned inflator and return to the parts department.
- Acquire the correct inflator from the parts department.
- Scan the new inflator using the GFF test plan.
- Install the new inflator, following the "Inflator, three spoke steering wheel, with vibration absorption" instructions.


Original Inflator Part #	Updated Inflator Part #
3C8898201B	3C8898201C
	is encountered, contact services at 1-800-767-

• NOTE

The photo is for reference only. The inflator that is installed may be either a single stage or dual stage inflator.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.


March 2018 69Q9 Page 29 of 66

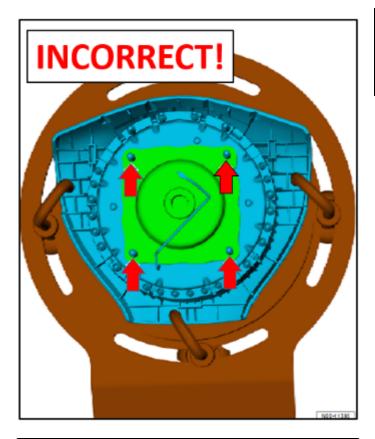

A WARNING


Note installation position:

The inflator must **NOT** be placed on the studs <arrows>.

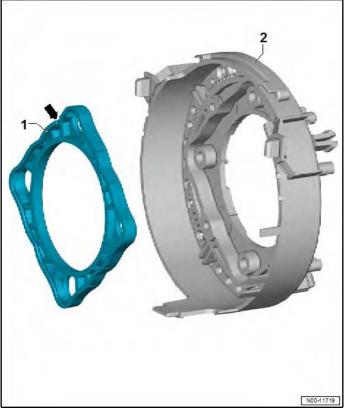

• Included in the replacement parts kit is an insert ring <1>. This must be used when installing a new inflator and placed in the horn ring <2>.


March 2018 69Q9 Page 30 of 66

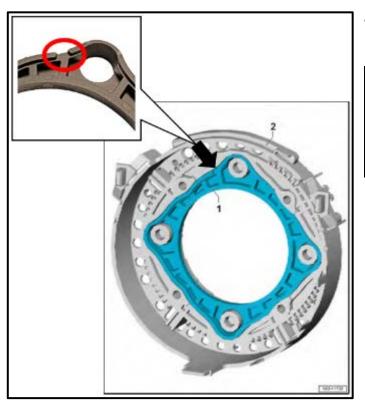

 Fit insert ring <1> into horn ring <2>. The notch (circle) in the insert ring must be at top <arrow> when doing this.

U NOTE

- It should be possible to fit the insert ring from the replacement parts kit with ease.
- It is essential to adhere to the installation position.
- The notch must be at the top <arrow>.

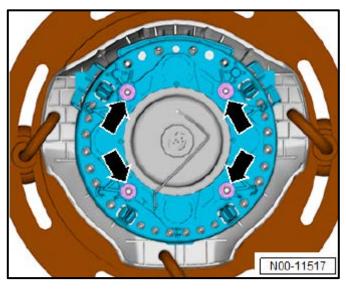


① NOTE

The nuts are self-locking and must be replaced


 Fit cover for inflator and tighten 4 nuts <arrows> to 5 Nm ± 0.4 Nm.

March 2018 69Q9 Page 31 of 66

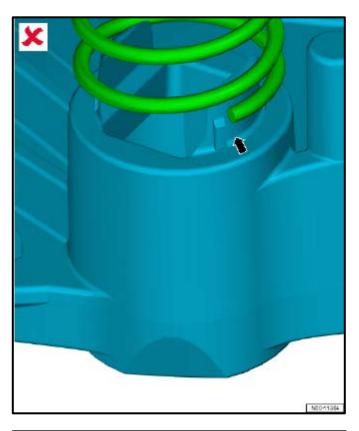


U NOTE

- If one of the springs is damaged or has been lost, it can be replaced with a spring from the bag of spares included.
- Note the examples shown for reference of proper spring seating.
- Spring seated incorrectly <arrow>.

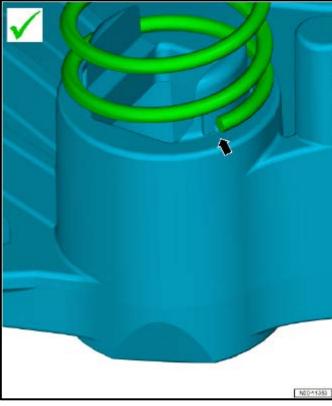


• Spring seated **correctly** <arrow>.

March 2018 69Q9 Page 32 of 66

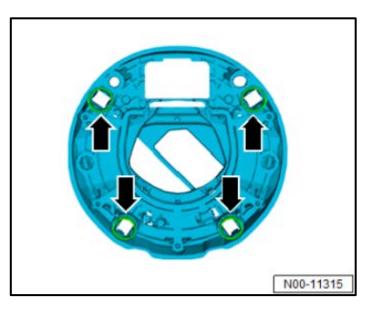


 Fit springs <arrows> for horn ring again and allow to engage audibly.

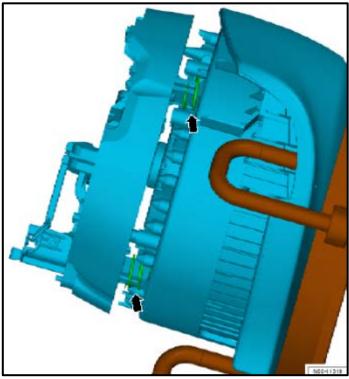

Position horn ring <arrows> with springs on securing clips and press firmly in place. Ensure that springs are seated correctly on both sides.


March 2018 69Q9 Page 33 of 66

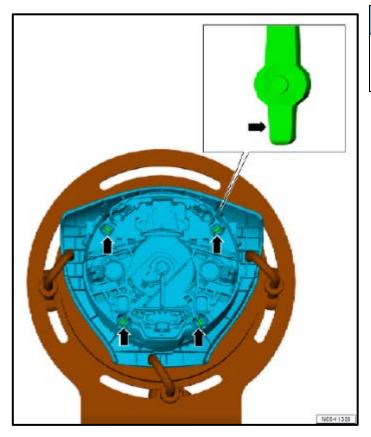

NOTE

If a pin is damaged or has been lost, it can be replaced with a locking pin from the bag of spares included.

 Using long-nose pliers, insert four locking pins in retaining lugs with narrow side facing downwards <arrow in magnification>. Pins must engage audibly.

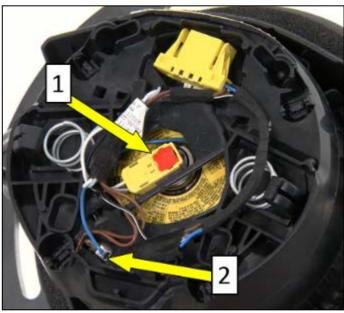

• Connect central connector <1> on inflator.

! NOTE


Ensure the connector locks are fully open when installing the connectors.

- Press central connector lock in until fully locked.
- Connect ground cable <2>.

Continue to Section F.

March 2018 69Q9 Page 34 of 66


Subsection 2 - Inflator, three spoke steering wheel, with vibration absorption

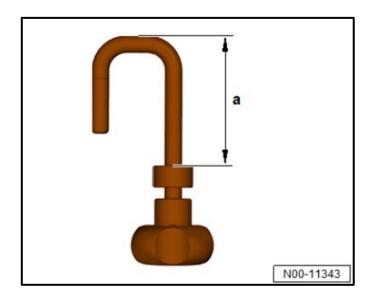

Removal Procedure:

① NOTE

- The three spoke steering wheel has three mounting points.
- Tighten mounting by hand to prevent damage.
- Adjust three knurled nuts of securing hooks to <dimension a> 50mm.

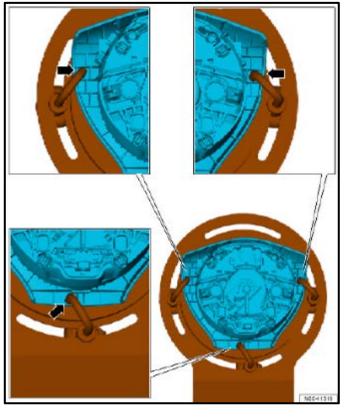

Clamp airbag centrally in airbag support. There are securing points on the sides <arrows>, parallel, opposite each other, and below.




NOTE

The clamps must be placed in the positions shown <arrows> to prevent damage to the airbag. Damage to the airbag is not covered under this action.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

March 2018 69Q9 Page 35 of 66

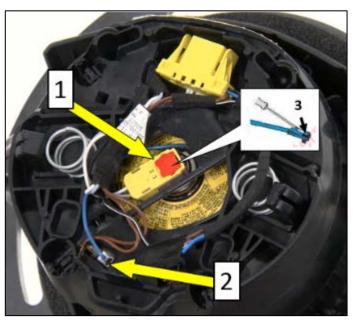


- Disengage connector lock <3> using a small flat bladed screwdriver.
- Remove connector <1> using needle nose pliers.

A CAUTION

- Do not use a screwdriver to pry off connector
 <1> or damage to the connector could occur.
- Damage to the airbag connectors will not be covered under this action.
- Remove ground cable <2>.



The photo is for reference only. The inflator that is installed may be either a single stage or dual stage inflator.

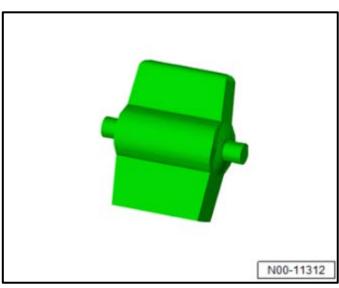


① NOTE


- The locking pins are to be reused.
- There may be instances in which short locking pins are fitted. These can be levered out with a small screwdriver.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

March 2018 69Q9 Page 36 of 66

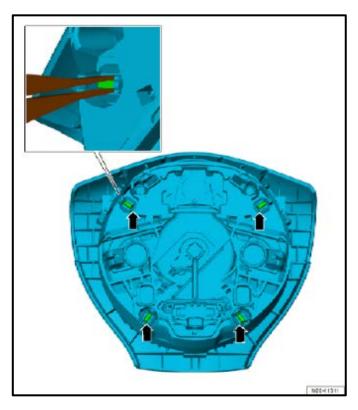

 Remove locking pins <arrows> for horn ring with aid of longnose pliers.

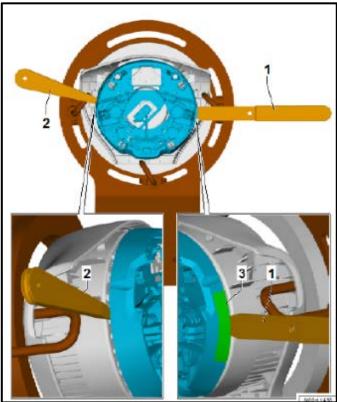


- Apply lever -T10571- <1> in shaded area <3>. At the same time, apply removal wedge -3409- on the other side <2> and lever off horn ring.
- · Repeat work steps on other side.

A CAUTION

Use extreme care when removing the horn ring. If horn ring is damaged during remove, airbag replacement will be necessary. Replacement of the airbag due to damage during horn ring removal will not be covered under this action.


March 2018 69Q9 Page 37 of 66

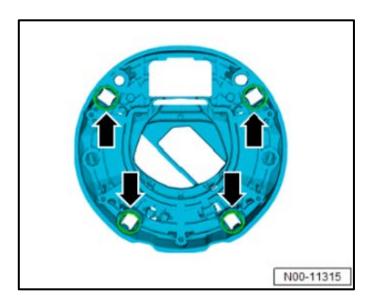


• Remove horn ring with springs <arrows>.

A CAUTION

- When removing the horn ring, take care that the springs are not lost as they are not available sepereately.
- **ONE** replacement spring is included in the inflator kit in the event a spring is lost or damaged.
- If more than one spring is lost, replacement of the airbag is required. Replacement of the airbag is required if a spring is lost and is not covered under this action.

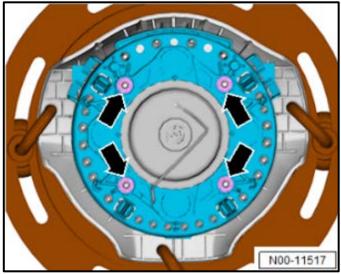

Remove and discard nuts <arrows>.

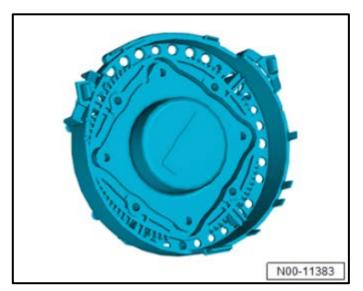

Remove the inflator and place in the original packaging.




Inflator return instructions are included with the new inflator.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

March 2018 69Q9 Page 38 of 66



Set new inflator in installation position.

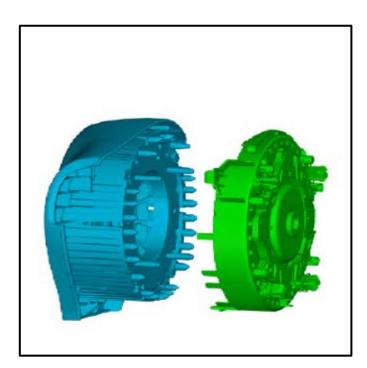




U NOTE

The nuts are self-locking and must be replaced


 Install new nuts <arrows> and torque to 5 Nm ± 0.4 Nm.

March 2018 69Q9 Page 39 of 66

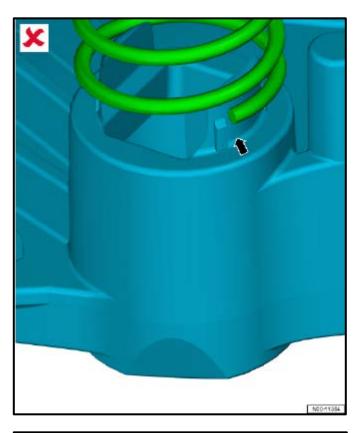


U NOTE

- If one of the springs is damaged or has been lost, it can be replaced with a spring from the bag of spares included.
- Note the examples shown for reference of proper spring seating.
- Spring seated incorrectly <arrow>.

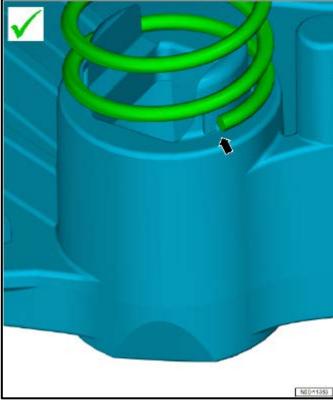


• Spring seated correctly <arrow>.

March 2018 69Q9 Page 40 of 66

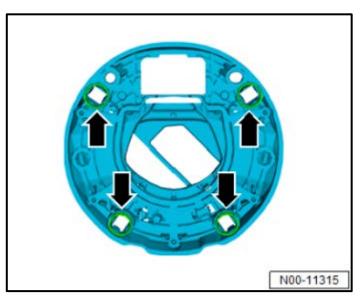


 Fit springs <arrows> for horn ring again and allow to engage audibly.

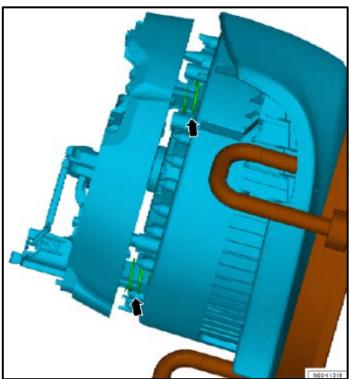

Position horn ring <arrows> with springs on securing clips and press firmly in place. Ensure that springs are seated correctly on both sides.


March 2018 69Q9 Page 41 of 66

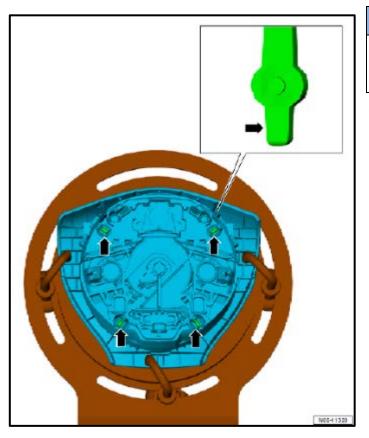

NOTE

If a pin is damaged or has been lost, it can be replaced with a locking pin from the bag of spares included.

Using long-nose pliers, insert four locking pins in retaining lugs with narrow side facing downwards <arrow in magnification>. Pins must engage audibly.

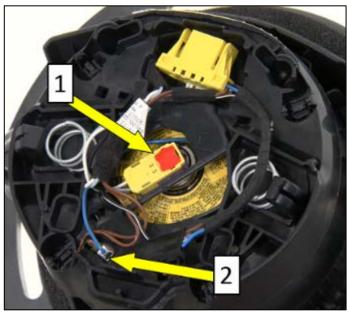

Connect central connector <1> on inflator.

! NOTE


Ensure the connector locks are fully open when installing the connectors.

- Press central connector lock in until fully locked.
- Connect ground cable <2>.

Continue to Section F.

March 2018 69Q9 Page 42 of 66

Subsection 3 - Renewing inflator, four spoke steering wheel, without vibration absorption

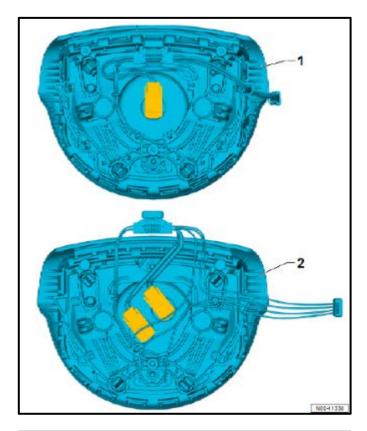


Removal Procedure:



U NOTE


The inflator comes as a single-stage <1> or two-stage <2> version. The work steps for inflator renewal are the same.

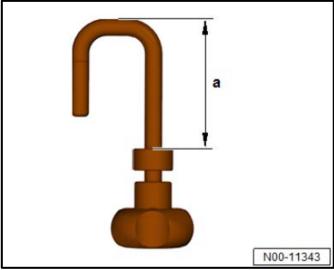

• NOTE

- The four spoke steering wheel has two mounting points.
- Tighten mounting by hand to prevent damage.
- Adjust three knurled nuts of securing hooks to <dimension a> 50mm.


March 2018 69Q9 Page 43 of 66

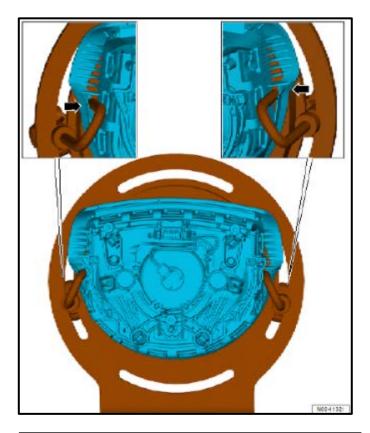

 Clamp airbag centrally in airbag support. Securing points on the sides <arrows> and parallel, opposite each other.

NOTE

The clamps must be placed in the positions shown <arrows> to prevent damage to the airbag. Damage to the airbag is not covered under this action.

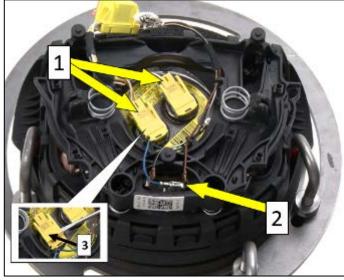

- Disengage connector lock(s) <3> using a small flat bladed screwdriver.
- Remove connector(s) <1> using needle nose pliers.

A CAUTION


- Do not use a screwdriver to pry off connector(s) <1> or damage to the connector could occur.
- Damage to the airbag connectors will not be covered under this action.
- Remove ground cable <2>.



The photo is for reference only. The inflator that is installed may be either a single stage or dual stage inflator.


The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

March 2018 69Q9 Page 44 of 66

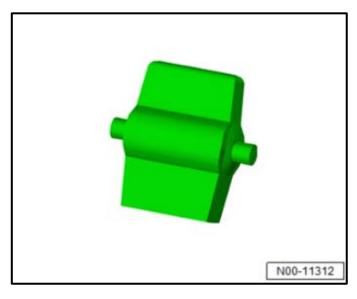


U NOTE

- The locking pins are to be reused.
- There may be instances in which short locking pins are fitted. These can be levered out with a small screwdriver.

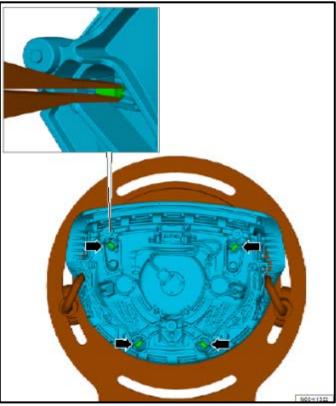


 Remove locking pins <arrows> for horn ring with aid of longnose pliers.

March 2018 69Q9 Page 45 of 66

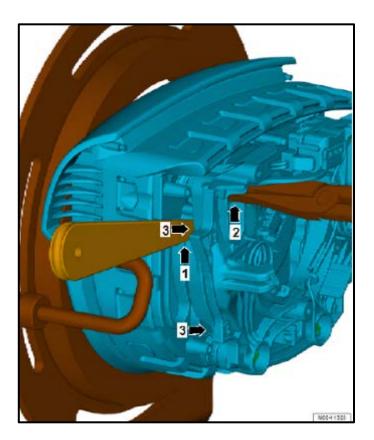

 Apply removal wedge -3409- between horn ring and inflator <1> and press together locking elements using longnose pliers <2>.
 Lever off horn ring at plastic lugs <3>.

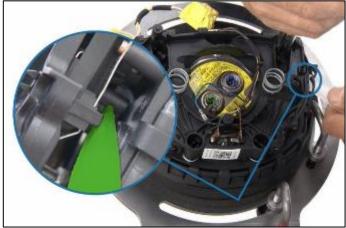


- Position the removal wedge -3409- on the plastic lugs to prevent damage to the conductor strip.
- Insert the removal wedge -3409- between the inflator and horn ring to prevent the horn ring from engaging again.
- Repeat work steps on other side.

A CAUTION

Use extreme care when removing the horn ring. If horn ring is damaged during remove, airbag replacement will be necessary. Replacement of the airbag due to damage during horn ring removal will not be covered under this action.


March 2018 69Q9 Page 46 of 66

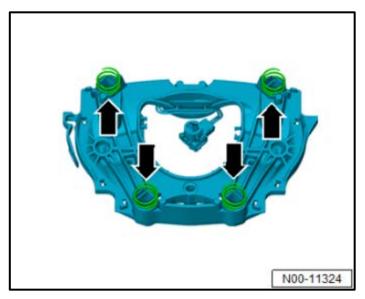

Remove horn ring with springs <arrows>.

A CAUTION

- When removing the horn ring, take care that the springs are not lost as they are not available sepereately.
- **ONE** replacement spring is included in the inflator kit in the event a spring is lost or damaged.
- If more than one spring is lost, replacement of the airbag is required. Replacement of the airbag is required if a spring is lost and is not covered under this action.

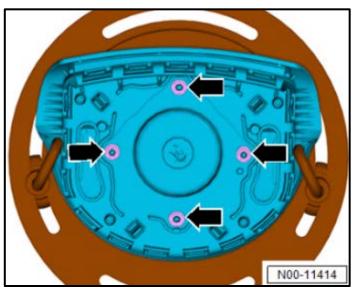


- Remove and discard nuts <arrows>.
- Remove the inflator and place in the original packaging.

U NOTE

Inflator return instructions are included with the new inflator.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

March 2018 69Q9 Page 47 of 66

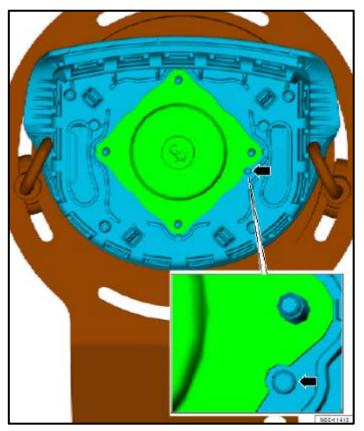

Installation Procedure:


 Insert new inflator and check to ensure it is seated correctly. Note the recess <arrow>.

Criteria	Inflator Kit Part Number
N1	3C0898201H

! NOTE

In the event an airbag had previously been replaced, the replacement airbag may have an inflator WITH the vibration absorber. If this situation is encountered, the inflator WITH vibration absorption (part # 3C0898201J) MUST be installed:

- Repackage the previously scanned inflator and return to the parts department.
- Acquire the correct inflator (part # 3C0898201J) from the parts department.
- Scan the new inflator using the GFF test plan.
- Install the new inflator, following the "Renewing inflator, four spoke steering wheel, with vibration absorption (Criteria T1)" instructions.

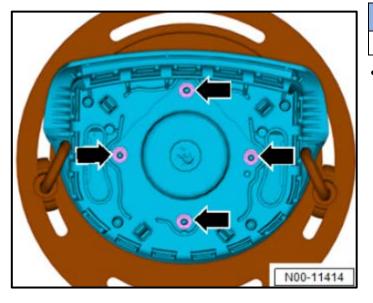


U NOTE

The nuts are self-locking and must be replaced


 Install new nuts <arrows> and torque to 5 Nm ± 0.4 Nm.

March 2018 69Q9 Page 48 of 66

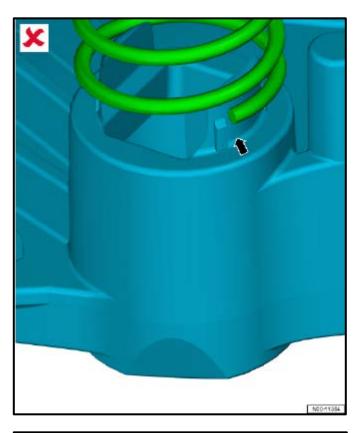


U NOTE

- If one of the springs is damaged or has been lost, it can be replaced with a spring from the bag of spares included.
- Note the examples shown for reference of proper spring seating.
- Spring seated incorrectly <arrow>.

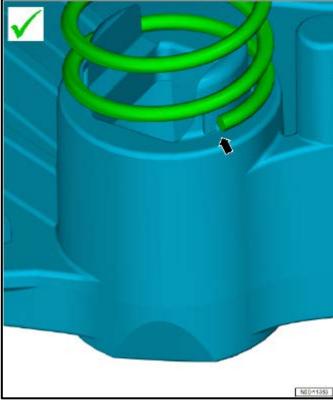


• Spring seated correctly <arrow>.

March 2018 69Q9 Page 49 of 66

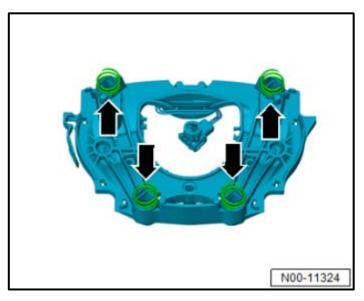


 Fit springs <arrows> for horn ring again if necessary.

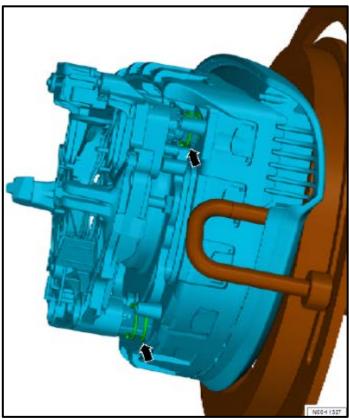

Position horn ring with springs on securing clips and press firmly in place. Ensure that springs are seated correctly on both sides <arrows>.


March 2018 69Q9 Page 50 of 66

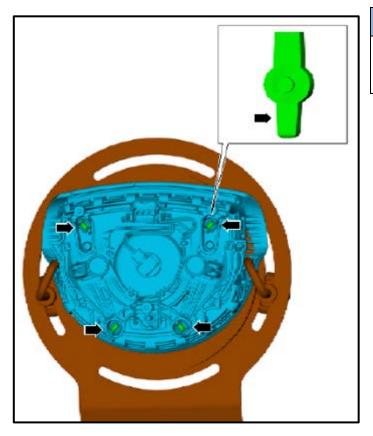

U NOTE

If a pin is damaged or has been lost, it can be replaced with a locking pin from the bag of spares included.

 Using long-nose pliers, insert four locking pins in retaining lugs with narrow side facing downwards <arrow in magnification>. Pins must engage audibly.

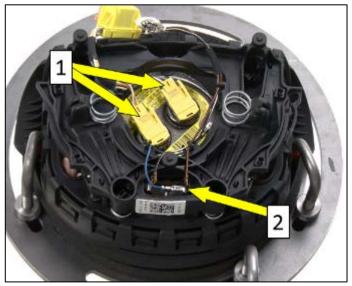


- Connect central connector(s) <1> on inflator.
- Press central connector lock(s) in until fully locked.
- Connect ground cable <2>.

Continue to Section F.

March 2018 69Q9 Page 51 of 66


Subsection 4 – Renewing inflator, four spoke steering wheel, with vibration absorption

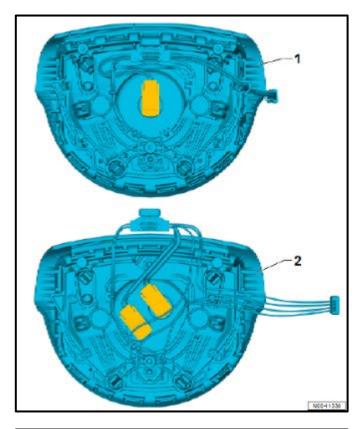

Removal Procedure:

① NOTE


- The inflator comes as a single-stage <1> or two-stage <2> version. The work steps for inflator renewal are the same.
- Tighten mounting by hand to prevent damage.

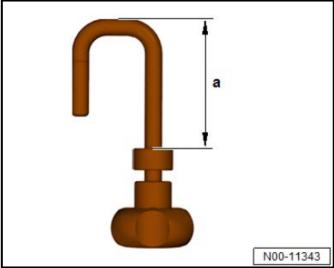

• NOTE

- The four spoke steering wheel has two mounting points.
- Tighten mounting by hand to prevent damage.
- Adjust three knurled nuts of securing hooks to <dimension a> 50mm.


March 2018 69Q9 Page 52 of 66

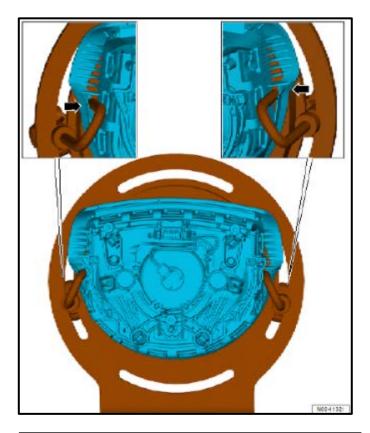

 Clamp airbag centrally in airbag support. Securing points on the sides <arrows> and parallel, opposite each other.

U NOTE

The clamps must be placed in the positions shown <arrows> to prevent damage to the airbag. Damage to the airbag is not covered under this action.

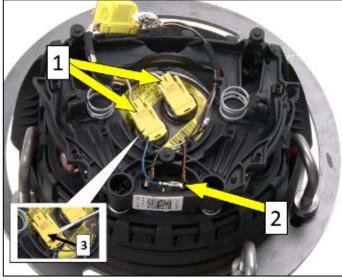

- Disengage connector lock(s) <3> using a small flat bladed screwdriver.
- Remove connector(s) <1> using needle nose pliers.


A CAUTION

- Do not use a screwdriver to pry off connector(s) <1> or damage to the connector could occur.
- Damage to the airbag connectors will not be covered under this action.
- Remove ground cable <2>.




The photo is for reference only. The inflator that is installed may be either a single stage or dual stage inflator.

March 2018 69Q9 Page 53 of 66

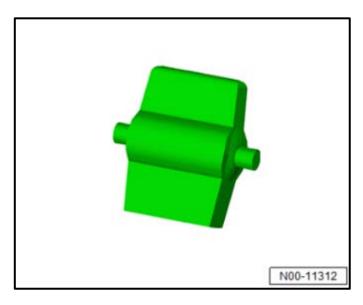


① NOTE

- The locking pins are to be reused.
- There may be instances in which short locking pins are fitted. These can be levered out with a small screwdriver.

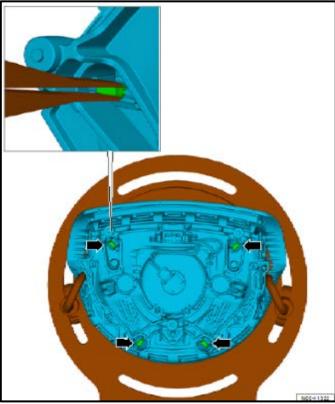

 Remove locking pins <arrows> for horn ring with aid of longnose pliers.

March 2018 69Q9 Page 54 of 66

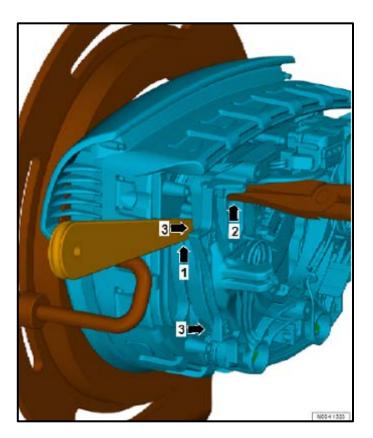

 Apply removal wedge -3409- between horn ring and inflator <1> and press together locking elements using longnose pliers <2>.
 Lever off horn ring at plastic lugs <3>.




- Position the removal wedge -3409- on the plastic lugs to prevent damage to the conductor strip.
- Insert the removal wedge -3409- between the inflator and horn ring to prevent the horn ring from engaging again.
- Repeat work steps on other side.

A CAUTION

Use extreme care when removing the horn ring. If horn ring is damaged during remove, airbag replacement will be necessary. Replacement of the airbag due to damage during horn ring removal will not be covered under this action.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.


March 2018 69Q9 Page 55 of 66

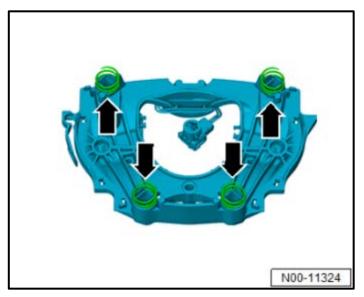

Remove horn ring with springs <arrows>.

A CAUTION

- When removing the horn ring, take care that the springs are not lost as they are not available sepereately.
- ONE replacement spring is included in the inflator kit in the event a spring is lost or damaged.
- If more than one spring is lost, replacement of the airbag is required. Replacement of the airbag is required if a spring is lost and is not covered under this action.

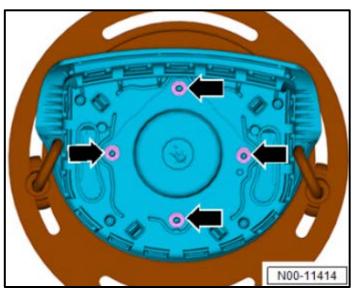


- Remove and discard nuts <arrows>.
- Remove the inflator and place in the original packaging.

U NOTE

Inflator return instructions are included with the new inflator.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.


March 2018 69Q9 Page 56 of 66

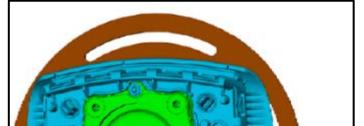

Installation Procedure:

 Insert new inflator and check to ensure it is seated correctly. Note the recess <arrow>.

Criteria	Inflator Kit Part Number
T1	3C0898201J

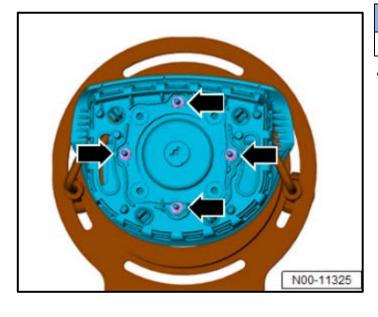


U NOTE

The nuts are self-locking and must be replaced


 Install new nuts <arrows> and torque to 5 Nm ± 0.4 Nm.

March 2018 69Q9 Page 57 of 66

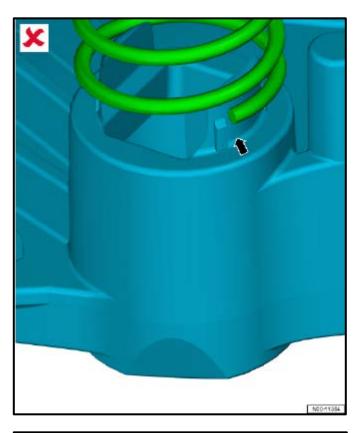


U NOTE

- If one of the springs is damaged or has been lost, it can be replaced with a spring from the bag of spares included.
- Note the examples shown for reference of proper spring seating.
- Spring seated incorrectly <arrow>.

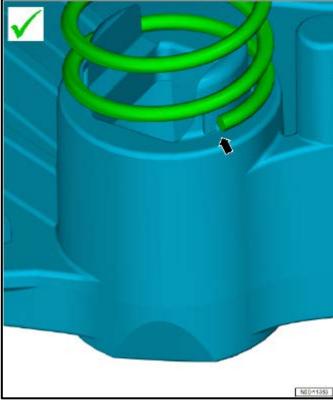


Spring seated correctly <arrow>.

March 2018 69Q9 Page 58 of 66

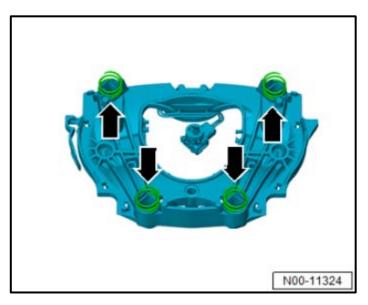


 Fit springs <arrows> for horn ring again if necessary.

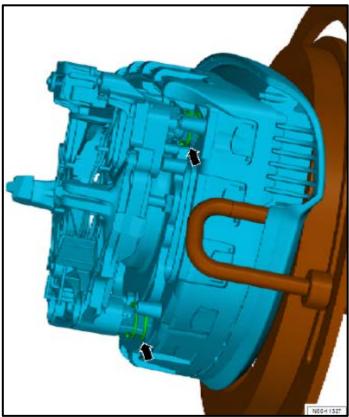

Position horn ring with springs on securing clips and press firmly in place. Ensure that springs are seated correctly on both sides <arrows>.


March 2018 69Q9 Page 59 of 66

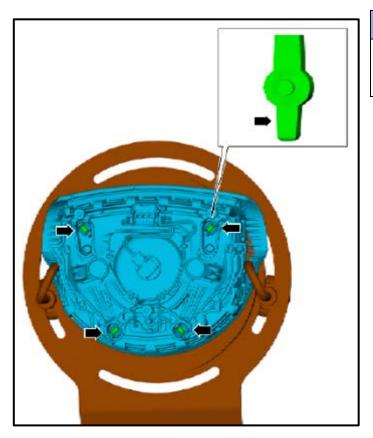

① NOTE

If a pin is damaged or has been lost, it can be replaced with a locking pin from the bag of spares included.

 Using long-nose pliers, insert four locking pins in retaining lugs with narrow side facing downwards <arrow in magnification>. Pins must engage audibly.

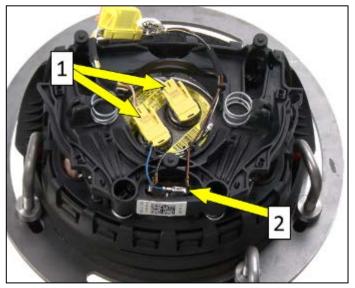


- Connect central connector(s) <1> on inflator.
- Press central connector lock(s) in until fully locked.
- Connect ground cable <2>.

Continue to Section F.

March 2018 69Q9 Page 60 of 66

Section F - Airbag Installation

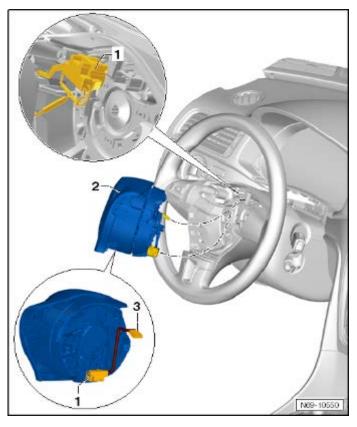

A WARNING

- The battery must be disconnected before installing the airbag back into the vehicle.
- Before handling pyrotechnic components (for example, disconnecting the connector), the person handling it must "discharge static electricity". This can be done by touching the door striker, for example.
- Connect the connector <1>. The connector must click into place during this.
- Press the connector lock on the connector <1>.
- Connect the connector <3> (if equipped).
- Insert the airbag unit <2> into the steering wheel but do not press on it.



Procedure illustrated is for a three spoke steering wheel. The procedure for a four spoke steering wheel is the same.



- Press on the edge of the airbag unit <1> with both hands until it locks into place.
- Gently pull on the airbag unit to make sure the airbag unit is secured correctly at all three attachment points in the steering wheel.

Continue to Section G.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2018 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

March 2018 69Q9 Page 61 of 66

Section G – Battery Reconnect



For 2006-2010 MY Passat vehicles, the engine may not start after reconnecting battery. This condition should be resolved by following these steps:

- 1. Remove the key from the vehicle.
- 2. Open and close the driver's door.
- 3. Lock then unlock the vehicle using the remote.
- 4. Insert the key and the vehicle should now start.





WARNING


Ignition must be **ON** when connecting battery. If pyrotechnic components (e.g. airbag, belt tensioner) are not repaired correctly, they may deploy unintentionally after connecting battery. There must not be anyone inside the vehicle when connecting the battery.

- Connect the battery ground cable terminal by hand to the battery negative terminal.
- Torque the nut <1> to 6 Nm.




NOTE

After connecting the battery and switching on the ignition, the ASR/ESP Control Lamp -K155- and Electromechanical Power Steering Indicator Lamp light up continuously. The indicator lamps switch off automatically after driving straight ahead at 10 to 15 mph. This activates Steering Angle Sensor -G85-.

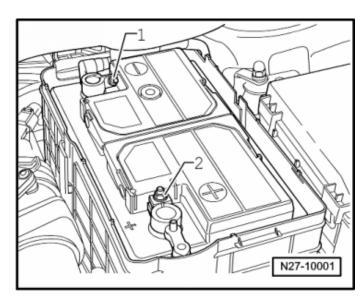

March 2018 69Q9 Page 62 of 66

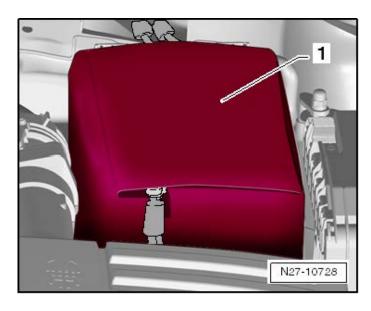


- Close the cover <1>.
- Cycle the ignition off and back on.
- Bring driver seat to an upright position.
- Store previously recorded radio presets (if necessary).
- Set clock to local time.
- Activate the power window regulator one-touch up/down function.
- Check the DTC memories of all the control units and erase under-voltage faults if necessary.
- After completing repairs, verify the horn is operational.




Diagnosis and repair of an inoperable horn, before or after inflator replacement, will not be covered under this campaign.

Proceed to Section H.

March 2018 69Q9 Page 63 of 66

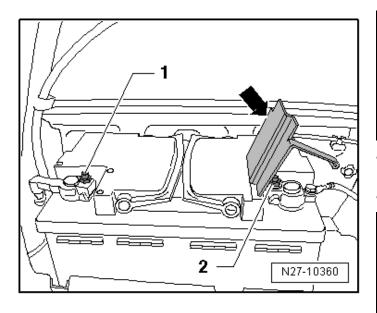

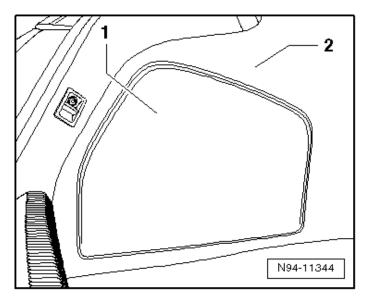

Battery In Luggage Compartment:

A WARNING

Ignition must be **ON** when connecting battery. If pyrotechnic components (e.g. airbag, belt tensioner) are not repaired correctly, they may deploy unintentionally after connecting battery. There must not be anyone inside the vehicle when connecting the battery.

- Connect the battery ground cable terminal by hand to the battery negative terminal.
- Torque the nut <1> to 6 Nm.

U NOTE

After connecting the battery and switching on the ignition, the ASR/ESP Control Lamp -K155- and Electromechanical Power Steering Indicator Lamp light up continuously. The indicator lamps switch off automatically after driving straight ahead at 10 to 15 mph. This activates Steering Angle Sensor -G85-.

- Install the service cover <1> on the side trim panel <2>.
- Cycle the ignition off and back on.
- · Bring driver seat to an upright position.
- Store previously recorded radio presets (if necessary).
- Set clock to local time.
- Activate the power window regulator one-touch up/down function.
- Check the DTC memories of all the control units and erase under-voltage faults if necessary.
- After completing repairs, verify the horn is operational.



Diagnosis and repair of an inoperable horn, before or after inflator replacement, will not be covered under this campaign.

Proceed to Section H.

March 2018 69Q9 Page 64 of 66

Section H - Campaign Completion Label

Install Campaign Completion Label

 Fill out and affix Campaign Completion Label, part number CAMP 010 000, next to the vehicle emission control information label.

i TIP

Ensure Campaign Completion Label does not cover any existing label(s).

Repair is Complete, Proceed to Appendix B (Mandatory Takata Inflator Return Process).

March 2018 69Q9 Page 65 of 66

Appendix A - Warning and Safety Precautions

A WARNING

General Safety Precautions when Working with Pyrotechnic Components:

- Pyrotechnic components always contain propellant that generates a gas during combustion. In some components, there is also a supply of pressurized gas to ensure this gas is generated
- This pressurized gas is stored under high pressure in a compressed gas container. Pyrotechnic components
 are triggered by electrical/mechanical igniters.
- Only trained personnel should perform testing, assembly and servicing work. Airbags do not have a replacement interval.
- Never check with test lamps, voltmeter or ohmmeters.
- Only check pyrotechnic components when they are installed in the vehicle using vehicle diagnosis, testing and information systems approved by the manufacturer.
- When working on pyrotechnic components and the airbag control module, disconnect the battery ground strap while the ignition is switched on. Then cover the negative terminal.
- Wait 10 seconds after disconnecting the battery.
- The ignition must be SWITCHED ON when connecting the battery. There should not be anyone inside the vehicle when doing this.
- Exception: vehicles with batteries in the passenger compartment. In this case, stay outside the range of the airbags and seat belts.
- Wash your hands after touching ignited pyrotechnic components from the restraint system.
- Do not open or repair pyrotechnic components. Use only new components to reduce the risk of injury.
- Do not install pyrotechnic components that have fallen onto a hard surface or show signs of damage.
- Discharge static electricity before handling pyrotechnic components, for example before disconnecting the electrical connector. This can be done by touching grounded metal objects such as the door striker pin.
- Install pyrotechnic components immediately after removing them from their transport packaging. If you must stop working, store the pyrotechnic component in its original transport packaging.
- Do not leave pyrotechnic components lying in the open unattended.
- Do not treat pyrotechnic components with grease, cleaning solutions or similar products.
- Do not expose pyrotechnic components to temperatures above 100 °C, even for brief periods of time.
- People in the immediate vicinity of the workplace must be protected from possible noise and projectiles.
- Pyrotechnic components can trigger unintentionally.
- In the event of unintentional deployment:
 - Single-stage inflators: allow airbag to cool down completely. Wait at least 10 minutes before handling.
 - Two-stage inflators: wait for second airbag ignition. Allow airbag to cool down completely. Wait at least 10 minutes before handling.

Appendix B – Mandatory Inflator Return Process

- Properly store (retain) removed parts in accordance with all state/province, local requirements.
- Questions regarding the return process should be directed to the contacts listed on the included return instructions.
- Additional instructions are located in the attachments in Elsa and ServiceNet.

March 2018 69Q9 Page 66 of 66