

Part 573 Safety Recall Report

19E-045

Manufacturer Name : Reyco Granning

Submission Date : JUL 17, 2019

NHTSA Recall No. : 19E-045

Manufacturer Recall No. : NR



Manufacturer Information :

Manufacturer Name : Reyco Granning

Address : 1205 Industrial Park Drive

Mt. Vernon MO 65712

Company phone : 4662178

Population :

Number of potentially involved : 399

Estimated percentage with defect : 10 %

Equipment Information :

Brand / Trade 1 : Reyco Granning

Model : IFS FT Independent Suspension Family

Part No. : IFS

Size : 20,24

Function : FT Suspension

Descriptive Information : Independent Front Suspension (IFS FT) modules manufactured by Reyco Granning Llc. Between 12/01/2014 to 7/01/2019 could have loose upper shock mounts. These modules were supplied to Fire Truck manufacturers.

Production Dates : DEC 01, 2014 - JUL 01, 2019

Description of Defect :

Description of the Defect : A loose upper shock mount system on Fire Truck Independent Front Suspensions manufactured by Reyco Granning llc.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Possible loss of hydraulic steering assist

Description of the Cause :

1. Shock mounting pockets manufactured outside of the specified tolerance range (too wide).
2. Nut /bolt combination provided by vendor with a very high friction coefficient (k factor) resulting in low clamp load at specified torque.

Identification of Any Warning that can Occur : Prior to complete separation of shock from upper mount, lose joint will rattle or clunk. Upon inspection, shock eyelet can be moved by hand. The failure will progress to loss of dampening and degradation of handling characteristics. Gross movement of the shock will result in a louder clunk as it contacts other suspension components. Finally, the shock can work into a position that results in damage to the steering gear box housing, causing a leak (puddle on

ground, degradation of steering assist).

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

Chronology :

Initially suspensions were built with standard shock absorbers with a standard upper eye and hardware configuration. On 12/1/2014, the shock was changed to Koni - the upper eye configuration was changed to allow the use of a heim joint and required an additional 2 spacers. It was determined at the time, after loose shock eyes were noted that the material used to make the spacers was not strong enough to withstand the compressive load. A kit was created at that time to address units that became loose in the field. The spacer material was changed at that time to a material with a much higher compressive strength. very few failures occurred after the change took place.

Description of Remedy :

Description of Remedy Program : Reyco Granning will notify all customers of this action and provide serial numbers of affected product to assist these manufacturers in identifying potential affected vehicles. Reyco Granning will implement an inspection and rework procedure.

How Remedy Component Differs from Recalled Component : The remedy involves the use of a new bolt an nut, a hardened washer (for use under the head of the bolt) and shims if necessary to close the gaps. The bolt nut combination has been tested and determined to provide adequate clamp for pockets within width tolerance. Shims ill be used to close the gap on pockets that may be over tolerance. New bolts will be torqued to the appropriate torque value.

Identify How/When Recall Condition was Corrected in Production : Quality alert was posted concerning issue on production line. New fasteners were brought in with a new coating (fully tested to insure that the combination produced appropriate clamp load). Pockets are being monitored as part of the process to insure that they are in tolerance. Bolt washer nut combination will be monitored on an ongoing basis.

Recall Schedule :

Description of Recall Schedule : NR

Planned Dealer Notification Date : JUL 31, 2019 - SEP 16, 2019

Planned Owner Notification Date : JUL 31, 2019 - SEP 16, 2019

Purchaser Information :

The following manufacturers purchased this defective/noncompliant equipment for possible use or installation in new motor vehicles or new items of motor vehicle equipment:

Name : Spartan Motors

Address : 1000 Reynolds Rd
Charlotte MI 48813

Country : US

Company Phone : NR

Name : Ferrara Fire Apparatus INC

Address : 27855 James Chapel Rd N
Holden LA 70744

Country : US

Company Phone : NR

Name : E-One

Address : 1601SW 37th Avenue
Ocala FL 34474

Country : US

Company Phone : NR

Name : Kovatch Mobile Equipment

Address : One Industrial Complex
Nesquehoning PA 18240

Country : US

Company Phone : NR

Name : Rosenbauer Motors L.L.C.

Address : 5190 260th St
Wyoming MN 55092

Country : US

Company Phone : NR

Name : HME Ahrens-Fox

Address : 1950 Byron Center Ave SW
Wyoming MI 49519

Country : US

Company Phone : NR

* NR - Not Reported