

Part 573 Safety Recall Report

19V-042

Manufacturer Name : Winnebago Industries, Inc**Submission Date :** MAR 12, 2019**NHTSA Recall No. :** 19V-042**Manufacturer Recall No. :** 156**Manufacturer Information :****Population :****Manufacturer Name :** Winnebago Industries, Inc**Number of potentially involved :** 3,351**Address :** PO BOX 152
605 W. Crystal Lake Rd. Forest City IA
50436**Estimated percentage with defect :** 100 %**Company phone :** 1-641-585-3535**Vehicle Information :****Vehicle 1 :** 2012-2018 Winnebago ERA**Vehicle Type :****Body Style :****Power Train :** NR**Descriptive Information :** Cabinets shelves did not have the required number of fasteners to hold the shelf to the cabinet face. Affected the entire population up thru hold notice 876**Production Dates :** NOV 11, 2010 - JAN 16, 2019**VIN Range 1 : Begin :**

NR

End : NR☐ Not sequential**Description of Defect :****Description of the Defect :** Overhead cabinet shelf may detach from the cabinet face and fall down in the cab area.**FMVSS 1 :** NR**FMVSS 2 :** NR**Description of the Safety Risk :** If the shelf would fall while in transit the driver and passenger may be injured from the shelf and the contents of the cabinet falling them and/or could become a distraction to the driver, which could lead to a crash causing to death or injury**Description of the Cause :** Cabinets shelves did not have the required number of fasteners to hold the shelf to the cabinet face**Identification of Any Warning that can Occur :** One or more cabinet screws coming loose.**Supplier Identification :**

Component Manufacturer

Name : NR
Address : NR
NR
Country : NR

Chronology :

1-3-19 S/N 15X14469 ORMU opened identifying OVHD shelf fell down on customer
1-4-19 Investigating found a Change Request opened June/July 2018 due to a shelf failure
1-7-19 Found ORMU on S/N 15W12962 was opened on 9-18-18 for shelf failure
1-7-19 Found S/N 15W12408 & 15W12615 on "Face Book" with a stated shelf failure
1-11-19 Safety Committee determined this issue is recallable
1-15-19 Submitted to NHTSA portal

Description of Remedy :

Description of Remedy Program :	Adding two support brackets and 18 screws along with a Warning label with MAX capacity of this storage space.
How Remedy Component Differs from Recalled Component :	The door opening will have a label installed stating the MAX capacity of the storage space.
Identify How/When Recall Condition was Corrected in Production :	Adding two support brackets and 18 screws along with a label stating the MAX capacity of the storage space.

Recall Schedule :

Description of Recall Schedule : NR
Planned Dealer Notification Date : NR - NR
Planned Owner Notification Date : NR - NR

* NR - Not Reported