

Part 573 Safety Recall Report

19V-067

Manufacturer Name : Chrysler (FCA US LLC)**Submission Date :** FEB 05, 2019**NHTSA Recall No. :** 19V-067**Manufacturer Recall No. :** V07**Manufacturer Information :**

Manufacturer Name : Chrysler (FCA US LLC)

Address : 800 Chrysler Drive
CIMS 482-00-91 Auburn Hills MI
48326-2757

Company phone : 1-800-853-1403

Population :

Number of potentially involved : 193,813

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2019-2019 Ram 1500

Vehicle Type :

Body Style : PICKUP TRUCK

Power Train : NR

Descriptive Information : Some 2019 MY Ram 1500 vehicles, equipped with adjustable pedals, may have been built with a pedal assembly that could allow the brake pedal to over travel during adjustment, potentially resulting in the brake pedal separating from the adjustable pedal assembly.

The suspect period began at Sterling Heights Assembly Plant ("SHAP") on October 31, 2017, when the 2019 MY Ram 1500 production began with adjustable pedals, to January 15, 2019, when an additional over travel prevention feature was added to the pedal assembly.

Similar vehicles not included in the recall were manufactured without adjustable pedals or after the period when an additional over travel prevention feature was added to the adjustable pedal assemblies in production.

Production Dates : OCT 31, 2017 - JAN 15, 2019

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Defect :**

Description of the Defect : An adjustable brake pedal assembly that allows the brake pedal adjustment to over travel could cause the brake pedal to become separated from the pedal assembly.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : If the brake pedal separates from the adjustable pedal assembly, the driver may be unable to use the brake pedal to apply the service brakes, which can cause vehicle crash without prior warning.

Description of the Cause : NR

**Identification of Any Warning
that can Occur :** NR

Supplier Identification :

Component Manufacturer

Name : Batz Mexicana Sa De Cv

Address : Circuito Exportacion No 142
San Luis Potosi FOREIGN STATES 78395

Country : Mexico

Chronology :

- On December 11, 2018, the FCA US LLC ("FCA US") Vehicle Safety and Regulatory Compliance ("VSRC") organization opened an investigation as a result of a field report from a vehicle which exhibited a separated brake pedal. (FCA US was told the vehicle was parked at the time of the incident).
- Between December 11, 2018, and January 17, 2019, meetings were conducted between FCA US VSRC and FCA US Chassis Engineering to review the issue and understand customer consequence, potential root cause, scope of vehicles potentially affected, and corrective actions being investigated and planned.
- On January 31, 2019, FCA US was notified of an additional incident of a separated brake pedal (the driver told FCA US the vehicle was in motion at the time of the incident).
- As of February 1, 2019, FCA US has identified two CAIRs, two field reports, and zero VOQs related to this issue.
- As of February 1, 2019, FCA US has identified 0.022 C/1000 warranty related to this issue.
- As of February 1, 2019, FCA US is not aware of any accidents or injuries potentially related to this issue.
- On February 2, 2019, FCA US determined, through the Vehicle Regulations Committee, to conduct a voluntary safety recall of the affected vehicles.

Description of Remedy :

Description of Remedy Program : FCA US will conduct a Voluntary Safety Recall on all affected vehicles to repair the adjustable pedal assembly.

FCA US has a longstanding policy and practice of reimbursing owners who have incurred the cost of repairing a problem that subsequently becomes the subject of a field action. To ensure consistency, FCA US, as part of the owner letter, will request that customers send the original receipt and/or other adequate proof of payment to the company for confirmation of the expense.

How Remedy Component Differs from Recalled Component : Part Name: Pedal Assy – Accelerator & Brake Auto Trans

Part Description: Adjustable Pedal Assembly

Part Number: 68312752AC / 68312752AD / 68312752AE / 68312752AF / 68312752AG / 68312752AH / 68312752AI

Comment: Remedy will add a secondary stop and spacer to the adjustable pedal assembly.

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : ** 2/5/2019: FCA US will notify dealers and begin notifying owners on or about 3/27/2019.

Planned Dealer Notification Date : MAR 27, 2019 - MAR 27, 2019

Planned Owner Notification Date : MAR 27, 2019 - MAR 27, 2019

* NR - Not Reported