OMB Control No.:	2127-0004
OND CONTROL TO	2127 0001

### Part 573 Safety Recall Report

# Manufacturer Name :Polaris Industries, Inc.Submission Date :MAR 07, 2019NHTSA Recall No. :19V-185Manufacturer Recall No. :T-18-01

#### Manufacturer Information :

Manufacturer Name : Polaris Industries, Inc. Address : 2100 Highway 55 Medina MN 55340 Company phone : 800-765-2747

#### **Population** :

Number of potentially involved : 3,305 Estimated percentage with defect : NR

🔂 🔆 🗥 🕁

NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION

19V-185

#### Vehicle Information :

Vehicle 1:	2018-2	019 Polaris Slingshot			
Vehicle Type :	MOTO	MOTORCYCLES			
Body Style :	OTHER				
Power Train :	GAS				
Descriptive Information :	This recall is a population expansion of 18V195 (Polaris ID: T-18-01), and is filed separately at the request of NHTSA.				
Production Dates :	FEB 24	, 2018 - JAN 14, 2019			
VIN Range 1:	Begin :	NR	End :	NR	Not sequential

#### **Description of Defect :**

Description of the Defect :	Errors in seat assembly may result in seat belt buckle and seat back dislodging from seat base.
FMVSS 1 :	NR
FMVSS 2 :	NR
Description of the Safety Risk :	If the seat slides unexpectedly, this may increase the risk of a loss of control or the risk of injury in the event of a crash.
Description of the Cause :	The seat belt and seat back anchoring bracket may have been improperly welded.
Identification of Any Warning that can Occur :	The seat back may loosen or move unexpectedly.

#### **Supplier Identification :**

#### **Component Manufacturer**

The information contained in this report was submitted pursuant to 49 CFR §573

## Part 573 Safety Recall Report

**19V-185** 

Nome IND	
Name : NR Address : NR	
NR	
Country : NR	
Chronology :	
	l is from the original population, until Polaris discovered a continued issue
from the supplier and started manua	ally inspecting them upon arrival in Huntsville. Upon discovery, Polaris at bases that had been arriving, and decided to expand the population of
Description of Remedy :	
Description of Remedy Program :	Polaris will instruct dealers to inspect seat belt bracket weldment and seat
	slider latching function. If a weld is incomplete or missing or if a slider does not latch properly, Polaris will instruct dealers to replace the seat base.
	If you have had this procedure performed before you received this letter, you may be eligible to receive reimbursement for the cost of obtaining a pre-notification remedy of the problem associated with this recall. For more information regarding obtaining reimbursement please contact the Polaris Consumer Service Department using the contact information above.
<b>J 1</b>	Any seat bases determined upon inspection to have assembly errors will be replaced with properly assembled and installed bases.
Identify How/When Recall Condition was Corrected in Production :	Quality checks in place for affected seat parts at supplier, as well as Polaris' production lines.
	Future production will entail quality checks of tooling and production processes.
Recall Schedule :	
Description of Recall Schedule :	NR
Planned Dealer Notification Date :	
Planned Owner Notification Date :	
* NR - Not Reported	