

Part 573 Safety Recall Report

19V-304

Manufacturer Name : Spartan Motors USA

Submission Date : APR 17, 2019

NHTSA Recall No. : 19V-304

Manufacturer Recall No. : 19009



Manufacturer Information :

Manufacturer Name : Spartan Motors USA

Address : 1541 Reynolds Road

Charlotte MI 48813

Company phone : 517-543-6400

Population :

Number of potentially involved : 89

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2019-2019 Fleet Vehicle Services Truck Body

Vehicle Type : BUSES, MEDIUM & HEAVY VEHICLES

Body Style : OTHER

Power Train : DIESEL

Descriptive Information : The basis for the population is related to a VIN list of chassis cabs supplied by Peterbilt that are affected by PACCAR's recall 19V-282

Production Dates : JAN 01, 2018 - DEC 31, 2018

VIN Range 1 : Begin :

NR

End : NR

Not sequential

Description of Defect :

Description of the Defect : In recall id 19V-282, Paccar asserts the connector between the cab power harness and the power distribution (PDC) harness may overheat and melt.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : A melted connector can create an intermittent connection that may result in loss of power to the vehicle and possible engine shutdown. (See Recall 19V-282)

Description of the Cause : The wires located on the Model 520 PDC harness and the mating power jumper are potentially undersized.

Identification of Any Warning that can Occur : Connector may melt without warning.

Supplier Identification :

Component Manufacturer

Name : NR
Address : NR
NR
Country : NR

Chronology :

To be supplied by COB 19APR19.

Description of Remedy :

Description of Remedy Program : The remedy will consist of replacing the 10 gauge main power wire to the PDC harness with 4 gauge wire in Model 520 LH and RH steer trucks manufactured prior to 3/4/19.

How Remedy Component Differs from Recalled Component : For Spartan, this recall is only for vehicles built on the M520 model chassis cab supplied by Peterbilt/Paccar. Please see 19V-282 for how Peterbilt/Paccar for distinguishing information on the chassis cab.

Identify How/When Recall Condition was Corrected in Production : Pending

Recall Schedule :

Description of Recall Schedule : Spartan will not issue a dealer notice. Instead, Spartan will issue an owner notification that directs the owner to contact a Peterbilt dealer.

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : JUN 03, 2019 - JUN 03, 2019

* NR - Not Reported