VOLVO CAR SERVICE AND PARTS BUSINESS



Parts Bulletin TITLE: Recall R29936: Coolant Bleeder Hose (Engine Side) Model Year 2016 XC90 **GROUP:** CAT/NO: **REFERENCE BULLETINS:** CAR MARKET: **United States and Canada** 2 R29936 **QB R29936 ISSUE DATE:** STATUS DATE: COPY TO / CIRCULATIONS (PLEASE INITIAL): 2019-04-17 2019-04-17 GENERAL PARTS SERVICE SALES MANAGER MANAGER MANAGER MANAGER Page 1 of 1

"Right first time in Time"

Reference Bulletins: QB R29936

Volvo Car USA LLC and Volvo Car Canada LTD (Volvo) on behalf of Volvo Car Group has decided to launch Recall R29936 on model year 2016 XC90 vehicles.

Volvo has identified that the coolant bleeder hose (engine side) may degrade over time and crack due to heat and humidity load. This condition can create a coolant leak, and also pose a risk of coolant leaking on the catalytic converter. If the coolant leak goes unnoticed, coolant may accumulate in the catalytic converter heatshield insulation and, in a worst case scenario, over time this might result in a fire in the engine compartment area when the vehicle is stationary.

The corrective action is to replace the engine side coolant bleeder hose.

A total of 34,006 U.S. and 2,721 Canadian vehicles are eligible for this recall.

The following part numbers apply:

Part Number	Description	Qty
32252299*	Coolant Bleeder Hose	1
31439821	Coolant	1 (Non-Hybrid) 1.5 (Hybrid)

*Maximum order quantity is 3.

Produced in the USA and available as an electronic document. Hard copy documents are printed in USA on recycled paper containing	
a minimum of 50% wastepaper and 10% post-consumer waste.	
© 2019 VOLVO CAR USA, LLC	