OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

## 19V-329

**Manufacturer Name:** Fenton Mobility Products, Inc.

**Submission Date:** APR 26, 2019 **NHTSA Recall No.:** 19V-329 **Manufacturer Recall No.:** 18E-076



#### **Manufacturer Information:**

Manufacturer Name: Fenton Mobility Products, Inc.

Address: 26 Center Street

Randolph NY 14772

Company phone: 716-484-7014

## **Population:**

Number of potentially involved: 360 Estimated percentage with defect: NR

#### **Vehicle Information:**

Vehicle 1: 2015-2018 Freedman Seating GOES Double Fold

Vehicle Type: LIGHT VEHICLES

Body Style : VAN Power Train : GAS

Descriptive Information: Freedman Seating sent us a recall notice, repair instructions and a list of affected

units based on our purchase orders

Production Dates: JAN 01, 2015 - JUL 31, 2018

VIN Range 1 : Begin : NR End : NR Not sequential

#### **Description of Defect:**

Description of the Defect: Freedman Seating Company (FSC) has determined that our GO-ES Foldaway

Seat may have

a defect which may increase the risk in occupant injury in the event of a vehicle

collision.

These seats may have been manufactured with a back frame weldment that is

too narrow

resulting in deformation of the seat back cushion dump mechanism which may

cause it to

malfunction. If this mechanism does malfunction the seat back cushion may not

support the

appropriate loading in the event of a front or rear vehicle collision.

During the operation of the seat and, specifically, in rotating the seat back

cushion from the

stowed to the upright, design use position there needs to be an audible click of

the mechanism

locking into position. In addition, the mechanism handle will rotate

downwards. There may be

some seats where the mechanism does not fully engage during this operation

of the seat back cushion

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: If this mechanism does malfunction the seat back cushion may not support

the

appropriate loading in the event of a front or rear vehicle collision.

Description of the Cause: Manufacturer Engineering Defect

Identification of Any Warning NONE

that can Occur:

#### **Supplier Identification:**

#### **Component Manufacturer**

Name: Freedman Seating

Address: 4545 W. Augusta Blvd

Chicago ILLINOIS 60465

**Country: United States** 

#### **Chronology:**

Unknown - Determined at Manufacturer

### **Description of Remedy:**

Description of Remedy Program: Recall kit 44200 will be made available for our on-the-road technician to

perform safety evaluation and repair as needed.

How Remedy Component Differs SAME Recall Component 44200 Freedman Kit

from Recalled Component :

Identify How/When Recall Condition It appears that this is only seats manufacturred before July 2018 unknown

was Corrected in Production: procedure for correction at Freedman

#### **Recall Schedule:**

Description of Recall Schedule: Customers will be notified that our technician will be on-site to assess

and correct this concern and appointments will be scheduled

Planned Dealer Notification Date : MAY 15, 2019 - MAY 31, 2019 Planned Owner Notification Date : MAY 15, 2019 - MAY 31, 2019

<sup>\*</sup> NR - Not Reported