


CONDITION OF CONCERN

Certain vehicles may exhibit any one or all of the following concerns, due to a faulty indicator assembly:

- Passenger air bag deactivation indicator light may turn off, even though the passenger air bag is deactivated.
- Seat belt status indicator of the front passenger seat may turn off, even though the front passenger seat belt is unfastened.
- Seat belt status indicators of rear passenger seats may turn green, even though the rear seat belt(s) are unfastened.

These false indicator concerns can be detected by illumination of the air bag system malfunction warning light in the instrument cluster and an audible warning.

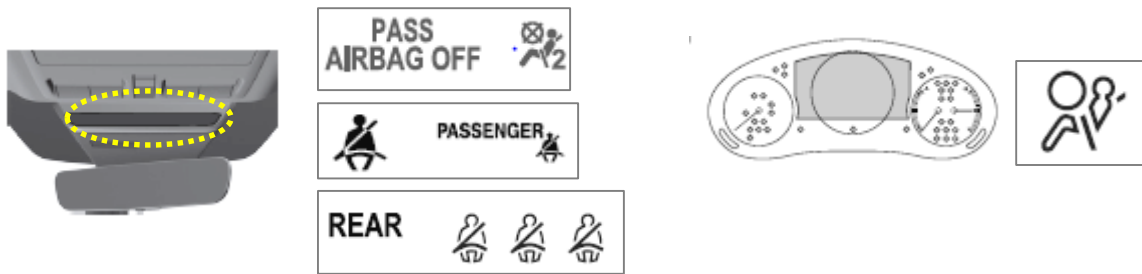

There is no effect on the air bag system operation. False information may lead the driver and passengers to react inappropriately to the warning lights, increasing risk to their safety, such as a driver being unaware the passengers in the rear seat are not belted while vehicle is moving.

Drivers can detect these defect occurrences by illumination of the air bag system malfunction warning light in the instrument cluster and an audible warning.

Dealers are instructed to replace the Indicator Assembly with a modified one. The repair must be performed on all subject vehicles at no charge to the vehicle owners.

Please refer the Repair Procedure document on MGSS for further details.

SUBJECT VEHICLES

Model	VIN range	Build date range
2019 Mazda3 (built at MC)	JM1BP****K1 100042-129277	From September 25, 2018 through March 8, 2019
2019 Mazda3 (built at MMVO)	3MZBP****KM 100048-107919	From January 15, 2019 through March 23, 2019

The asterisk symbol "*" can be any letter or number.

PARTS AND WARRANTY INFORMATION
Recall Campaign 3319E

OWNER NOTIFICATION

Mazda will notify U.S. owners by first class mail by July 10, 2019.

PARTS INFORMATION

Description	Part number	Quantity	Notes	Scrap
Indicator	BDGF-55-260B	1	Use the part with suffix "B" or later	YES
Sensor Cover (R)	BCJH-67-Z31	1	Necessary only when damaged during repair	YES
Sensor Cover (L)	BCJH-67-Z32	1		YES
Sensor Cover (C)	BCJH-67-Z33	1		YES
Campaign Label	9999-95-065A-06	1=50 labels	Obtain in Mazda e-Store (no charge)	N/A

WARRANTY CLAIM PROCESSING INFORMATION

	Indicator Replacement
Process Number	AK023A
Symptom Code	99
Damage Code	99
Causal Part No. & Quantity	BDGF-55-260* & 1
Labor Operation	XXR4NARX
Labor Hours	0.2 hrs.

Note:

- The suffix of Causal Part No. should be "B" or later.
- If the sensor cover is damaged during repair, submit the replaced cover as a related part.

RENTAL CAR INFORMATION

Mazda recommends the usage of the MCVP loaner vehicle when available. If all MCVP loaner vehicles are in use and unavailable, and the customer needs a rental car, then use your local rental facility and offer a rental car. Be sure that every effort is made to repair the car within one business day or less in order to allow the next customer the same experience.

Rental Car Warranty Claim Information

	MCVP Vehicle Preferred	Rental Agency Vehicle
Warranty Type Code	N/A MCVP does not require claim submission	A
Symptom Code		99
Damage Code		99
Part Number Main		5555-33-19ER
Part Quantity		0
Labor Operation Code		MM024XRX
Labor Hours		0
Sublet - Rental Car		
Sublet Invoice Number		Number from Rental Invoice or Dealer Purchase Order
Sublet Type Code		Enter "Z9" (other)
Sublet Amount		Up to \$30.00 per day for the number of days customer
Sublet Text		Number of days rental car was

Rental expenses exceeding the two-day limit will require prior Warranty Department Authorization, as outlined in the Mazda Rental Car Reimbursement Program policy.