



Jaguar Land Rover North America, LLC has informed the National Highway Traffic Safety Administration (NHTSA) of its intent to perform a voluntary Safety Recall on certain 2016 model year Land Rover Range Rover Sport and Range Rover vehicles imported into the United States market. Information relating to this Recall will be posted on the National Highway Traffic Safety Administration website.

United States Federal regulations require that retailers must be notified within a reasonable time after the manufacturer decides that a defect that relates to motor vehicle safety or a noncompliance exists.

United States Federal law requires retailers to complete any outstanding Recall service before a new vehicle is delivered to the buyer or lessee. Violation of this requirement by a retailer could result in a civil penalty of up to \$21,780.00 per vehicle.

This Aftersales Bulletin serves as notification to all Land Rover retailers in the United States and Federalized Territories that any affected new vehicles may not be sold and delivered for customer use until the Recall repair is completed.

DESCRIPTION OF DEFECT

An issue has been identified on certain Land Rover vehicles within the listed Affected Vehicle Range where customers have reported a front and/or rear left door is unlatched when in the closed position and no indication provided of an unlatched condition. Some customers have reported that a front and/or rear door on the left-side of the vehicle has opened while the vehicle was in motion. A spring in the Keyless Vehicle Latching System (KV Latch) may jam between the outside transmission lever and chamfer bush. With the spring trapped, the latch assembly cannot return to its correct position and the latch assembly will not fully latch the door.

AFFECTED VEHICLE RANGE

Range Rover Sport (L494)

Model Year: 2016

VIN: SALWG2VF0GA556983-SALWR2EF6GA599458

..... SALWR2VF5GA636516-SALWG2PFXGA657901

Range Rover (L405)

Model Year: 2016

VIN: SALGS2EF3GA258138-SALGS2PF8GA298504

A total of 28,671 vehicles are potentially involved in the USA and Federalized Territories. Visit the British Brands Sales Suite (BBSS) website for a list of affected vehicles at your retailer.

EFFECT ON VEHICLE OPERATION

Vehicle doors which are not latched in either the primary or secondary state may, while driving, open. This can increase the risk of a vehicle crash or compromise the safety of vehicle occupants.

SERVICE PROGRAM / REWORK ACTION

Owners will be notified by mail and instructed to take their vehicle to an authorized retailer who will replace the front and rear left door latch assemblies with one that fully meets the engineering specification.

There will be no charge to owners for this action.

OWNER NOTIFICATION

Owner notification is expected to occur on or before July 17, 2019.

Jaguar Land Rover North America, LLC
100 Jaguar Land Rover Way
Mahwah, NJ 07495

ACTION TO BE TAKEN

Check DDW to ensure that the vehicle is affected by this Program prior to undertaking any rework action.

Retailers are required to HOLD affected new vehicles that are within your control and refrain from releasing the vehicles for new vehicle sale pending completion of the rework action. Affected vehicles already in the hands of customers should be updated at the next available opportunity.

Jaguar Land Rover North America recommends that affected sales demonstrator and loaner vehicles are repaired before use and that used vehicles are repaired before sale. Retailers who choose to proceed against this recommendation, where legally permitted, must clearly and conspicuously disclose the open recall to the applicable customers.

A Technical Bulletin will be published once repair instructions are finalized and any required parts have been procured.

Thank you for your cooperation in this matter. Jaguar Land Rover North America apologizes for any inconvenience this may cause.