

## 2016 MY RANGE ROVER RANGE ROVER SPORT Safety Recall N336 – Doors may not latch or open while driving



- A spring in the Keyless Vehicle Latching System (KV Latch) may jam between the outside transmission lever and chamfer bush. With the spring trapped, the latch assembly cannot return to its correct position and the latch assembly will not fully latch the door. Vehicle doors not latched in either the primary or secondary state may open during driving.
- Land Rover approved repairers will replace both left hand side door latches with assemblies that fully meet the engineering specification.
- 28,679 USA vehicles are affected. Does not affect Canada.
- Retailers were notified by Bulletin on June 6<sup>th</sup> 2019
- The date for availability of parts and the repair bulletin is being actively managed with the supplier. A review on June 19<sup>th</sup> is expected to provide a timing plan. Retailers will be updated as soon as this information becomes available.
- Customer mailing notification by July 19<sup>th</sup> 2019.
- All affected new vehicles have been retailed.