# Part 573 Safety Recall Report

Manufacturer Name :	Vac-Tron Equipment, LLC
Submission Date :	JUL 24, 2019
<b>NHTSA Recall No. :</b>	19V-442
Manufacturer Recall No. :	VVK0001

#### **Manufacturer Information :**

Manufacturer Name : Vac-Tron Equipment, LLC Address : 27137 South Hwy 33 Okahumpka FL 34762 Company phone : 728-2222

#### Vehicle Information :

Vehicle 1:	2015-2019 Vac-Tron LP873SDT Heavy	
Vehicle Type :	TRAILERS	
Body Style :		
Power Train :	NR	
Descriptive Information :	Vacuum Excavator-dual axle trailer/The LP873SDT Heavy model being recalled is constructed differently than all other models currently at Vac-Tron. This unit has a scissors action that is on top of the frame that places the rear tank extremities higher than other models. Also, the lighting and configuration is different than other models of trailers.	
Production Dates :	DEC 02, 2015 - MAY 21, 2019	
VIN Range 1:	Begin :NREnd :NRNot sequential	

#### **Description of Defect :**

Description of the Defect :	<ol> <li>No rear clearance lamps.</li> <li>No front clearance lamps</li> <li>No rear reflex reflectors placed at trailers widest point.</li> <li>No rear side reflex reflectors.</li> <li>No front side reflex reflectors.</li> <li>Conspicuity tape does not meet length requirements on the side of the trailer.</li> <li>No conspicuity tape on the rear of the trailer</li> <li>No rear upper body marking tape</li> <li>No Front clearance lamps, Yellow showing vehicle width at widest point.</li> <li>Trailer was discovered in needing an extended lower chassis.</li> </ol>		
FMVSS 1 :	108 - Lamps, reflective devices, and assoc. Equipment		
FMVSS 2 :	224 - Rear impact protection		
Description of the Safety Risk :	The trailer may not be visible at night due to lack of lamps at the front and rear and the insufficient amount of reflectivity on the sides and rear of the		
The information contained in this report was submitted pursuant to 40 CED SE72			





### N

### **Population :**

Number of potentially involved : 208 Estimated percentage with defect : 100 %

### Part 573 Safety Recall Report

trailer.

Description of the Cause : NR

Identification of Any Warning NR that can Occur :

#### **Supplier Identification :**

#### **Component Manufacturer**

Name : NR Address : NR

NR

Country: NR

#### **Chronology** :

29-May-2019 Vermeer product safety was notified of a customer concern with a Vac-Tron LP873SDT Heavy trailers lighting and reflectors lacking NHSTA requirements. 31-May-2019 a meeting was had with Vac-Tron and Vermeer to discuss customer concerns and it was determined that more research was needed on the Model in understanding the history of the parts list and different year builds. 6-June-2019 confirmed that the Trailer did not meet all NHSTA requirements for lighting and reflective devices. 7-June-2019 Registered Vac-Tron in NHSTA website as a manufacturer. 18-June-2019 First meeting over solution development. 2-July-2019 met for identified fixes. 3-July-2019 Phone calls over discovery of non complaint lower chassis.

#### **Description of Remedy :**

Description of Remedy Program :	Vac-Tron will send necessary parts and instructions to resolve noncompliance issues. Dealers will be reimbursed for their parts and labor.
	Addition of conspicuity tape that was not installed originally. Addition of reflectors that were not installed originally, Movement of the Marker lights from noncompliant position to compliant position. Install rear lower chassis extension, conspicuity tape, and reflectors that were not installed on rear of the original machine.
Identify How/When Recall Condition was Corrected in Production :	All machines on production line will be built with this kit installed. This will begin 24-July-2019.

#### **Recall Schedule :**

Description of Recall Schedule : NR

The information contained in this report was submitted pursuant to 49 CFR §573

## Part 573 Safety Recall Report

**19V-442** 

Planned Dealer Notification Date :AUG 01, 2019 - AUG 01, 2019Planned Owner Notification Date :AUG 08, 2019 - AUG 08, 2019

\* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573