

Keystone RV Company

7/18/19

SAFETY ADVISORY # 19-357

Hampton – Sunset Breakaway Wiring

Keystone is conducting a voluntary RECALL notification campaign in accordance with the National Highway Transportation and Safety Act. It has been decided that the vehicles in the recall population have a breakaway switch that is nonfunctional. Under certain conditions during travel, if the trailer becomes detached from the tow vehicle, the breakaway switch will not activate the brakes leading to an increased risk of personal injury.

Year	Model	Serial Number Range
2020	Hampton - 364MBL, 370FDL, 371FKL, 372FDB, 373RDD, 374BAR	L5330000 - L5330079
2020	Sunset - 185RK, 186BH, 212RB, 222RB, 242BH, 251RK, 253RB, 259RL, 260SI, 262BH, 272BH, 285CK, 288BH, 289QB, 291RK, 330SI, 331BH, 336BH	L5350204 - L5350608

Parts Required: None

Tools Required: - Nut Driver

Note – Check serial number on Key Express to verify the campaign is open. Some vehicles were repaired before they left Keystone.

When performing warranty or recall service, please make certain that appropriate Personal Protective Equipment (PPE) is used.

The remedy is to inspect the installation of the breakaway wiring at the Bargman 7-way box mounted on the drawbar frame. If needed, move ring terminal from the charge line to the blue brake wire terminal.

REPAIR INSTRUCTIONS

Step 1

Locate the trailer on a level, flat, hard surface. Chock the wheels.

Step 2

Disconnect the 120 VAC and 12 VDC power sources.

Step 3

Remove the cover to the Bargman 7-way distribution box and inspect the installation of the breakaway wire. See Figures 1 & 2.

Step 4

If the breakaway wire is connected to the black charge line, remove it and install it on the blue brake wire.

Step 5


Test the breakaway by briefly pulling the breakaway plunger.

PLEASE NOTE: pulling the breakaway plunger for an extended period of time can cause damage to the braking system.

Re-install the Bargman 7-way distribution box cover.

ELECTRICAL WIRING - BARGMAN CORD

Fig. 1

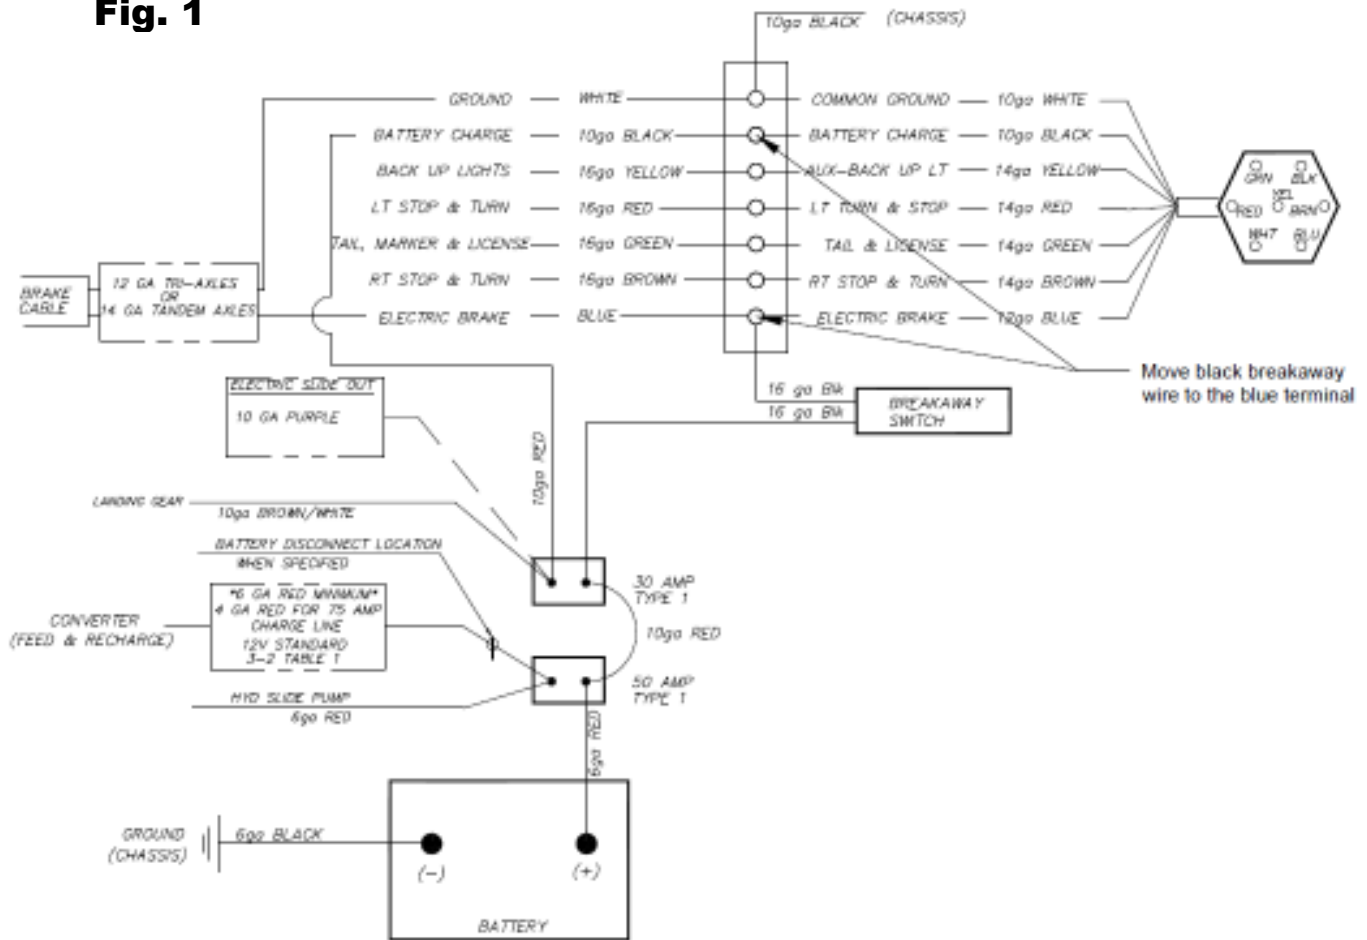

Step 6

Proceed to warranty reimbursement below.

WARRANTY REIMBURSEMENT

REPAIR

Submit the claim on Key Express using **Flat Rate Code # 7135742B**

In the Complaint section note: Safety Advisory # 19-357

In the Cause section note: Breakaway was incorrectly wired.

In the Correction section note: Moved Breakaway wire from charge line to brake wire.

The amount of time authorized for this repair is **.5 hour**.

Please call Keystone RV Customer Service at **844-361-8455** if you have any questions.