



IMPORTANT SAFETY RECALL NOTICE

NHTSA Recall No. 19V-613

October 18, 2019

[REDACTED]

This important safety recall notice applies to your vehicle with the following Vehicle Identification Number ("VIN"):

[REDACTED]

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act. McLaren Automotive Incorporated ("McLaren") has decided that a defect that relates to motor vehicle safety exists in certain Model Year 2018-2019 McLaren Senna vehicles. According to our records, you are the owner of one of those vehicles.

WHAT IS THE ISSUE?

McLaren has determined that a branch of the Senna's engine wiring harness can potentially come into contact with a metal link pipe heatshield. If there is contact, there may over time be chafing of the engine harness. If this chafing breaches the harness heatshield wrap and the harness outer sleeving, it could lead to damage to the wires contained within the engine harness bundle. If the wires are damaged, there are a number of potential consequences: (1) the car could enter idle limp mode (significant engine power reduction); (2) there could be a torque limitation (slight engine power reduction); and (3) the engine could stall, which could lead to a risk if a crash. There will be several warnings prior to any stall, including a dashboard warning light, a dashboard warning message, an audio alert signal, and a change in the vehicle's driving characteristics.

In addition, if the engine is not turned off following these warnings, unburnt fuel in the catalyst could lead to increased temperature of the catalyst, resulting in overheating. This could eventually lead to a rupture of the exhaust system, which would allow exhaust gasses to escape. Depending on the location of such a rupture, there could be damage to the vehicle, increasing the risk of a crash.

WHAT MCLAREN WILL DO

To remedy this problem, your McLaren dealer will re-route the wiring harness to assure that it will not come into contact with the heatshield. This will be performed at no cost to you.



WHAT YOU SHOULD DO

At your earliest convenience, please call your McLaren dealer to schedule an appointment to have the remedy performed. We estimate that the procedure will take less than two (2) hours to complete.

OTHER IMPORTANT INFORMATION

If you no longer own the vehicle identified above, please contact McLaren's Client Services department at (855) 202-8815 or clientservicesna@mclaren.com. If possible, please provide us with the name and address of the current owner so we may contact him or her regarding this recall.

If you have any questions or require further assistance, please contact McLaren's Client Services department at (855) 202-8815 or clientservicesna@mclaren.com.

If you believe that McLaren has failed or is unable to remedy the defect without charge within a reasonable time, please contact us at the number shown above. You may also contact the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue, SE, Washington, DC 20590; or call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153); or go to <http://www.safercar.gov>.

If you have leased any of the above-referenced vehicles to another person, Federal regulations require you to send a copy of this notice to the lessee by first-class mail within ten days of your receipt of this notice.

Thank you for your prompt attention to this matter. We sincerely regret any inconvenience that this condition may cause you. Your safety is our highest priority.

Sincerely,

Scott Morgan

VP Fixed Operations

SAFETY RECALL NOTICE



USE THIS INFORMATION FOR ALL INFORMATION

Issued in Accordance
With Federal Law



