TOPIC		RECALL		
	TYPE	CODE	QUESTION	ANSWER
		3022	What vehicles are	Certain 2012-2019 Model Year
Compliance			included in Safety	Volkswagen Golf, Jetta, Beetle
Recall		37M2	Recall 37M2?	vehicles.
1 10 00				Over time, a build-up of silicate on
1				the shift lever micro switch
,				contacts can result in an isolation-
,				like layer that may be interpreted
,				as an open micro switch. This
,				open switch normally indicates
,				that the shift lever is in "P" park
,				position. If the build-up happens,
,				it may be possible to remove the
,				key from the ignition switch
,				without the shift lever being in the
,				"P" park position because the
,				system isn't able to recognize that
,				the vehicle is not in "P" park. This
,				makes the vehicle noncompliant
,				
				and rollaway prevention.
				If the ignition key is removed
,				
,				•
,				
,			What is the safety	
,			concern for Safety	injure people and damage
			Recall 37M2?	property.
				To correct this defect, dealers will
			Safety Recall 3/M2?	I.
,			When will the renair	
,				
				,
,				the vehicle, an audible warning
,				sound and failure message may
,				appear in instrument cluster while
,				the vehicle is in motion, due to the
,				
,				
,				
,				
			Are there any	
,				
				and vernole inspected.
				Owners are advised to always set
	1	İ	Safety Recall 37M2?	the parking brake and follow the
			Recall 37M2? What is the repair for Safety Recall 37M2? When will the repair for Safety Recall 37M2 be available? Are there any precautions I should take because my vehicle is part of	property. To correct this defect, dealers will Install an additional switch and circuit board. The recall repair is FREE. Volkswagen will send a letter as soon as the recall work can be completed on your vehicle. The recall repair(s) will be performed for you for FREE. Yes. If this condition is present in the vehicle, an audible warning sound and failure message may appear in instrument cluster while the vehicle is in motion, due to the micro switch failure (a non-existent "P" Park shift lever position is incorrectly detected). If this happens, owners are advised to contact an authorized Volkswagen dealer immediately and make arrangements to have the vehicle inspected. Owners are advised to always set

		parking instructions as described in the vehicle owner's manual before removing the ignition key.	
	How will I know when I can get my vehicle fixed under Safety Recall 37M2?	Volkswagen will send you a letter via first-class mail when the recall repair is available for your vehicle. Until then, if you have any questions or vehicle concerns, please click here to find a Volkswagen dealer or click here to Contact Us.	