

1199 Superleggera Model Year 2014 1299 Superleggera Model Year 2017 1299 Panigale R Final Edition Model Year 2018 Panigale R Model Year 2015-2017 Safety Recall Bulletin SRV-RCL-19-002

Date: September 26, 2019

To: Dealer Principal, General Manager, Service Manager, North American Dealer

Network

From: Richard Kenton, Technical Director

Eric Bradley, Technical Training and Publications Manager


#### Dear Dealers,

Based on continued quality tests and service reports, it was identified that the engine vapor breather system could operate incorrectly, with possible consequent leakage of engine oil from the Airbox breather tube.

All motorcycles involved in this Safety Recall Campaign will be upgraded by installing the kit part no.69929001A characterized by a new completely redesigned cyclone separator to prevent the operational issues.

### **Application**

The exact list of the frame numbers subject to the CR180 is available on the DCS, in sections:

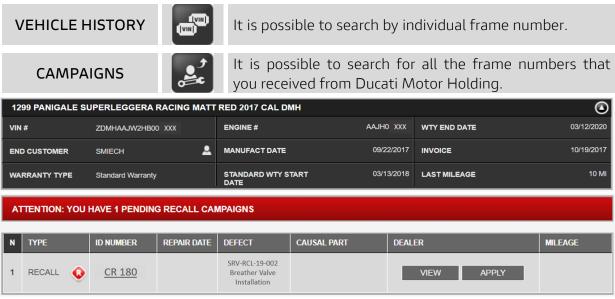



1199 Superleggera Model Year 2014 1299 Superleggera Model Year 2017 1299 Panigale R Final Edition Model Year 2018 Panigale R Model Year 2015-2017 Safety Recall Bulletin SRV-RCL-19-002

### **Customer Impact**

All motorcycles in dealer stock ('to be registered' or 'already registered') and awaiting delivery to final customers must undergo this procedure during pre-delivery operations, before delivery to the final customer. All motorcycles already delivered to final customers must undergo this procedure at the next service appointment.

#### Parts distribution

Kit part no. 69929001A, required to complete the upgrade in accordance with this Safety Recall Campaign must be ordered individually per VIN by the dealer. The required tie straps can be sourced locally and do not need to be ordered through DCS

Special tool part no. 889450108 <u>must NOT be ordered by the dealer.</u> They will be distributed by the Ducati North America directly to each dealer.

### Warranty claim reimbursement rules

The reimbursement for performing this Safety Recall Campaign will take place following the normal warranty claim procedure, using the DCS "Vehicle History" section. The warranty claim is pre-filled and is identified as CR180.

You shall be reimbursed for the cost of the components required and supplied for the repairs (Breather kit part no. 69929001A), and **2h:30 minutes** (**25 labor units**) labor time that includes the time necessary for:

- Vehicle reception
- Installation of the Breather kit part no. 69929001A
- Soft cleaning of the vehicle



1199 Superleggera Model Year 2014 1299 Superleggera Model Year 2017 1299 Panigale R Final Edition Model Year 2018 Panigale R Model Year 2015-2017 Safety Recall Bulletin SRV-RCL-19-002

#### **Table of Contents**


	Page
Introduction	1
Application	1
Customer Impact	2
Parts Distribution	2
Warranty reimbursement rules	2
Spare Parts	4
Service Solution	5
Additional Requirements and Notes	17
Customer Letter Example	18



1199 Superleggera Model Year 2014 1299 Superleggera Model Year 2017 1299 Panigale R Final Edition Model Year 2018 Panigale R Model Year 2015-2017 Safety Recall Bulletin SRV-RCL-19-002

#### **Spare Parts**

The kit part no.69929001A is made up of the following components:

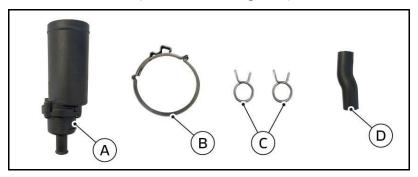

Part no.	Reference	Description	Quantity
69929001A	А	Cyclone separator	1
	В	Click clamp	1
	С	Clamps	2
	D	Rubber hose	1



#### **ATTENTION**

To install the Breather valve kit part no.69929001A, it is necessary to use the special buffer part no.889450108 that will be sent free of charge (1 per each Dealer).

Do NOT enter any order on the DCS for the purchase of the above-mentioned special tool.





1199 Superleggera Model Year 2014 1299 Superleggera Model Year 2017 1299 Panigale R Final Edition Model Year 2018 Panigale R Model Year 2015-2017 Safety Recall Bulletin SRV-RCL-19-002

#### Service Solution



#### WARNING


To ensure the correct execution of the operation within the provided labor time to carry out the updates, it is necessary to follow the sequence indicated in the following instructions



The procedure for the installation of the Breather valve kit part no.69929001A indicated below, refers to the 1299 Superleggera model. Proceed in the same way also for the other models involved in this Safety Recall Campaign.


- 1. Position the vehicle on the rear paddock stand
- 2. Remove the LH side fairing (see Sec. 5: "Fairing installation Fairing" of the Workshop Manual)
- 3. Remove the ignition switch cover (see Sec. 5: "Fairing installation Headlight Fairing" of the Workshop Manual)
- 4. Remove both right and left air conveyer covers (see Sec. 5: "Fairing installation Headlight Fairing" of the Workshop Manual)
- **5**. Remove the battery **cover (1)**




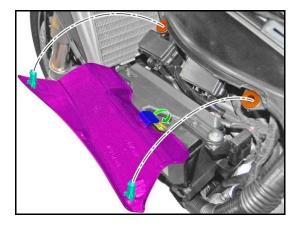



- **6.** Remove the **3 M5x22 screws (2)** and the relevant **spacers (3)** securing the electrical components support
- 7. Remove the 2 big self-locking ties (4)

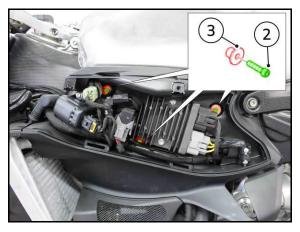

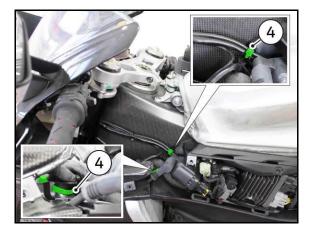


- 8. Disconnect the spark plug cable (5) from the horizontal cylinder coil
- **9.** Remove the big self-locking **tie (6)** securing the ignition switch **connector (7)** to the electrical components support and disconnect the connector









- **10**. Remove the **M6x22 screw (8)** securing the pressure sensor to the electrical components support and slide **nut (9)** out
- 11. Remove the 2 connectors (10) of the voltage regulator

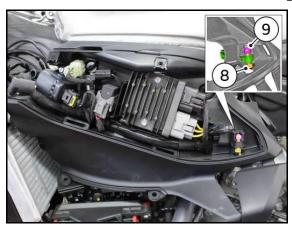




- 12. Remove the rider seat (see Sec.5: "Fairing installation Seat" of the Workshop Manual)
- 13. Remove the 2 M6x14 screws (11) that retain the fuel tank bracket (12) to the rear subframe
- **14.** Lift the fuel tank and keep it lifted using a suitable support taking care not to damage components with the support or impinge the fuel tank into any other components, as shown in the figure

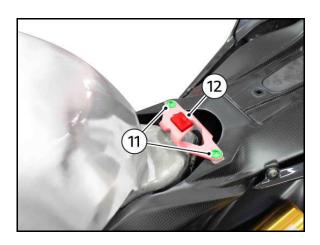


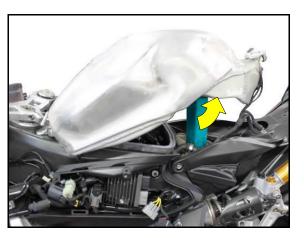




- 15. Disconnect fuel level sensor connector (12) and ground cable (13)
- **16**. Release the BBS control unit from the rear subframe and disconnect **connector (14)**

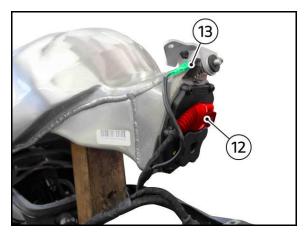

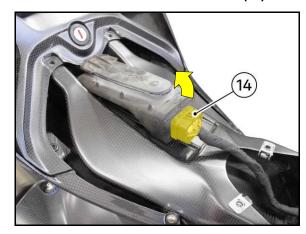

- **17**. Disconnect the rear wiring **connector (15)**
- 18. Pull out the vertical head pressure sensor hose (16) by removing the clamp (17)




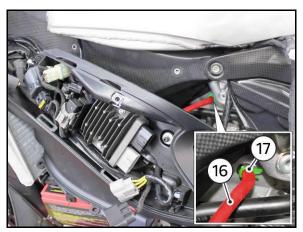





1199 Superleggera Model Year 2014 1299 Superleggera Model Year 2017 1299 Panigale R Final Edition Model Year 2018 Panigale R Model Year 2015-2017 Safety Recall Bulletin SRV-RCL-19-002

19. Disconnect vertical head pressure sensor connector (18)

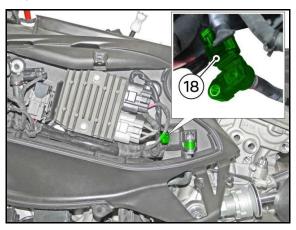

**20**. To access the **cyclone hose (19)**, rotate the electrical components support towards the front side and fasten it with an elastic band, as shown in the figure

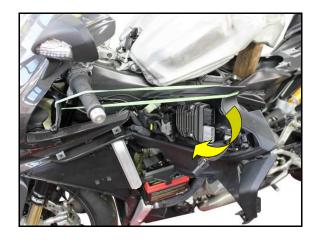

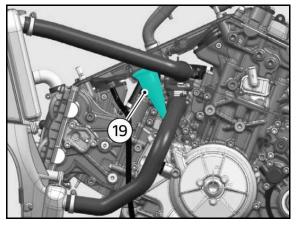



### NOTE

If the adapter hose and junction were installed previously during the performance of SAT-901, remove and discard the additional hose section and junction.





1199 Superleggera Model Year 2014 1299 Superleggera Model Year 2017 1299 Panigale R Final Edition Model Year 2018 Panigale R Model Year 2015-2017 Safety Recall Bulletin SRV-RCL-19-002

**21.** To install the Breather valve kit part no.69929001A it is necessary to modify the cyclone **hose (19)** installed on the vehicle.

Use a marker to make a mark on the cyclone hose (19) at a length of 35 mm measured from the Airbox bottom; use a cutter or workshop scissors to cut the hose in correspondence of the mark previously made with the marker.

**22.** Remove the click **clamp (20)** and pull out the lower part of the cyclone **hose (19)** from the crankcase

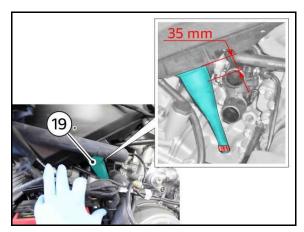

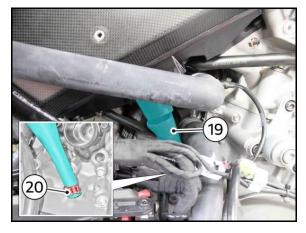


**23**. Take the tool part no.889450108, insert the buffer in the cyclone **hose (19)** driving it fully home and remove the excessive section of hose using a cutter.



#### **ATTENTION**

<u>During the trimming operation, protect the surrounding components around the cyclone hose to avoid damaging the coolant hoses</u>

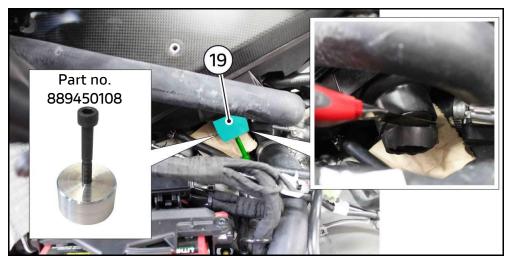



1199 Superleggera Model Year 2014 1299 Superleggera Model Year 2017 1299 Panigale R Final Edition Model Year 2018 Panigale R Model Year 2015-2017 Safety Recall Bulletin SRV-RCL-19-002




#### NOTE

Check that the remaining length of the cyclone **hose (19)** is equal to approx. 30 mm and remove both the protection used and the tool part no.889450108.




**24**. Take the kit part no.69929001A and assemble the **cyclone separator (A)**, the **click clamp (B)**, the **rubber hose (D)** and the **2 clamps (C)** as shown in the figure

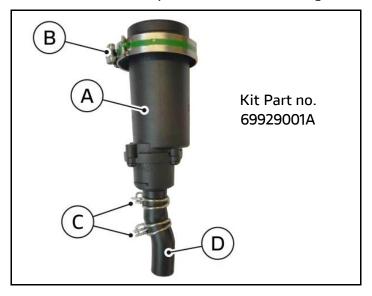





- 25. Install the cyclone separator (A) inside the cyclone hose aiming the stamping towards the vertical head, as shown in the figure. Fasten the cyclone separator using the click clamp (B)
- **26.** Insert the terminal part of the **hose (D)** in the crankcase and aim the **2 clamps (C)** as shown in the figure

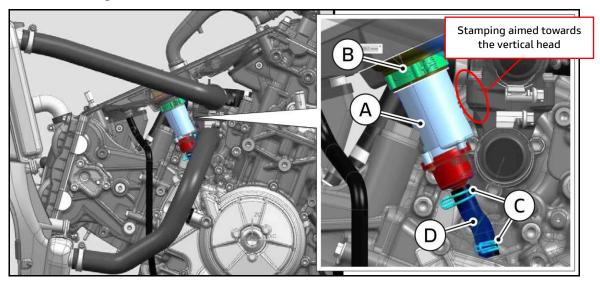


- 27. Remove the elastic band used to rotate the electrical components support
- 28. Connect the rear wiring connector (15)
- 29. Connect connector (14) and reposition the BBS control unit inside the rear subframe

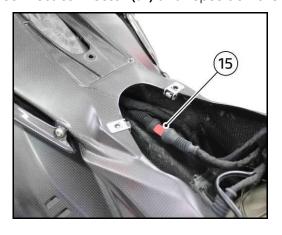


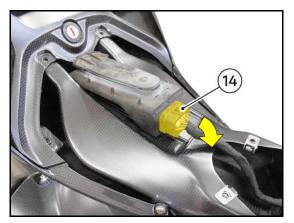





- 30. Connect fuel level sensor connector (12) and ground cable (13)
- 31. Remove the fuel tank support and fit bracket (12) tightening 2 M6x14 screws (11) to 8 Nm ± 10%

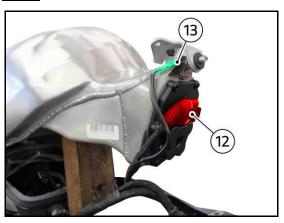

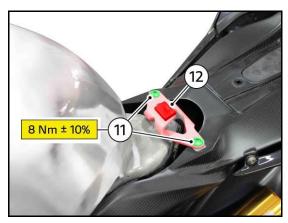

- **32**. Connect vertical head pressure sensor **connector (18)**
- **33.** Connect the vertical head pressure sensor **hose (16)** and fasten it with **clamp (17)** aiming it as shown in the figure

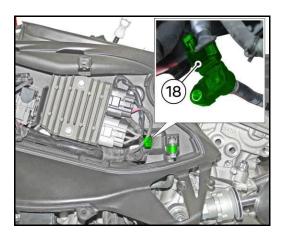


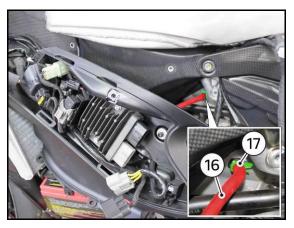




- **34.** Fit the **2 connectors (10)** of the voltage regulator
- **35.** Fasten the pressure sensor to the electrical components support by fitting **nut (9)** and tightening **M6x22 fastening screw (8)** to <u>4 Nm ± 10%</u>



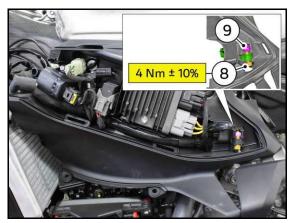


- **36**. Connect the **spark plug cable (5)** of the horizontal cylinder coil
- **37.** Connect ignition switch **connector (7)** and fasten it to the electrical components support using a new **self-locking tie (21)** and aim it as shown in the figure




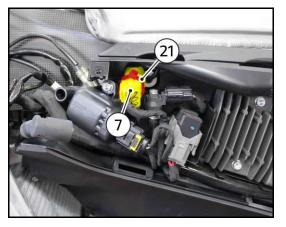




- **38.** Install the electrical components support by starting the **3 M5x22 screws (2)** with the relevant **spacers (3)**. Tighten the **3 M5x22 screws (2)** to **5 Nm ± 10%**
- **39**. Install the 2 new big self-locking ties (22) as shown in the figure

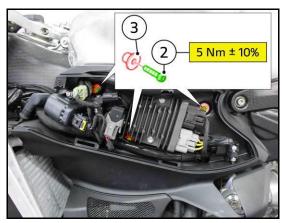

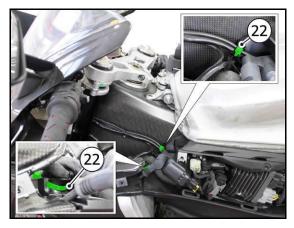

40. Install the battery cover (1) as shown in the figure

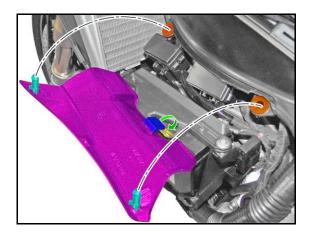





1199 Superleggera Model Year 2014 1299 Superleggera Model Year 2017 1299 Panigale R Final Edition Model Year 2018 Panigale R Model Year 2015-2017 Safety Recall Bulletin SRV-RCL-19-002

- **41**. Fit the LH side fairing (see Sec. 5: "Fairing installation Fairing" of the Workshop Manual)
- **42.** Fit the ignition switch cover (see Sec. 5: "Fairing installation Headlight Fairing" of the Workshop Manual)
- **43.** Fit both right and left air conveyer covers (see Sec. 5: "Fairing installation Headlight Fairing" of the Workshop Manual)
- **44.** Fit the rider seat (see Sec.5: "Fairing installation Seat" of the Workshop Manual)
- **45.** Remove the rear paddock stand

For questions on this Safety Recall Campaign, please contact your Service Area Manager.



1199 Superleggera Model Year 2014 1299 Superleggera Model Year 2017 1299 Panigale R Final Edition Model Year 2018 Panigale R Model Year 2015-2017 Safety Recall Bulletin SRV-RCL-19-002

### Campaign Authorization

Ducati North America, Inc. will mail a notification letter to all known owners. If a customer does not present this notification letter, it is important that you confirm the eligibility for recall status on the DCS before you commence work. Reimbursement requests for duplicate recall campaign repairs will not be accepted.

#### **Dealer Obligation**

This program is designed to complete the necessary repairs and to achieve owner satisfaction. Therefore, we ask that you to take prompt and courteous action in accordance with these directives. Please provide a copy of this communication to every person in your dealership who has recall-related responsibilities. Please direct any questions or concerns to your Service Area Manager.

Thank you for your cooperation.

Service Department Ducati North America, Inc.



1199 Superleggera Model Year 2014 1299 Superleggera Model Year 2017 1299 Panigale R Final Edition Model Year 2018 Panigale R Model Year 2015-2017 Safety Recall Bulletin SRV-RCL-19-002

#### IMPORTANT SAFETY RECALL NOTICE

September 23, 2019

Customer Name Customer Address City, St, Zip Code

Subject:

Ducati Motorcycle: Panigale V4 (all models and country versions)

NHTSA Campaign I.D. Number: 19V-675

Transport Canada Safety Recall I.D. Number: 2019-XXX

Dealer Bulletin: SRV-RCL-19-002

Dear Ducati Owner,

This notice is sent to you in accordance with the requirements of the U.S. National Traffic and Motor Vehicle Safety Act. (For USA Owners). This notice is sent to you in accordance with the requirements of the Motor Vehicle Safety Act. (For Canadian Owners). This is to inform you that your vehicle may contain a defect that could affect the safety of a person. Ducati Motor Holding S.P.A. has decided that a defect which relates to motor vehicle safety exists in certain 2014-2018 Panigale 1199 and 1299 model motorcycles. Our records indicate that you are the owner of a Ducati motorcycle affected by this safety recall campaign. Please take the time to read this letter and help us take the appropriate steps to ensure that your vehicle is operating properly.

### What is wrong?

Based on continued quality tests and service reports, it was identified that the engine vapor breather system could operate incorrectly, with possible consequent leakage of engine oil from the crank-case breather hose. Excessive oil can migrate out of the airbox down the airbox drain hose. The airbox drain hose exits underneath the motorcycle. If an oil leak from the airbox drain hose occurs, this may deposit a small quantity of oil toward the rear tire increasing the risk of crash due to a lack of grip while riding.



1199 Superleggera Model Year 2014 1299 Superleggera Model Year 2017 1299 Panigale R Final Edition Model Year 2018 Panigale R Model Year 2015-2017 Safety Recall Bulletin SRV-RCL-19-002

#### What will Ducati do?

An official Ducati dealer will update the crank case breather system with an updated valve and fluid separator assembly. The Dealer will perform this repair at no cost to you for parts and labor. We request that you contact your authorized Ducati dealer and schedule an appointment, so that the required repair can be performed without delay. The repair will take approximately 2.5 hours to complete. Service time will vary depending on dealer scheduling.

Please, contact your Ducati Service as soon as possible to make an appointment for the update. If there is no visible oil exiting the lower engine area, you may continue to use your motorcycle to reach your Ducati authorized dealer. We recommend riding carefully, avoiding sudden speed changes/accelerations and respecting the speed limits

To locate your nearest authorized Ducati dealer, please go to www.ducati.com, and select the "dealer locator" or you may call toll free from the U.S. 1-888-391-5446.

Federal regulations require that any lessor receiving this recall notice must forward a copy of this notice to the lessee within ten days.

#### Service Problem Help:

If you believe that your dealer has failed or is unable to remedy the defect without charge, or within a reasonable period of time, please contact Ducati North America Customer Care at 1 (888) 391-5446.

If you still cannot obtain satisfaction, you may file a complaint with:

#### For USA Customers:

National Highway Traffic Safety Administration 1200 New Jersey Avenue, SE Washington, D.C. 20590 Or call toll-free hotline at 1-888-327-4236 (TTY 1- 800-424-9153),or go to HTTP://WWW.SAFERCAR.GOV.

#### For Canadian customers:

Please contact Ducati customer service at 1-888-391-5446 or for additional information about the recall you can contact Transport Canada at 1-800-333-0510.



1199 Superleggera Model Year 2014 1299 Superleggera Model Year 2017 1299 Panigale R Final Edition Model Year 2018 Panigale R Model Year 2015-2017 Safety Recall Bulletin SRV-RCL-19-002

#### TREAD ACT CUSTOMER REIMBURSEMENT PLAN

If you have paid for the repair described in the attached letter, and you would like to be considered for reimbursement, please contact your authorized Ducati dealer. Expenses from repair facilities outside of the authorized Ducati dealer network will be considered; however, the procedure must meet Ducati North America's standards.

Your authorized Ducati retailer will request a copy of your owner notification letter, as well as, a copy of your previously paid invoice. They'll inspect the vehicle, if still in your possession, prior to submitting a claim on your behalf to Ducati North America, Inc. for reimbursement.

Only a repair involving this safety recall campaign is reimbursable. Ducati North America, Inc will not reimburse consequential expenses such as towing, rental, accommodations, and damage repairs.

We recommend that your authorized Ducati dealer be your primary contact on this issue. We anticipate that your authorized Ducati dealer will be able to answer any questions that you may have regarding your qualifications for reimbursement of a previous repair; additionally, our Customer Relations Dept. may be contacted at 888-391-5446 for any special assistance required.

We regret any inconvenience to you from this action; however, your safety and satisfaction are important to us.

Sincerely,

Richard Kenton Technical Director – Ducati North America