TECHNICAL INSTRUCTIONS

FOR

SAFETY RECALL JOA, JOB, JOC

FRONT PASSENGER AIRBAG "MODULE" REPLACEMENT ONLY



CERTAIN 2005 – 2008 MODEL YEAR MATRIX


All dealership technicians performing this recall are required to successfully complete the most current version of the E-Learning course "Safety Recall and Service Campaign Essentials". To ensure that all vehicles have the repair performed correctly; technicians performing this recall repair are required to have successfully completed E-Learning course SC18A (if you had previously completed E-Learning Course SC13B, you do not have to take SC18A), in addition to "Safety Recall and Service Campaign Essentials", and currently hold <u>at least one</u> of the following certifications levels:

- Toyota Certified (Electrical)
- Toyota Expert (Any Specialty)
- Master
- Master Diagnostic Technicians

It is the dealership's responsibility to select technicians with the above certification level or greater to perform this repair. Carefully review your resources, the technician skill level, and ability before assigning technicians to this repair. It is important to consider technician days off and vacation schedules to ensure there are properly trained technicians available to perform this repair at all times.


I. OPERATION FLOW CHART

The flow chart is for reference only. *DO NOT* use it in place of the full technical instructions. Follow *ALL* steps as outlined in the full technical instructions to confirm the campaign is completed correctly.

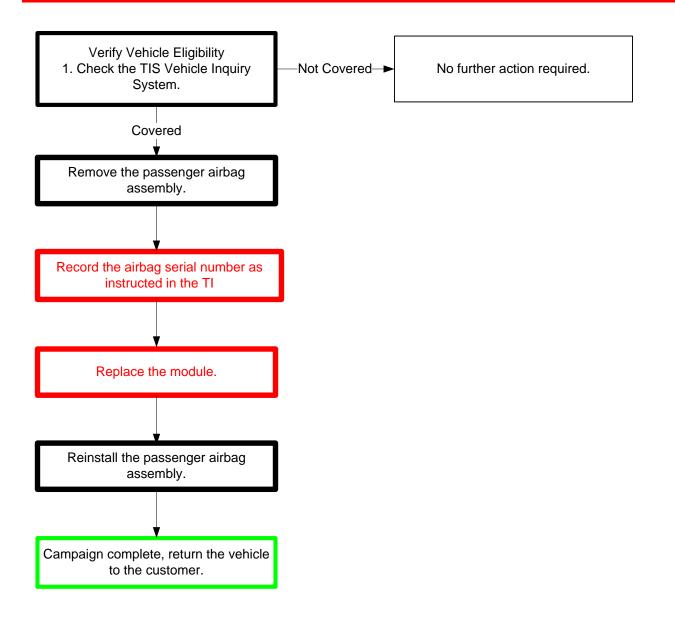

II. BACKGROUND

The subject vehicles are equipped with front passenger airbag inflators which may have been manufactured in such a way as to have a potential for the intrusion of moisture over time. Depending on the circumstances, this could create excessive internal pressure when the airbag is deployed and cause the inflator to rupture. In the event of an inflator rupture, metal fragments could pass through the airbag cushion material, striking the vehicle occupants and potentially resulting in serious injury or death.

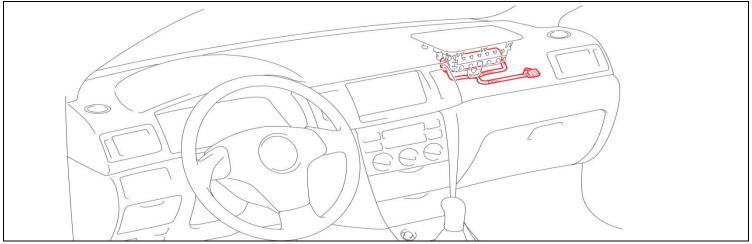

III. IDENTIFICATION OF AFFECTED VEHICLES

- Check the TIS Vehicle Inquiry System to confirm the VIN is involved in this Safety Recall, and that the campaign has not already been completed prior to dealer shipment or by another dealer.
- TMS warranty will not reimburse dealers for repairs conducted on vehicles that are not affected or were completed by another dealer.

IV. PREPARATION

A. PARTS

Applicable for: The Continental U.S. 48 States Only

Model	Part Number	Part Description	Quantity
05-08 Matrix	04005-22901	Instrument Panel Airbag Kit*	1
	*The kit above inclu	ides the following parts.	
	Airbag Mod	ule 1	
Matrix	04005-28112	IP Wire Harness Kit*	1
	*The kit above inclu	ides the following parts.	
	Wire Harne	ss 1	

Applicable for: Alaska, Hawaii and USTT Locations Only

Model	Part Number	Part Description	Quantity
05-08 Matrix	04005-22801	Instrument Panel Airbag Kit*	1
	*The kit above incl	udes the following parts.	
	Airbag Moo	dule 1	
Matrix	04005-28112	IP Wire Harness Kit*	1
	*The kit above incl	udes the following parts.	
	Wire Harne	ess 1	




B. TOOLS & EQUIPMENT

- Standard hand tools
- Torque wrenchTechstream
- Molding remover set

OPTIONAL SST – This is an essential special service tool that the dealership should have. This tool is not mandatory when performing this repair.


	i en ing the repairi	
Part Number	Part Name	Quantity
09890-47010-01	Anti-Static Mat Set	1

DSF CAMPAIGN TOOLS – This tool was provided to the dealership for campaign D0F and will be used for campaign DSF. This tool is required when performing this repair.

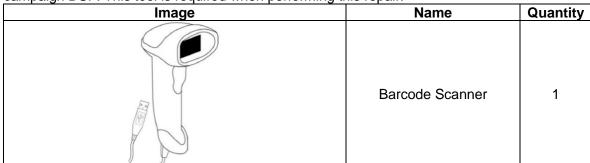


NOTE: This tool *CANNOT* be ordered through the parts or tools system. There is a very limited supply of tools, but if additional tools are needed, contact your regional representative.


V. COMPONENTS

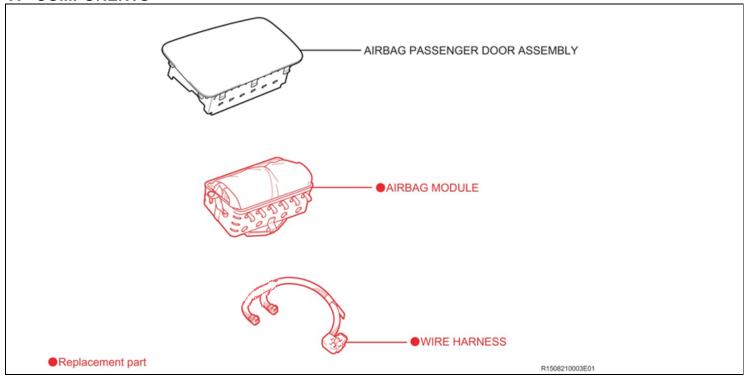

VI. SAFETY PRECAUTIONS

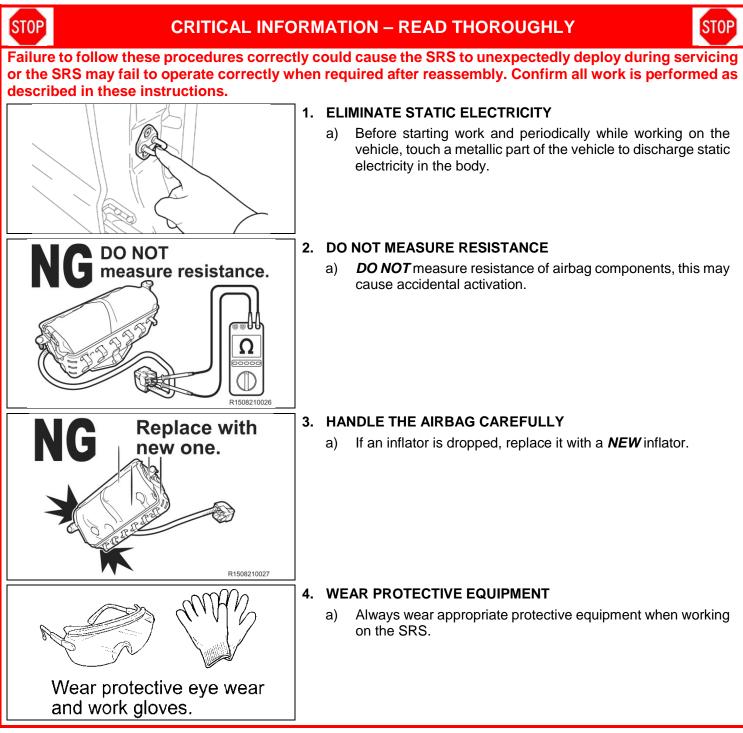

VII. SRS SYSTEM HEALTH CHECK

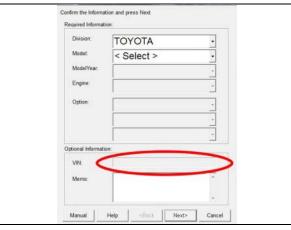

1. PERFORM A HEALTH CHECK

- a) Confirm the Techstream is connected to the dealership's internet.
- b) When launching the Techstream software the VIN **MUST** be entered manually.

NOTE: All letters of the VIN *MUST* be entered in ALL CAPS, or the VIN will need to be reentered when running the diagnostic report.

c) Perform a health check.

The VIN *MUST* be entered manually in ALL CAPS when launching the Techstream software, the VIN MAY *NOT* auto-populate due to vehicle age.

The serial number recording application will be disabled and the repair cannot be completed if a health check and diagnostic report is not performed and recorded by TMS.

VIII. WORK AREA PREPARATION


STOP

ST0P

CRITICAL INFORMATION – READ THOROUGHLY


STOP

The anti-static mat set that is an essential SST may be available at your dealership and is optional to use during inflator replacement. If the anti-static kit is not available, before starting work and periodically while working on the vehicle, touch a metallic part of the vehicle to discharge static electricity in the body.

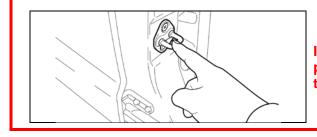

If the anti-static kit is not available, before starting work and periodically while working on the vehicle, touch a metallic part of the vehicle to discharge static electricity in the body.

IX. PASSENGER AIRBAG INFLATOR REPLACEMENT

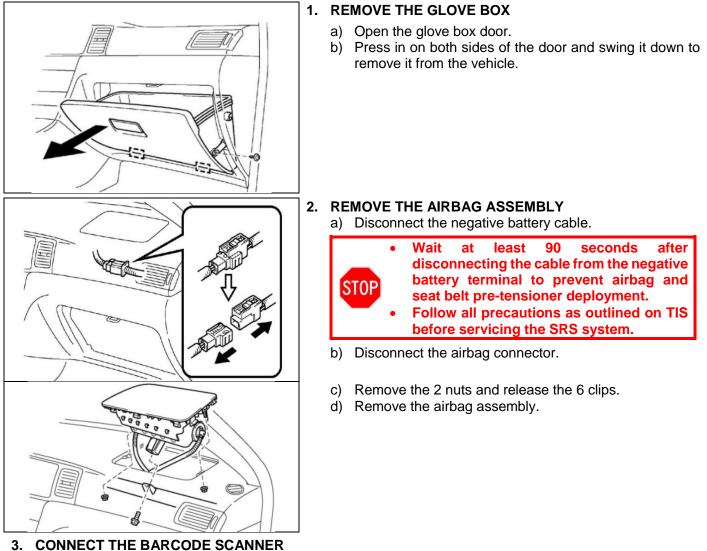


- a) Connect the barcode scanner to the USB port on the Techstream.
- b) The scanner will automatically connect and a beep will be heard when the scanner is ready.

NOTE:

- The scanner was provided for SSC D0F.
- The scanner works best in low light conditions.
- Always hold the scanner directly in front of and parallel to the barcode label.

Campaign Phase Interpretation

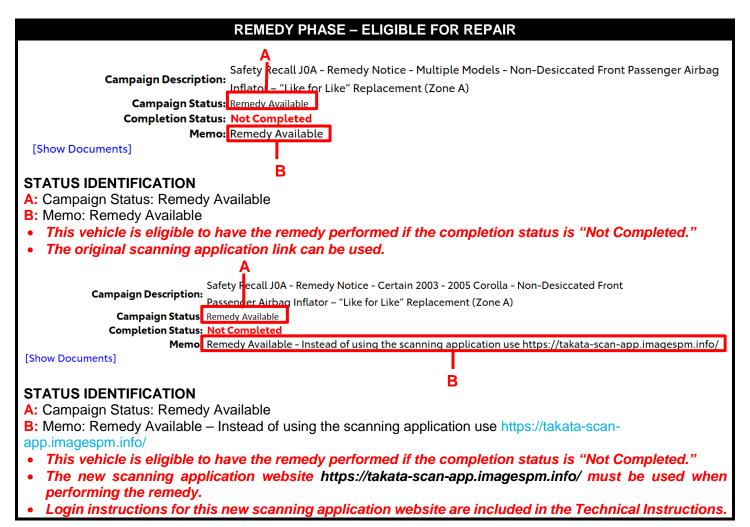

9

4. LAUNCH THE SERIAL NUMBER RECORDING APPLICATION

Search

4. LAUNCH THE SERIAL NUMBER RECORD	
• using the barcode scanner. The barcode scanner application included on every warranty cla may be subject to debit.	MBLY, and NEW ASSEMBLY serial numbers MUST be recorded on MUST be completed on every vehicle. These numbers MUST be aim that is submitted for inflator module replacement or the claim work MUST have an internet connection to perform the inspection
 a) Log into the website via the URL below <u>https://takata-scan-app.imagespm.inf</u> b) User ID: Dealer Code 	
First time login password: xxxxx	
Login Complete all required (*) fields below. * User ID (enter your 5-digit dealer * Password: Login Forgot Password?	r code, or 6-digit for Canadian dealers eg. Cnnnnn format):
Enter or Scan VIN Enter the 17-digit Vehicle Identification Number to begin the search for this campaign. VIN:	c) Enter the VIN into the website

ATTENTION: This information is **CRITICAL**

- a) Scan the **AIRBAG ASSEMBLY** serial number 2 times.
 - 1) Confirm the cursor is in the first serial number box then scan the serial.
 - 2) Position the cursor in the second serial number box then scan the serial.
- b) Click search.

NOTE:

- If both serial numbers that are entered do not match, confirm and reenter.
- If the serial number barcode will not scan, it can be entered manually.

AIRBAG SERIAL NUMBER IDENTIFICATION

- The airbag serial number is *ALWAYS* the 12 *DIGITS* located between the asterisks.
- The 3 digits before the asterisk *ARE NOT* part of the serial number, and *SHOULD NOT* be entered or an inaccurate response may be returned.

Airbag Serial Number Label Example



The AIRBAG ASSEMBLY serial number and the INFLATOR serial number are DIFFERENT. The AIRBAG ASSEMBLY serial number MUST be recorded prior to replacement.




Takata Scan App

TMS Test Dealership


Search Another VIN | Print Screen | Log Out

ORIGINAL Serial Number

Scan or enter the *original* Airbag Assembly Serial Number into the website.

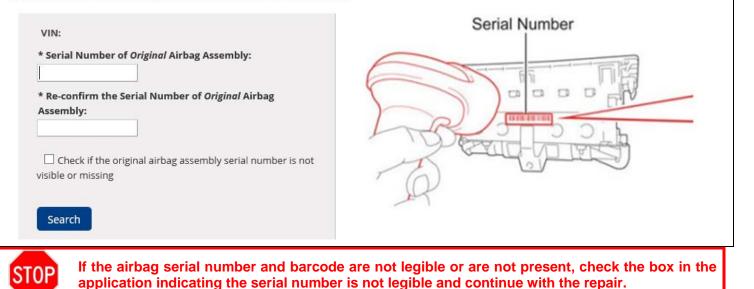

c) Scan the NEW airbag barcode in the Serial N	lumber Recording Application.
	ΟΥΟΤΑ
Takata Scan App	
TMS Test Dealership	Search Another VIN Print Screen Log Out
NEW Serial Number	
Scan or enter the new Airbag Assembly Serial Number into the website.	
VIN:	Serial Number
* Serial Number of <i>New</i> Airbag Assembly: * Re-confirm the Serial Number of <i>New</i> Airbag Assembly: Search	
STOP The new AIRBAG ASSEMBLY serial nur the airbag assembly to the vehicle.	mber <i>MUST</i> be recorded prior to reinstallation to track
d) Record your name, Tech SPIN ID, and mileae) Check the two acknowledgement boxes and	
Additional Information and Agreement	:s
Provide additional information below before proceeding to obtain war	anty authorization number.
VIN: Original Serial: New Serial: Technician Name: Technician ID: Mileage on Vehicle:	
Required Acknowledgements:	
Search	

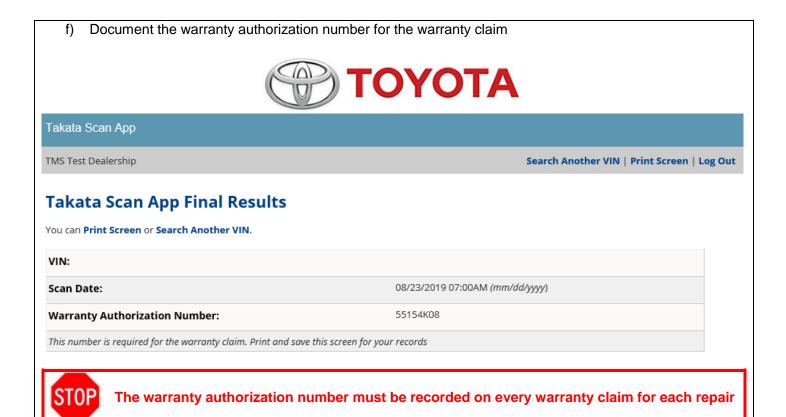

6. NEW SERIAL NUMBER (WEBSITE WILL NOT ACCEPT NEW SERIAL NUMBER)

a) If directed to the sceen below this indicates the serial number entered is not loaded in the system. Confirm if the blue check mark is on the box. If yes, follow the instructions on the screen.

NOTE: Ensure you include a Job Aid and a picture of the Airbag Assembly in your email

Takata Scan App

Administrator

Search Another VIN | Print Screen | Log Ou

NEW Serial Number (confirm if marked label)

NOTE: This serial number 123456789123 is not recognized. This part should be returned to Toyota UNLESS there is a mark on the label (shown below). If there is a mark on the label submit a picture of the airbag assembly and a job aid to quality_compliance@toyota.com and await further instructions.

...OR return to original New Serial Number screen to re-enter another number.

VIN: 2T1BR32E73C118968


Serial Number: 123456789123



X. MODULE REPLACEMENT


1. WORKING WITH AIRBAG

- a) Carefully place the airbag on the bench inflator side up.
 - NOTE: Place clean sheet(s) of paper on the bench to protect the airbag.
- b) Avoid standing directly over the inflator.

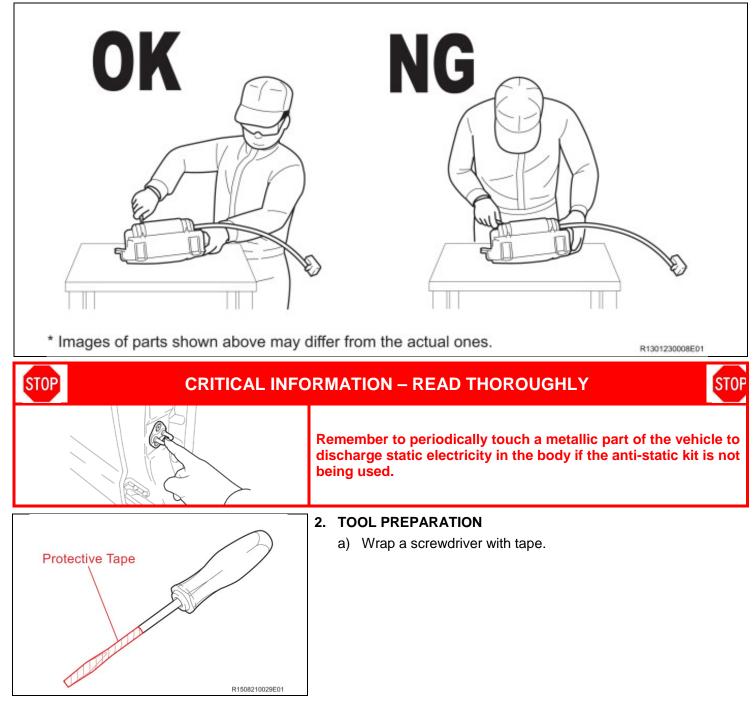

3. REMOVE THE COVER

a) Gently insert the screwdriver between the airbag door and module and disengage the claws holding the door to the module. Please refer to the video below.

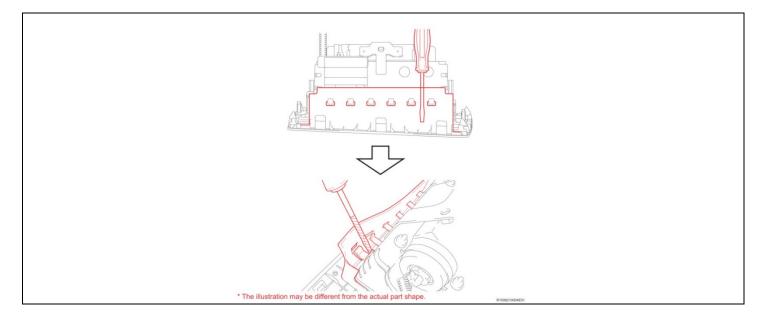


- b) After all the claws have been disengaged separate the module from the door.
- c) Mark the old module so it is not reused.
- d) Inspect the door for damage to the mounting slots.



4. INSTALL THE NEW MODULE

a) Carefully slide the new module into the airbag door.

NOTE: Mounting direction.

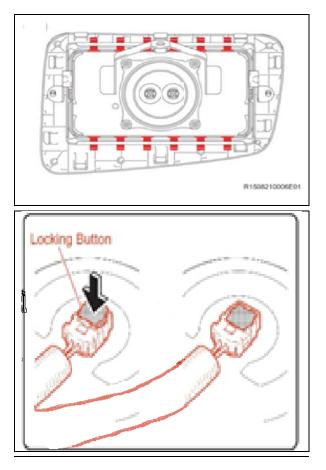

b) Reengage the tangs of the module into the door using the screwdriver with the shaft wrapped in tape.

- c) Connect the new harness to the new module.
- d) Press the lock tab down.

XI. FRONT PASSENGER AIRBAG ASSEMBLY INSTALLATION

1. REINSTALL THE AIRBAG ASSEMBLY

Note: During reinstallation of the airbag assembly, ensure the 12mm bolt and two 10mm nuts securing the airbag assembly to the instrument panel are installed and torqued to the required specification identified on TIS.

a) Refer to TIS for instructions on airbag installation:

Matrix 2005MY 2006MY 2007MY 2008MY

- 2. RECONNECT THE NEGATIVE BATTERY CABLE
- 3. PERFORM A HEALTH CHECK AND DIAGNOSTIC REPORT


◄ VERIFY REPAIR QUALITY ►

- Confirm all precautions are follow to ensure safety during the repair
- Confirm the entire serial number checker application is completed and the warranty authorization # is recorded on EVERY vehicle
- Confirm the old module is handled safely and given to the appropriate parts professional for shipment
 - Confirm the new harness connector is fully engaged and routed correctly.

If you have any questions regarding this update, please contact your regional representative.

XII. APPENDIX

A. CAMPAIGN DESIGNATION DECODER

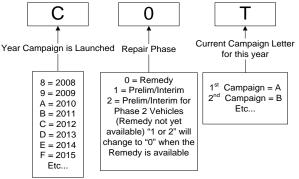

B. CAMPAIGN PARTS DISPOSAL

ALL inflators that are removed from vehicles under this campaign **MUST** be packaged and shipped back to the inflator manufacturer following the manufacturer's instructions. The instructions can be found in the following locations:

• Attached to the dealer letter