OMB Control No.: 2127-0004

Part 573 Safety Recall Report

19V-811

Manufacturer Name: Winnebago Industries, Inc

Submission Date: NOV 13, 2019 **NHTSA Recall No.:** 19V-811 **Manufacturer Recall No.:** recall #160



Manufacturer Information:

tion.

Manufacturer Name : Winnebago Industries, Inc

Address: PO BOX 152 Estin 605 W. Crystal Lake Rd. Forest City IA

50436

Company phone: 1-641-585-3535

Population:

Number of potentially involved: 638 Estimated percentage with defect: 100 %

Vehicle Information:

Vehicle 1: 2017-2020 Winnebago and Itasca Vista, Sunstar, Adventurer

Vehicle Type :
Body Style :
Power Train : NR

Descriptive Information: Issue related to one Floor Plan "35F" starting with the 2017 "W2" model year when

an electrical connector was relocated from chassis to above floor.

Production Dates: JUL 21, 2016 - OCT 21, 2019

VIN Range 1 : Begin : NR End : NR Not sequential

Description of Defect:

Description of the Defect: An electrical connector was mounted directly on the floor instead of the

standoff backet it is normally mounted on.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: Should the floor get wet where the electrical connection is mounted to the

floor. The water has the potential to be a conductive path between the hot

and neutral which when energized can cause a fire.

Description of the Cause: Should the floor get wet where the electrical connection is mounted to the

floor. The water has the potential to be a conductive path between the hot and

neutral which when energized can cause a fire.

Identification of Any Warning NR

that can Occur:

Supplier Identification:

Component Manufacturer

Name: NR Address: NR

NR

Country: NR

Chronology:

3-5-18 Customer contacted us about a fire to his coach single incident

10-8-18 Customer contacted us about a fire to his coach 2nd incident

9-16-19 Customer contacted us about a fire to his coach 3rd incident

10-14-19 Safety Committee meet - 3 fire on the same floor plan and origin is in the same area (near furnace). Fire Investigators reports to different causes, Committee wants to understand the cause, investigate and remeet.

10-25 thru 28 -19 3rd fire incident coach brought to Forest City to investigate the cause of the fire. A electrical connector was found mounted to the floor without the stand-off bracket. Determined this was the cause and a more feasible explanation for the other two units that had a fire.

10-29-19 Customer contacted us about a fire to his coach. 4th incident

11-6-19 Safety Committee re-meet and gave the go-ahead to start recall.

11-8-19 a 5th incident is reported

11-13- submitted recall 160 to NHTSA Portal

Description of Remedy:

Description of Remedy Program: NR

How Remedy Component Differs The electrical connector will be mounted on a metal bracket -vs- mounted

from Recalled Component: directly on the floor

Identify How/When Recall Condition The electrical connector will be mounted on a metal bracket -vs- mounted

was Corrected in Production: directly on the floor

Recall Schedule:

Description of Recall Schedule: Notification dates bill be posted after we print and assemble the mailing

envelopes

Planned Dealer Notification Date : NR - NR Planned Owner Notification Date : NR - NR

* NR - Not Reported