OMB Control No.: 2127-0004

Part 573 Safety Recall Report

19V-843

Manufacturer Name: Harley-Davidson Motor Company

NHTSA Recall No.: 19V-843

Manufacturer Recall No.: 0175



Manufacturer Information:

Manufacturer Name: Harley-Davidson Motor Company

Address: 3700 W. Juneau Avenue

Milwaukee WI 53201-0653

Company phone: (414) 343-4056

Population:

Number of potentially involved: 12,624 Estimated percentage with defect: 1 %

Vehicle Information:

Vehicle 1: 2019-2019 Harley-Davidson Trike: FLHTCUTG, FLRT, FLHTCUTGSE

Vehicle Type: MOTORCYCLES

Body Style : OTHER Power Train : GAS

Descriptive Information: All 2019 Trike models (FLHTCUTG, FLRT, FLHTCUTGSE) are included in the recall

population. These models were produced with traction control system software (within the electro-hydraulic control unit (EHCU)), which will be updated. The

specific number of this make/model/model year is: 9067

Production Dates: MAR 12, 2018 - JUN 20, 2019

Vehicle 2: 2020-2020 Harley-Davidson Trike: FLHTCUTG, FLRT, FLHTCUTGSE

Vehicle Type: MOTORCYCLES

Body Style : OTHER Power Train : GAS

Descriptive Information: All 2020 Trike models (FLHTCUTG, FLRT, FLHTCUTGSE) within these build dates are

part of the recall population. These models were produced with traction control system software (within the electro-hydraulic control unit (EHCU)), which will be

updated. The specific number of this make/model/model year is: 3557

Production Dates: MAR 03, 2019 - NOV 05, 2019

Description of Defect:

Description of the Defect: The Trike Traction Control System software used on the subject motorcycles

may respond incorrectly to a faulty rear wheel speed signal by activating one of

the rear brakes.

FMVSS 1: NR

FMVSS 2: NR

Description of the Safety Risk: Unintended activation of one rear brake could lead to an unexpected change

in vehicle direction which may increase the risk of a crash.

Description of the Cause: There is an error in the electro-hydraulic control unit (EHCU) software.

Identification of Any Warning The traction control indicator (TC) may have remained continuously lit in

that can Occur: conjunction with the fault indicator lamp.

Supplier Identification:

Component Manufacturer

Name: Robert Bosch LLC Address: 38000 Hills Tech Dr.

Farmington Hills MICHIGAN 48331

Country: United States

Chronology:

See attached chronology.

Description of Remedy:

Description of Remedy Program: Owners of affected motorcycles will be asked to arrange service with an

authorized Harley-Davidson dealer, who will confirm that the motorcycle is covered by this recall. If covered, the dealer will install a new software download. This service will be provided at no charge to the customer. Pursuant to 49 CFR577.11(e), Harley-Davidson requests that it be exempt

from providing a notification of a reimbursement plan. Any prenotification product failure would have been addressed under the

manufacturer's limited warranty. Accordingly, no person would be eligible

for reimbursement pursuant to 573.13.

How Remedy Component Differs The new EHCU software download removes or disables the software

from Recalled Component: routine that causes this unintended activation of a rear brake.

Identify How/When Recall Condition Beginning on or about 11/25/2019, production vehicles will receive

was Corrected in Production: updated EHCU software.

Recall Schedule:

Description of Recall Schedule : Harley-Davidson will notify the dealer network on or about 11/25/2019.

Owner notification letters will be sent beginning on or about

12/02/2019.

Planned Dealer Notification Date : NOV 25, 2019 - NOV 25, 2019 Planned Owner Notification Date : DEC 02, 2019 - DEC 06, 2019

* NR - Not Reported