

MERCEDES-BENZ USA, LLC One Mercedes-Benz Dr. Sandy Springs, GA 30328 Phone: (770) 705-0600 Fax: (770) 705-0117 MBUSA.com

newschannel update

TO: Mercedes-Benz Dealer Principals, General	FROM: Gregory Gunther, Department Manager,
Managers, Sales Managers, Service Managers, Parts	Vehicle Compliance and Analysis, Engineering
Managers	Services
RE: Recall Campaign 2017120018	
Launch Notification	
Seatbelt Guide Loop Retrofit (2 of 2)	DATE: March 23, 2018
MY 18 190	
(AMG GT-Class Roadster)	

IMPORTANT NEW RECALL CAMPAIGN LAUNCH UPDATE

 (\mathbb{A})



RECALL CAMPAIGN LAUNCH NOTIFICATION

Campaign No. :	Campaign Desc. :	Sootbolt Cuido Loop (Boodstor)	
2017120018	1712P91D34	Seatbelt Guide Loop (Roadster)	
(AMG GT-Class Roadster) vehicles.	The recall campaign will be vi gged in VMI as "OPEN" on Ma	dditional components to the seatbelt guidance on 738 MY 2018 Model 190 isible on the <u>www.safercar.gov</u> website and may generate questions from arch 23, 2018. An additional notification, 2017120017, applies to AMG GT-Coupe vehicles.	
Background			
Issue	certain AMG GT-Clas loop during normal c	Daimler AG ("DAG"), the manufacturer of Mercedes-Benz vehicles, has determined that on certain AMG GT-Class vehicles (190 platform), the seat belt may bind within the seat belt guide loop during normal operation. The resulting slack in the seatbelt could impair the restraint function of the seatbelt.	
What We're Doing		MBUSA will conduct a voluntary recall. An authorized Mercedes-Benz dealer will retrofit an additional component to the seatbelt guide loop.	
Parts Parts are available and may be ordered.			
Vehicles Affected			
Vehicle Model Year(s)	2018	2018	
Vehicle Model	AMG GT-Class	AMG GT-Class	
Vehicle Populations			
Total Recall Population	738	738	
Total Vehicles in Dealer Invent	t ory 202	202	
MBUSA Internal Vehicles	3	3	
covered by this notification until th and Work Instructions will Loaner and demon	e vehicle has been repaired. be available in Star TekInfo. nstrator vehicles may continu a violation of Federal Law for	 sell or lease any <u>new</u> MY18 AMG GT-Class vehicles in dealer inventory Once remedy parts are available, the vehicles will be flagged as "OPEN" Once the repair is complete, the vehicle may be sold or leased. ue to be driven, but must not be retailed until repaired. r <u>car rental companies</u> to rent new MY18 AMG GT-Class vehicles covered il the vehicle has been repaired. 	
Next Steps/Notes			
Customer Notification Timelin	e Customer letters	are scheduled to be mailed in early April, 2018.	
AOMS/SOMS	AOMs – This reca your dealers ASA	III may generate questions from your dealers. Please forward this notice to P.	
Rental Fleet Partners	-	ffect vehicles in your fleet. Please contact your respective MBUSA fleet or further information and next steps. For repairs, please contact your A dealer.	
• •	•	s determined to maintain a high level of vehicle quality and customer the Customer Assistance Center at 1-800-FOR-MERCEDES.	

Recall Campaign Bulletin



Campaign No. 2017120018, March 2018

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT:Model 190 Model year 2018Retrofit seat belt guide on driver's seat and front passenger seat (roadster)

Daimler AG ("DAG"), the manufacturer of Mercedes-Benz vehicles, has determined that on certain AMG GT-Class vehicles (190 platform), the seat belt may bind within the seat belt guide loop during normal operation. The resulting slack in the seatbelt could impair the restraint function of the seatbelt. MBUSA will conduct a voluntary recall. An authorized Mercedes-Benz dealer will retrofit an additional component to the seatbelt guide loop.

Prior to performing this Recall Campaign:

- Please check VMI to determine if the vehicle is involved in the Campaign and if it has been previously repaired.
- Please review the entire Recall Campaign bulletin and follow the repair procedure exactly as described.

Please note that Recall Campaigns **do not expire** and may also be performed on a vehicle with a vehicle status indicator.


Approximately 676 vehicles are involved.

Order No. P-RC-2017120018 This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records. Recall Campaign Bulletin

Recall Campaign Bulletin

ng 1 k V pai Re lica

Recall Campaign Bulletin

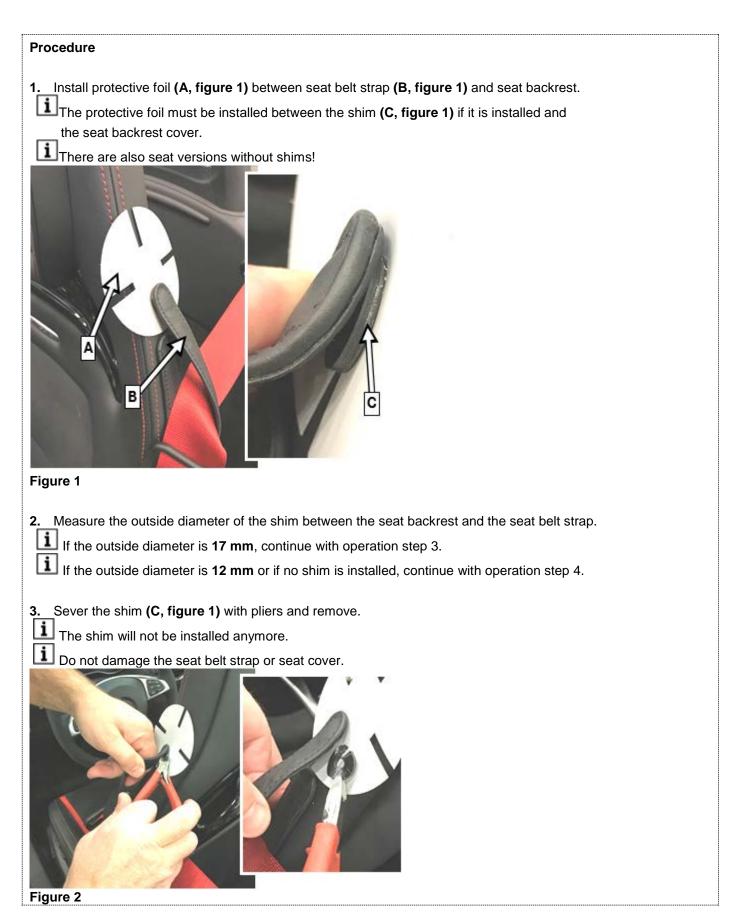

4. Place cutting template (D, figure 3) for marking the cutting edge on the seat belt strap.

Place the rounding of the cutting template flush with the radius of the seat belt strap at the top.

Mark cutting edge on the inner side of the seat belt strap.

After positioning, hold the template on the cutting edge.

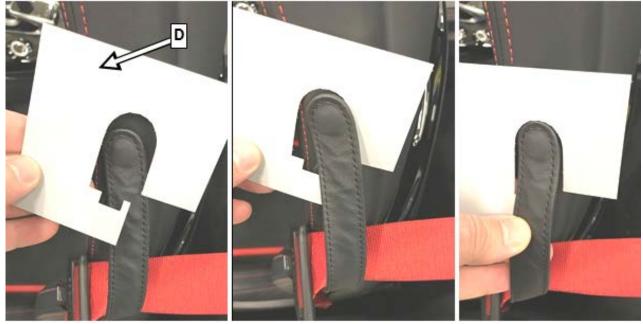
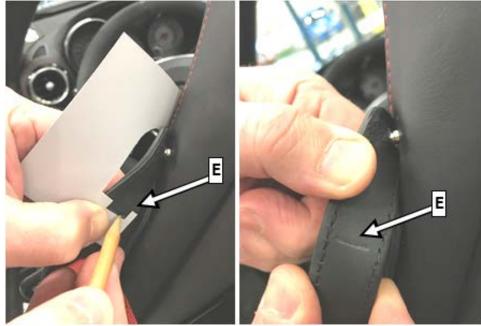


Figure 3

i

i

5. Turn the seat belt strap over with the template positioned and mark the cutting edge on the inner side (E, figure 4).





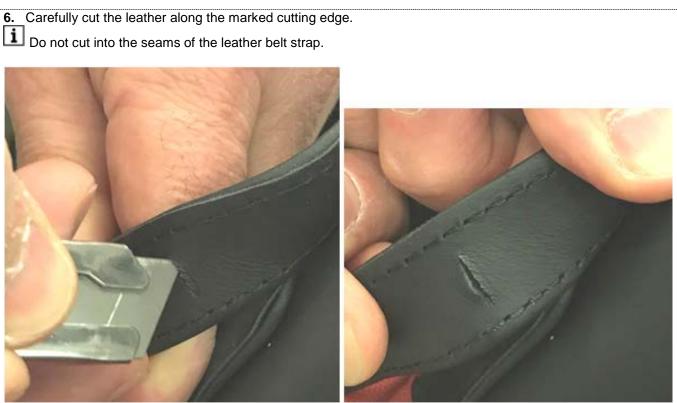


Figure 5

7. Only for seat belt straps with 12 mm shims that are still installed: Break seat belt guide at the perforation and deburr the broken edge.

i For seats without a shim, continue with **operation step 8**.



Figure 6

8. Insert the seat belt guide completely into the notched seat belt strap and then push upwards towards the seat belt strap rivet. i

If a previous version is installed, remove it and replace it with the current version.



Figure 7

9. Thread in the lower edge (F, figure 8) of the seat belt guide under the seat belt strap.

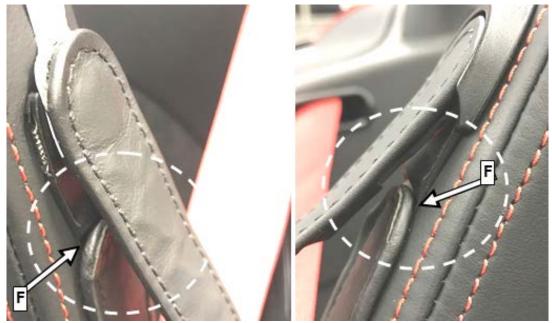


Figure 8

10. Slide the protective foil (G, figure 9) between the seat belt strap and seat belt guide.
 This makes it possible to insert the upper part without twisting the seat belt strap.

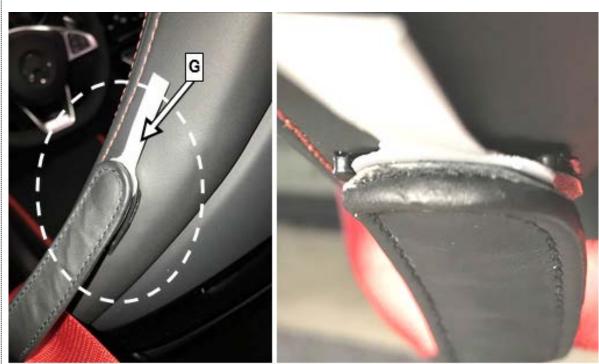


Figure 9

11. Slide the protective foil (A, figure 10) over the attachment rivet between the seat belt guide and the seat cover.



Figure 10

12. Place the upper part of the seat belt guide (H, figure 11) and make it engage with the lower part with two to three teeth. i

The wider side of the upper part (J, figure 11) must be installed against the direction of travel!

7

There are different upper parts for the left and right seat in the parts kit!



Figure 11

i

13. Take out the protective foil (G, figure 9) and place the protective cap (K, figure 12) on the seat belt strap end and hold it.

I The protective cap is used later when the upper and lower part of the seat belt guide are bonded to protect the seat belt strap.



Figure 12

14. Install the supplied needle on the adhesive and apply adhesive to the engaging parts on the left, right and top on the retaining bridges for the catch tabs of the upper part.

i After applying adhesive, remove the protective cap.



Figure 13

15. Insert plastic strip into the lower part of the seat belt guide and completely engage the upper part with the lower part.

i Then remove the protective foil.





16. Repeat operation steps 1 to 15 on the opposite seat belt strap.



Operation Number labor times are subject to change.