OMB Control No.: 2127-0004

Part 573 Safety Recall Report

20V-061

Manufacturer Name: Hyundai Motor America

NHTSA Recall No.: 20V-061

Manufacturer Recall No.: 188



Manufacturer Information:

Manufacturer Name: Hyundai Motor America

Address: 10550 Talbert Avenue

Fountain Valley CA 92708

Company phone: 800-633-5151

Population:

Number of potentially involved : 476,111 Estimated percentage with defect : 100 %

Vehicle Information:

Vehicle 1: 2007-2010 Hyundai Elantra

Vehicle Type: LIGHT VEHICLES

Body Style : 4-DOOR Power Train : GAS

Descriptive Information: The subject vehicles include certain model year 2007 through 2010 Hyundai Elantra

vehicles produced between July 14, 2006 and November 23, 2010 by Hyundai Motor

Company ("HMC") in the Republic of Korea.

Production Dates : JUL 14, 2006 - NOV 23, 2010

VIN Range 1 : Begin : NR End : NR Not sequential

Vehicle 2: 2009-2011 Hyundai Elantra Touring

Vehicle Type: LIGHT VEHICLES Body Style: HATCHBACK

Power Train: GAS

Descriptive Information: The subject vehicles include certain model year 2009 through 2011 Hyundai Elantra

Touring vehicles produced between October 15, 2008 and December 06, 2010 by

Hyundai Motor Company ("HMC") in the Republic of Korea.

Production Dates: OCT 15, 2008 - DEC 06, 2010

Vehicle 3: 2007-2008 Hyundai Entourage

Vehicle Type: LIGHT VEHICLES

Body Style: VAN Power Train: GAS

Descriptive Information: The subject vehicles include certain model year 2007 through 2008 Hyundai

Entourage vehicles produced between February 16, 2006 and June 30, 2008 by

Hyundai Motor Company ("HMC") in the Republic of Korea.

Production Dates: FEB 16, 2006 - JUN 30, 2008

	VIN Range 1:Beg	in:	NR	End:	NR	☐ Not sequential
	Vehicle 4: 20 Vehicle Type: LIG Body Style: SU Power Train: GA	GHT VEHICLES V				
	Descriptive Information: The subject vehicles include certain model year 2007 Hyundai Santa Fe vehicles produced between August 8, 2006 and December 8, 2006 by Hyundai Motor Company ("HMC") in the Republic of Korea.					
	Production Dates: AU VIN Range 1:Beg		NR	End:	NR	☐ Not sequential
Description of Defect :						
	Description of the Defect :	module that r	emains energiz	zed who	en the vehicl	Lock Brake System ("ABS") e is turned off. If moisture short circuit could gradually
	FMVSS 1 : FMVSS 2 :					
Ι	Description of the Safety Risk :	risk of a "key-		npartm		there could be an increased e short circuit does not affect
	·	has not yet be powered, an e	een identified; l	noweve	er, because tl	he ABS module electrical circuit ne ABS module is continually while the vehicle is turned off.
	Identification of Any Warning that can Occur :	NR				
Supplier Identification :						
	Component Manufacturer					
	Name: Hyundai Mobis Address: 203, Teheran-ro					
	Gangnam-gu Seoul Country : Korea, Republic of	-	orea FOREIGN	STATE	S 06141	
Chronology :						

Please see Attachment A for the requested chronology.

Description of Remedy:

Description of Remedy Program: Hyundai Motor America plans to notify owners of affected vehicles to

return their vehicles to their Hyundai dealers to install a relay in the vehicle's main junction box. This procedure will be performed at no

charge.

Hyundai will provide reimbursement to owners for repairs according to

the plan submitted on May 16, 2018.

How Remedy Component Differs The new relay will power down the ABS module when the vehicle's

from Recalled Component: ignition switch is turned OFF.

Identify How/When Recall Condition The ABS system was changed starting with model year 2011 Elantra was Corrected in Production: vehicles in November 2010, model year 2012 Elantra Touring vehicles in

December 2010, and model year 2007 Santa Fe vehicles in December 2006. Hyundai Entourage vehicle production ceased after the completion

of model year 2008.

Recall Schedule:

Description of Recall Schedule: Dealers and owners will be notified in early April 2020.

Planned Dealer Notification Date: APR 03, 2020 - APR 03, 2020 Planned Owner Notification Date: APR 03, 2020 - APR 03, 2020

* NR - Not Reported