



GROUP  
**Safety Recall Campaign**

MODEL  
**2013-2014MY  
Optima (QF)  
2.4L/2.0L-T GDI**

NUMBER  
**SC187 (Rev 2, 12/09/2020)**

DATE  
**June 2020**

## SAFETY RECALL CAMPAIGN


SUBJECT:

### LOW-PRESSURE FUEL FEED TUBE INSPECTION AND REPAIR/REPLACEMENT (SC187)

#### \* NOTICE

**This bulletin has been revised to include additional information. New/revised sections of this bulletin are indicated by a black bar in the margin area.**

This bulletin provides the procedure to inspect and either repair or replace the low-pressure fuel tube assembly on some 2013-2014MY Optima (QF) vehicles produced at KMMG from November 15, 2012 through December 18, 2013. The material of the low-pressure fuel tube may deteriorate over time and develop a crack from exposure to heat generated within the engine compartment under certain circumstances. If the fuel tube develops a crack, a fuel smell and eventually a fuel leak can occur. A fuel leak increases the risk of a fire. Dealers are to inspect the low-pressure fuel tube for damage and/or leaking as outlined in this bulletin. If damage and/or leaking is found, the low-pressure fuel tube is to be replaced with a new one. If no damage or leaking is found, a heat-protective tape is to be installed at the connection between the low-pressure fuel tube and the fuel pump for added protection. Before conducting the procedure, verify that the vehicle is included in the list of affected VINs.

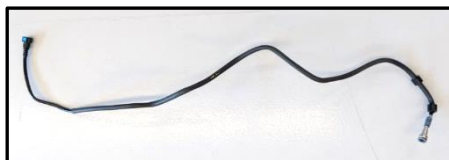

#### \* NOTICE

**There is no charge to the vehicle owner for this repair. Under applicable law, you may not sell or otherwise deliver any affected vehicle until it has been repaired pursuant to the procedures set forth in this bulletin.**

#### \* NOTICE


**To assure complete customer satisfaction, always remember to refer to WebDCS Warranty Coverage (validation) Inquiry Screen (Service → Warranty Coverage → Warranty Coverage Inquiry) for a list of any additional campaigns that may need to be performed on the vehicle before returning it to the customer.**

Printed TSB copy is for reference only; information may be updated at any time.  
Always refer to KGIS for the latest information.

Circulate To:  General Manager  Service Manager  Parts Manager  
 Service Advisors  Technicians  Body Shop Manager  Fleet Repair

SUBJECT: **LOW-PRESSURE FUEL FEED TUBE INSPECTION AND REPAIR/REPLACEMENT (SC187)**


**Flowchart:**

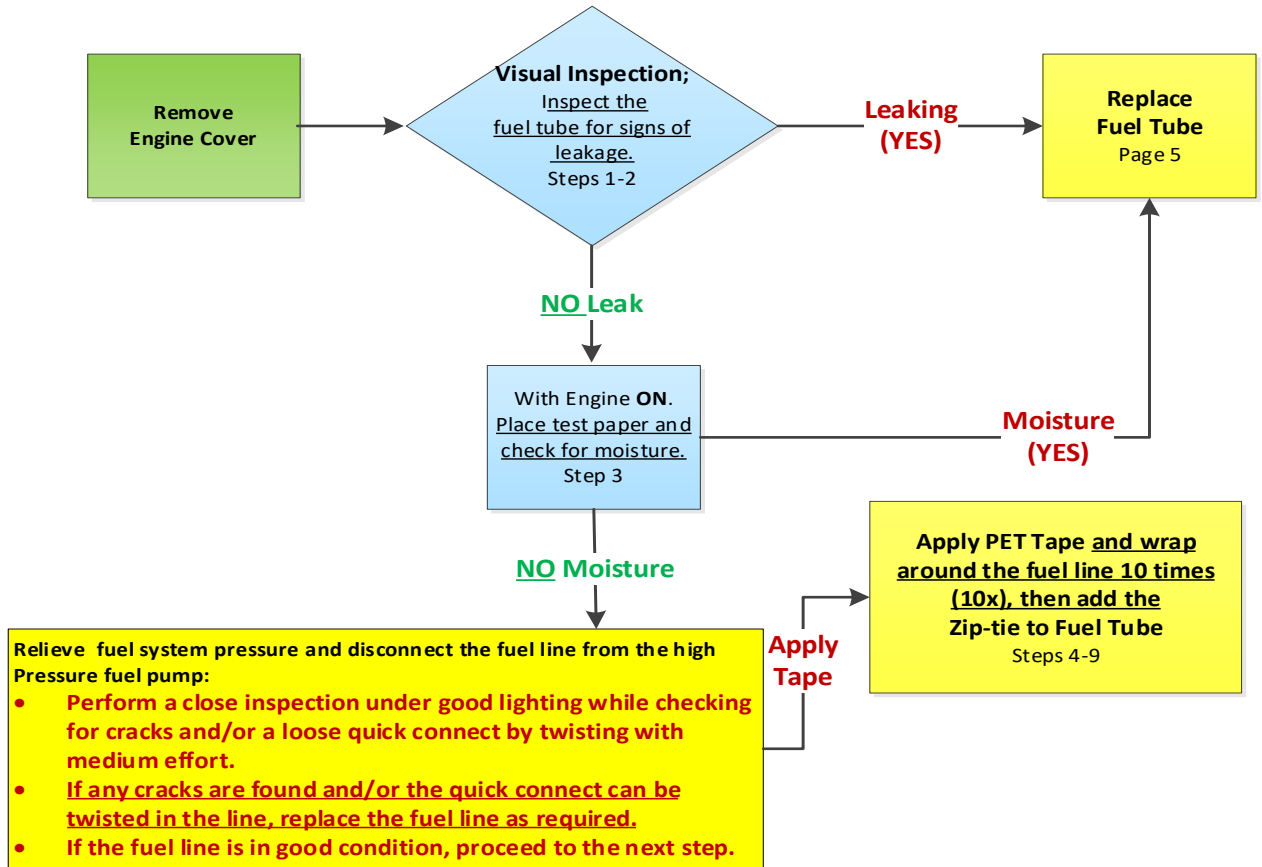

**Inspection and Fuel Line Taping Procedure:**

1. Open hood and remove engine cover.


Note: 2.4L GDI shown for demonstration purpose. Refer to the applicable Shop Manual on KGIS for more details and/or 2.0L-T application.

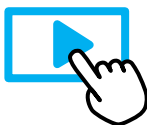

[Video should be reviewed prior to inspection and repair.](#)




- 2a. Locate the fuel line (A) connector and visually inspect for leak in the outlined area shown.
- 2b. If fuel line IS leaking, refer to page 5 to replace the fuel line.
- 2c. If fuel line is NOT leaking, proceed to step 3 for further inspection.

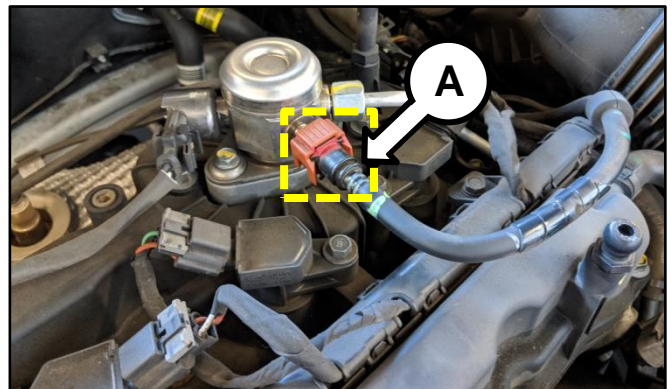

SUBJECT:

## LOW-PRESSURE FUEL FEED TUBE INSPECTION AND REPAIR/REPLACEMENT (SC187)

- 3a. Start the engine and allow it to idle.
- 3b. Place the test paper under the fuel line (A) connector area shown and check for moisture on the paper, indicating presence of a leak.

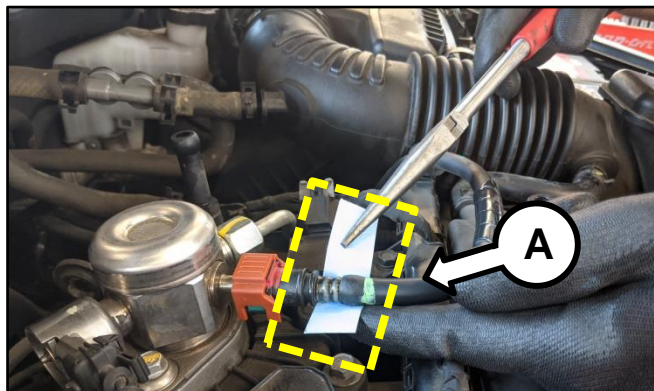



- 3c. If moisture is NOT present, turn the engine OFF and proceed to step 4 to tape and cable tie the fuel line.




- 3d. If moisture IS present, turn engine OFF and proceed to the fuel line 'Replacement Procedure' outlined on page 5.



4. On the fuse box located next to the air cleaner assembly, remove the 20A Fuel Pump relay (B).

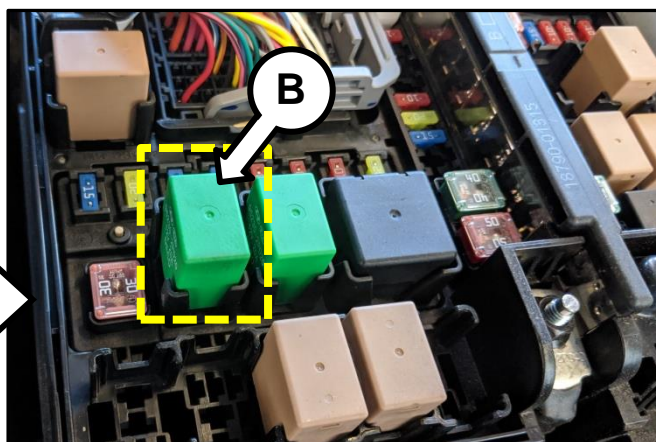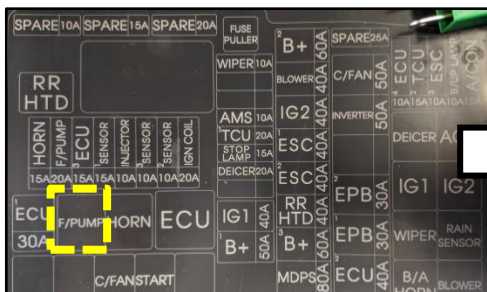

- 5a. Disconnect the high-pressure fuel pump (C) electronic connector (D).
- 5b. Attempt to start the engine to relieve fuel system pressure.

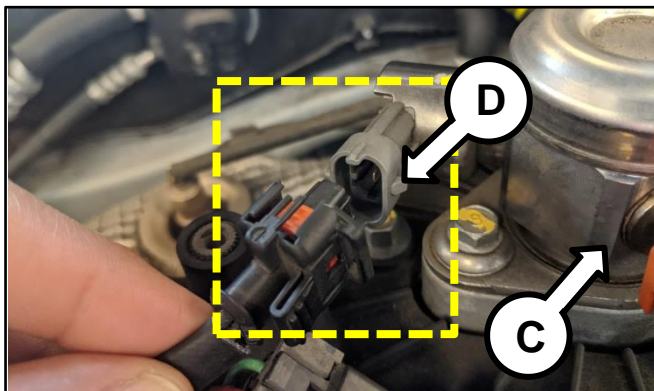

SUBJECT:

## LOW-PRESSURE FUEL FEED TUBE INSPECTION AND REPAIR/REPLACEMENT (SC187)

- 6a. Place a clean rag underneath and disconnect the fuel line (A) from the high-pressure fuel pump (C).

### \* NOTICE



Perform the inspection in a well-lighted shop or use bright flashlight during the inspection.

- 6b. **Carefully inspect the full circumference of the fuel line, inspecting for small cracks and attempt to rotate the quick connect fitting, if the quick connect rotates with medium effort, replace the fuel line.**

If the internal green connector or secondary orange lock is damaged/broken, then replace the fuel line.

- If the fuel line is in good condition proceed to Step 7.


7. Using the supplied PET tape, **tightly wrap the fuel line (A) in between the area shown below ten times (10x).**

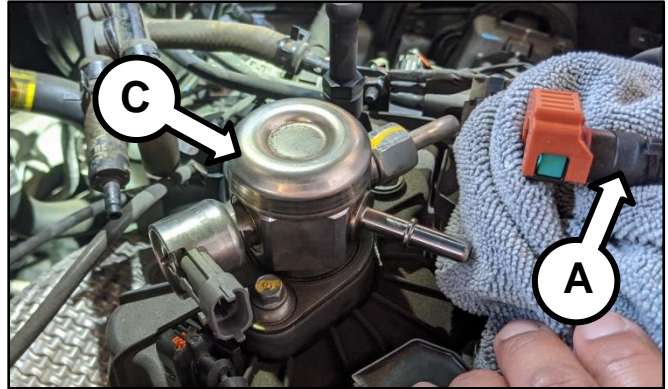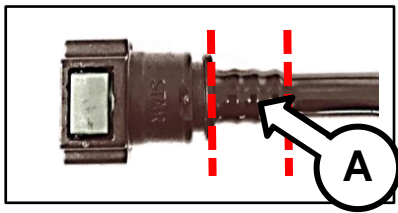

- 8a. **Secure the tape to the fuel line with a cable tie (E) as shown.**

- 8b. Reinstall the fuel line (A) to the high-pressure pump. Ensure to insert fully to lock in place and confirm engagement.

- 8c. Re-connect the high-pressure fuel pump connector (D).

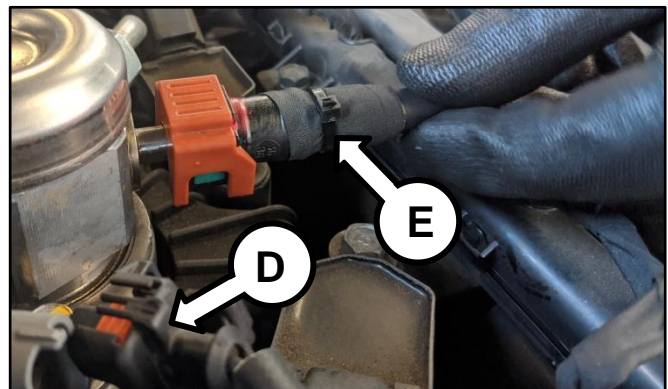

SUBJECT:

## LOW-PRESSURE FUEL FEED TUBE INSPECTION AND REPAIR/REPLACEMENT (SC187)

- 9a. Reinstall the fuel pump relay.
- 9b. Start the engine and allow it to idle.
- 9c. Confirm that no leak is present using test paper.
- 9d. Install the engine cover.
- 9e. Check for any DTC's stored during the procedure.





### Replacement Procedure:


#### \* NOTICE

**Ensure that the engine is not running and the ignition is in the OFF position. Vehicle will need to be lifted and lowered on a lift during this procedure. Refer to the applicable Shop Manual on KGIS for more details and/or 2.0L-T application. Note: 2.4L GDI shown for demonstration purposes.**

1. On the fuse box located next to the air cleaner assembly, remove the 20A Fuel Pump relay (A).

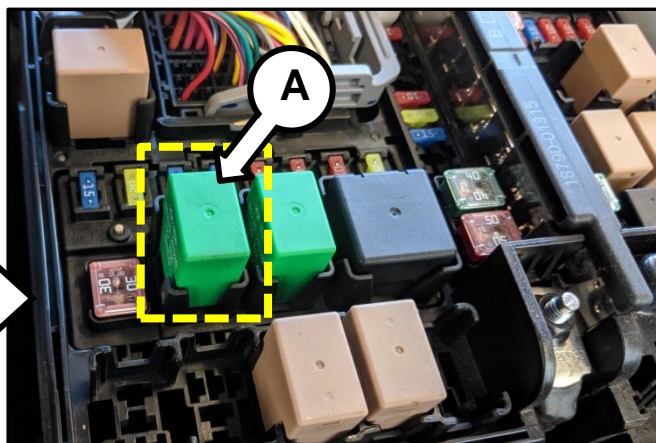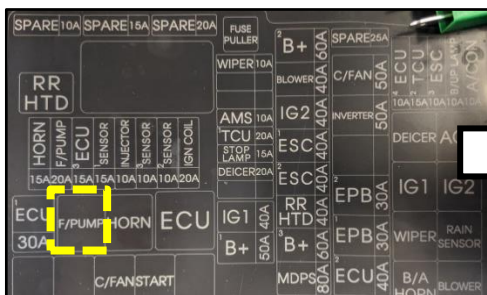


2. Remove the air cleaner assembly (B).

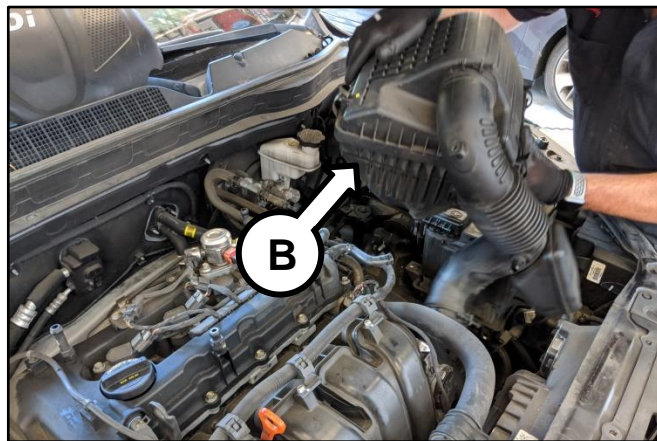


SUBJECT:

## LOW-PRESSURE FUEL FEED TUBE INSPECTION AND REPAIR/REPLACEMENT (SC187)

- 3a. Disconnect the high-pressure fuel pump (C) electrical connector (D).
- 3b. Attempt to start the engine to relieve fuel system pressure.

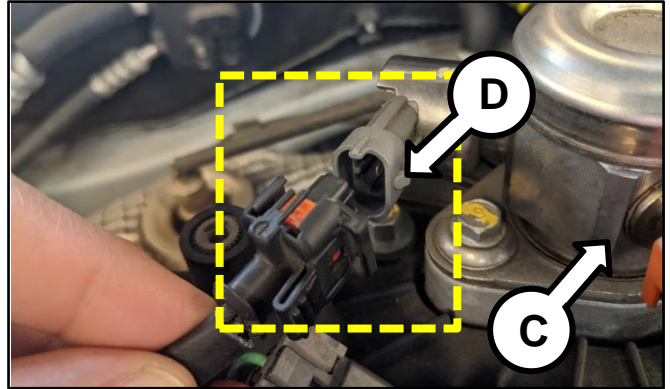

4. Place a clean rag underneath and disconnect the fuel line (E) from the high-pressure fuel pump (C).

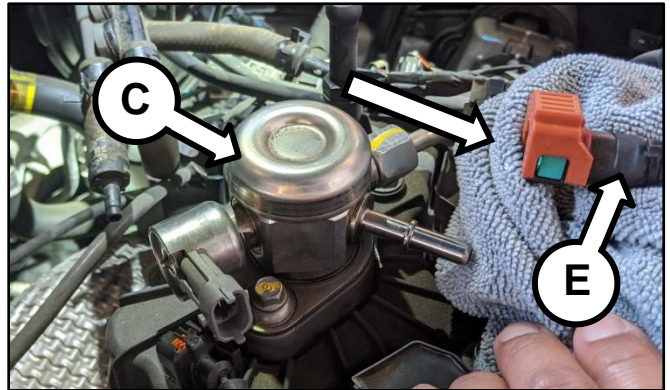

5. Remove/detach the three (3) upper fuel line (E) retaining brackets (2.4L shown).


Note: Fuel line bracket(s) routing for 2.0L-T may differ.



SUBJECT:

## LOW-PRESSURE FUEL FEED TUBE INSPECTION AND REPAIR/REPLACEMENT (SC187)

- 6a. Raise vehicle on lift.
- 6b. Remove the two (2) bottom engine covers.

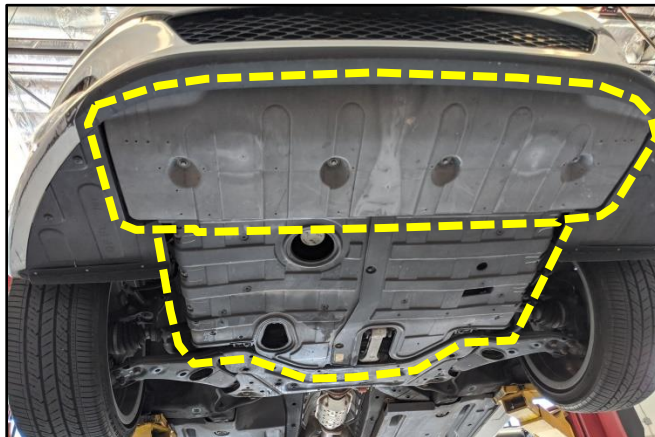


- 7. Remove the left (driver side) bottom cover.



- 8. Detach the front bottom fuel line guard/cover and lower as shown.




- 9a. Detach the fuel line (E) from the retaining bracket.
- 9b. Press the blue tabs to disconnect/release and remove the fuel line (E).

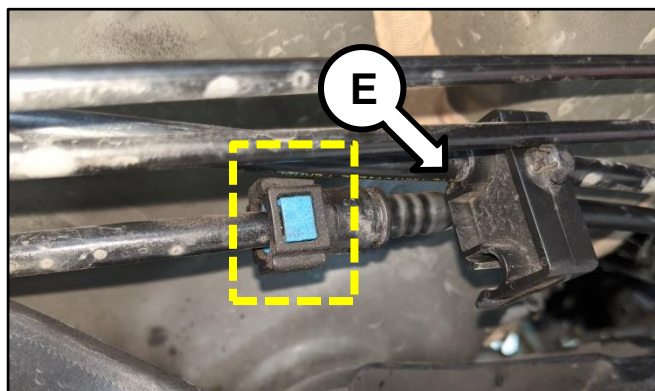

## LOW-PRESSURE FUEL FEED TUBE INSPECTION AND REPAIR/REPLACEMENT (SC187)

10. Install the new fuel line (F) in the reverse order of removal.

Note: Ensure fuel line is fully engaged.

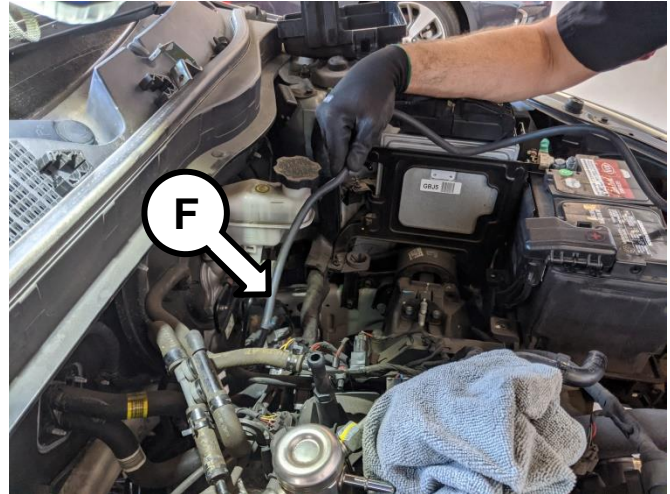

11. Reinstall the fuel pump relay.
12. Start the engine and allow it to idle.
13. Confirm that no leak is present.
14. Install the engine cover.
15. Check for any DTC's stored during the procedure.




SUBJECT:

## LOW-PRESSURE FUEL FEED TUBE INSPECTION AND REPAIR/REPLACEMENT (SC187)




AFFECTED VEHICLE RANGE:

Model	Production Date Range
Optima (QF)	November 15, 2012 through December 18, 2013

REQUIRED PART:

Part Name	Part Number	Figure	Qty.
Fuel Line 2.4L	31310 3Q901QQK		1
Fuel Line 2.0L-T	31310 3Q101QQK		

REQUIRED TOOL:

Tool Name	Tool Number	Figure	Comments
Test Paper	NWPGEN180		Previously auto-shipped to dealers as part of SC172. For order or replacement, contact Snap-on Business Solutions at (888) 542-1011
PET Tape	U1915BK20C		Auto-shipped to Dealers. For order or replacement, contact Snap-on Business Solutions at (888) 542-1011
Cable Tie	CT4BK18-C (3M Hi-Temp)		Source Locally

WARRANTY INFORMATION:

**N Code: N99 C Code: C99**

Claim Type	ENG	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
R	2.4L 2.0L-T	31310 3Q900	0	(SC187) Fuel Line Inspection and Taping.	201A0210	0.3 M/H	N/A	0
	2.4L			(SC187) Fuel Line Inspection and Replacement	201A02R0	1.6 M/H	31310 3Q901QQK	1
	2.0L-T			31310 3Q101QQK				

**Note: If necessary, use sublet code 'X2' for rental expense reimbursement (up to 3 days maximum) for fuel line replacement labor codes only. Use sublet code 'X1' with a maximum allowed amount of \$0.20 for 3M cable tie reimbursement.**

### \* NOTICE

**VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference SC187 when accessing the WebDCS system.**

