

Part 573 Safety Recall Report

20V-151

Manufacturer Name : Automobili Lamborghini

Submission Date : MAR 18, 2020

NHTSA Recall No. : 20V-151

Manufacturer Recall No. : L73X-R.02.20



Manufacturer Information :

Manufacturer Name : Automobili Lamborghini

Address : Via Modena 12
Sant'Agata Bolognese (BO) 40019 -
Italy 00 99999

Company phone : 999

Population :

Number of potentially involved : 26

Estimated percentage with defect : 40 %

Vehicle Information :

Vehicle 1 : 2020-2020 Automobili Lamborghini Aventador SVJ Coupe and Aventador SVJ Roadster

Vehicle Type : LIGHT VEHICLES

Body Style : 2-DOOR

Power Train : GAS

Descriptive Information : Basis for determination was made according to manufacturing records.

Production Dates : DEC 03, 2019 - JAN 22, 2020

VIN Range 1 : Begin : ZHWUM6ZD4LLA09411 End : ZHWUN6ZD1LLA09511 Not sequential

Description of Defect :

Description of the Defect : During the assembly a non properly trained new operator may have not correctly engaged the bowden cable pin inside the internal door handles.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Over time the internal door handle mechanism may fail and the door cannot be unlocked from the inside, posing an entrapment risk. This failure could lead to the inability to operate the handles from inside the vehicle with a safety risk in case of emergency. The outside handles operation is guaranteed by a different component and its functionality is not affected. Therefore, it is still possible to open the doors normally from the outside.

Description of the Cause : Operator error during the manual assembly step of the component component.

Identification of Any Warning that can Occur : No particular warning before the failure.

Supplier Identification :**Component Manufacturer**

Name : NR
Address : NR
NR
Country : NR

Chronology :

On January 2020 during end of line quality checks Automobili Lamborghini S.p.A. verified few cases of non-operative internal door handles. Automobili Lamborghini S.p.A. launched an internal investigation to determine the root cause. Results from the investigation revealed a risk that additional number of vehicles produced between December 2019 and January 2020 may present over time the issue. On March 11, 2020 the matter was presented at the Product Safety Committee where a decision to conduct a safety recall was made.

Description of Remedy :

Description of Remedy Program :	Automobili Lamborghini S.p.A. will notify all owners of affected vehicles and will instruct them to arrange for an appointment with an authorized Lamborghini dealer. Dealers will replace the whole internal door handle free of charge.
How Remedy Component Differs from Recalled Component :	The new door handles installed with appropriate method have guaranteed correct engagement of the bowden cable pin.
Identify How/When Recall Condition was Corrected in Production :	Vehicles produced from January 2020 have since been inspected for properly bowden cable pin engagement and the assembly process was revised and improved in order to prevent unknown variables.

Recall Schedule :

Description of Recall Schedule :	Customers will be notified by registered mail; while dealers through Lamborghini dealer portal.
Planned Dealer Notification Date :	APR 24, 2020 - APR 24, 2020
Planned Owner Notification Date :	MAY 01, 2020 - JUN 01, 2020

* NR - Not Reported