

# Part 573 Safety Recall Report

# 20V-198

**Manufacturer Name :** KTM North America, Inc.**Submission Date :** APR 06, 2020**NHTSA Recall No. :** 20V-198**Manufacturer Recall No. :** TB2011**Manufacturer Information :**

Manufacturer Name : KTM North America, Inc.

Address : 1119 Milan Avenue

Amherst OH 44001

Company phone : 440-985-3553

**Population :**

Number of potentially involved : 3,164

Estimated percentage with defect : 1 %

**Vehicle Information :**

Vehicle 1 : 2019-2020 KTM 790 Adventure

Vehicle Type : MOTORCYCLES

Body Style : OTHER

Power Train : GAS

**Descriptive Information :** The component was only used on KTM 790 79 Adventure and 790 Adventure R models. Affected units were manufactured between February 14, 2019 and December 2, 2019.

Production Dates : FEB 14, 2019 - DEC 02, 2019

VIN Range 1 : Begin : VBKTR3403LM778917 End : VBKTR3400KM758171  Not sequential

Vehicle 2 : 2019-2020 KTM 790 Adventure R

Vehicle Type : MOTORCYCLES

Body Style : OTHER

Power Train : GAS

**Descriptive Information :** The component was only used on KTM 790 79 Adventure and 790 Adventure R models. Affected units were manufactured between February 14, 2019 and December 2, 2019.

Production Dates : FEB 14, 2019 - DEC 02, 2019

VIN Range 1 : Begin : VBKTR3403LM778917 End : VBKTR3400KM758171  Not sequential**Description of Defect :**

**Description of the Defect :** On affected models during operation there is a possibility that the rear brake system may fail under extreme conditions. If the rear brake system fails this may reduce the braking system effectiveness.

FMVSS 1 : NR

FMVSS 2 : NR

**Description of the Safety Risk :** On affected models during use, there is a possibility that the rear brake system may fail under extreme conditions.

**Description of the Cause :** Insufficient heat transfer between the hose and the metal fitting that mounts to the rear brake caliper. The material deviation could lead to a failure of the rear brake system.

**Identification of Any Warning that can Occur :** None

## Involved Components :

**Component Name 1 :** NR

**Component Description :** NR

**Component Part Number :** NR

## Supplier Identification :

### Component Manufacturer

**Name :** J. Juan / Polígono Industrial Camí Ral

**Address :** C/ Miquel Servet, 21-23  
Gavà BARCELONA FOREIGN STATES 08850

**Country :** Spain

## Chronology :

September of 2019 KTM Sportmotorcycle GmbH (the Austrian manufacturer) conducted an investigation of the 790 Adventure/R brake system upon review of customer service claims. Components produced from November 25, 2019, forward have been corrected. As a result of the information received from the supplier, KTM Sportmotorcycle determined a recall should be issued for affected vehicles.

## Description of Remedy :

**Description of Remedy Program :** Official KTM dealers will install a new rear brake line with a longer metal fitting and copper sealing rings must be installed on all affected motorcycles free of charge to the customers or offer reimbursement of previously repaired defects covered by this recall.

**How Remedy Component Differs** A new rear brake line with a longer metal fitting has been developed to

from Recalled Component : improve heat transfer. The new rear brake line along with new copper sealing rings will be installed on all affected motorcycles.

Identify How/When Recall Condition was Corrected in Production : November 25, 2019

### Recall Schedule :

Description of Recall Schedule : KTM North America is notifying all registered owners of the above-affected motorcycles by mail and all authorized KTM dealers via KTM Dealernet an internet based dealer communication system

Planned Dealer Notification Date : APR 06, 2020 - OCT 08, 2021

Planned Owner Notification Date : JUN 01, 2020 - DEC 03, 2021

\* NR - Not Reported