



Mercedes-Benz

Campaign No. 2020070004, August 2020

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **Model E-Class, GLC-Class, and AMG GT-Class 4-doors Coupe (213, 253, and 290)
Model Year 2020****Replace Left Rear Seatback Latch**

Mercedes-Benz AG (“MBAG”), the manufacturer of Mercedes-Benz vehicles, has determined that on certain Model Year (“MY”) 2020 E-Class (213 platform), GLC-Class (253 platform) and AMG GT-Class 4-doors Coupe (290 platform) vehicles equipped with rear seatbacks that can be electrically unlatched, the left rear seatback latch might not meet current production specifications. If the rear seatback latch does not meet specifications, its basic functionality remains, but in the event of a crash, if the cargo area is loaded, the cargo could strike the left rear seatback seat. In this case, a seatback latch failure cannot be ruled out, which could increase the risk of injury to occupants. An authorized Mercedes-Benz dealer will replace the left rear seatback latch on the affected vehicles.

Prior to performing this Recall Campaign:

- **VMI must always be checked before performing campaigns to verify that the campaign is required on a specific vehicle. Always check for any other open campaigns, and perform accordingly.**
- Please review the entire Recall Campaign bulletin and follow the repair procedure exactly as described.

Please note that Recall Campaigns **do not expire** and may also be performed on a vehicle with a vehicle status indicator.

Approximately 1351 vehicles are involved.

Order No. P-RC-2020070004

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Work procedure

1. Replace seat backrest locking function for **left** rear seat

i For basic data for models 213 and 253, see **AR91.12-P-1730LWS**.

i For basic data for model 290, see **AR91.12-P-1730FRX**.

The left cover reinforcement (**A 205 920 60 03 9051**) is very easily damaged during disassembly and must be replaced.

Primary Parts Information

Qty.	Part Name	Part Number
1	Left seat backrest frame lock	A 205 920 05 76
1	Left cover reinforcement	A 205 920 60 03 9051
As required	Left lock cover	*

* The replacement parts must be determined according to the equipment variant for the VIN via the parts process in the Xentry Portal (XPPI).

Warranty Information

Operation: Replace seat backrest locking function for left rear seat (02-1624)

Damage Code	Operation Number	Labor Time (hrs.)
92 950 01 7	02-1624	0.4

i **Note**

Operation Number labor times are subject to change.