



Parts Bulletin

SUBJECT:

**Recall R10029: Front Seat Belt Fastener
2007 – 2018 S60CC, S60L, V60CC, S60, XC60, V60, XC70, V70, S80, S80L**

GROUP: 8	CAT/NO: R10029	REFERENCE BULLETINS: QB R10029	CAR MARKET: US/CAN
COPY TO / CIRCULATIONS (PLEASE INITIAL):			ISSUE DATE: 2020-12-17
GENERAL MANAGER	PARTS MANAGER	SERVICE MANAGER	SALES MANAGER
Page 1 of 1			

“Right first time in Time”

Reference Bulletins: QB R10029

Volvo Car USA LLC and Volvo Car of Canada Ltd (Volvo) on behalf of Volvo Car Corporation, has decided to launch Recall R10029 on certain model year 2007 – 2018 60 Series, 70 Series and 80 Series vehicles.

Volvo has identified an issue regarding the front seat belt fastening, mounted on the outboard side of the front seat. The front seat belt fastening cable may, under certain circumstances, suffer from wear and fatigue if repeatedly bent over the seat cushion. This could cause damage to the cable, which could result in reduced or no seat belt restraint function.

The corrective action is to replace the front driver and passenger seat belt fastener.*

A total of 307,910 U.S. and 24,057 Canadian vehicles are eligible for this recall.

The following part numbers apply:

Part Number	Description	Qty
32341045	End Fitting (Verify the VDN in TIE to ensure Proper quantity is replaced and claimed)	1 or 2
32328849	Block (Passenger side only model specific Refer to QBI/VCC 519962-2)	1

*In rare instances a vehicle may only be equipped with a pyrotechnic seat belt fastener on the driver’s side seat. In this instance it is only necessary to replace the driver’s side end fitting (VDN EI02).