#### OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

# **20V-519**

**Manufacturer Name:** Kia Motors America

Submission Date: AUG 27, 2020 NHTSA Recall No.: 20V-519 Manufacturer Recall No.: SC197



#### **Manufacturer Information:**

Manufacturer Name: Kia Motors America

Address: 111 Peters Canyon Road

Irvine CA 92606

Company phone: 800-333-4542

# **Population:**

Number of potentially involved : 440,370Estimated percentage with defect : 1%

## **Vehicle Information:**

Vehicle 1: 2013-2015 Kia Optima

Vehicle Type: LIGHT VEHICLES

Body Style: ALL Power Train: GAS

Descriptive Information: Certain 2013-2015 model year Kia Optima (QF) vehicles manufactured from July 12,

2013 through October 2, 2015 and certain 2014-2015 model year Kia Sorento (XMa) vehicles manufactured from June 17, 2013 through December 11, 2014 at Kia Motors

Manufacturing Georgia.

The recall population was determined by a review of vehicle production records. The vehicles subject to this recall were not produced in VIN order. Customers seeking information about their specific vehicle will be referred to Kia's Consumer Assistance

Center or their Kia dealer.

[Optima 283,803 vehicles / Sorento 156,567 vehicles]

Production Dates: JUL 12, 2013 - OCT 02, 2015

VIN Range 1 : Begin : NR End : NR Not sequential

Vehicle 2: 2014-2015 Kia Sorento

Vehicle Type: LIGHT VEHICLES

Body Style : ALL Power Train : GAS

Descriptive Information: Certain 2013-2015 model year Kia Optima (QF) vehicles manufactured from July 12,

2013 through October 2, 2015 and certain 2014-2015 model year Kia Sorento (XMa) vehicles manufactured from June 17, 2013 through December 11, 2014 at Kia Motors

Manufacturing Georgia.

The recall population was determined by a review of vehicle production records. The vehicles subject to this recall were not produced in VIN order. Customers seeking information about their specific vehicle will be referred to Kia's Consumer Assistance

Center or their Kia dealer.

[Optima 283,803 vehicles / Sorento 156,567 vehicles]

Production Dates: JUN 17, 2013 - DEC 11, 2014

VIN Range 1: Begin: NR End: NR

☐ Not sequential

# **Description of Defect:**

Description of the Defect: Due to suspected supplier quality deviation issue, brake fluid may leak

internally inside the Hydraulic Electronic Control Unit (HECU) which overtime, can result in an electrical short. An electrical short in the HECU increases the

risk of an engine compartment fire while driving.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: An electrical short in HECU increases the risk of a fire.

Description of the Cause: Leaking brake fluid internally in the HECU

Identification of Any Warning Illumination of the MIL and/or ABS warning light, burning/melting smell,

that can Occur: smoke from engine compartment

#### **Involved Components:**

Component Name 1: HECU

Component Description: Hydraulic Electronic Control Unit: Optima (QF) with Electric Parking Brake (EPB)

Component Part Number: 58920-4C870, 58920-4C550

Component Name 2: HECU

Component Description: Hydraulic Electronic Control Unit: Optima (QF) without EPB

Component Part Number: 58920-2T870, 58920-2T550

Component Name 3: HECU

Component Description: Hydraulic Electronic Control Unit: Sorento (XMa)

Component Part Number: 58920-1U000

# **Supplier Identification:**

# **Component Manufacturer**

Name: Mando America Corporation (Georgia Plant

Address: 955 Meriwether Park Dr.

Hogansville GEORGIA 30230

**Country: United States** 

# **Chronology:**

See attached document titled "Optima and Sorento HECU Chronology"

#### **Description of Remedy:**

Description of Remedy Program : All owners of the subject vehicles will be notified by first class mail with

instructions to bring their vehicles to a Kia dealer. Dealers will be instructed to inspect the HECU for leaking brake fluid in the HECU. If brake fluid is leaking, the HECU will be replaced with a new one. Kia will reimburse owners for repair expenses already incurred pursuant to Kia's

General Reimbursement Plan filed May 11, 2020.

How Remedy Component Differs The remedy component does not leak brake fluid.

from Recalled Component:

Identify How/When Recall Condition The 2016MY Optima (JFa) and Sorento (UMa) vehicles manufactured at

was Corrected in Production: KMMG have HECU's manufactured by a different supplier.

# **Recall Schedule:**

Description of Recall Schedule: The dealer notification is scheduled for October 12, 2020, and the owner

notification is scheduled to begin on October 15, 2020 and end on

October 26, 2020.

Planned Dealer Notification Date : OCT 12, 2020 - OCT 12, 2020 Planned Owner Notification Date : OCT 15, 2020 - OCT 26, 2020

<sup>\*</sup> NR - Not Reported